Waste Tank Summary Report for Month Ending December 31, 1998

Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

FLUOR DANIEL HANFORD, INC.

Richland, Washington

Hanford Management and Integration Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

1	EC	ΛI	n	ISCI	I A I	IR A	o

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

DISCLM-2.CHP (1-91)

Waste Tank Summary Report for Month Ending December 31, 1998

B. M. Hanlon
Lockheed Martin Hanford Corp.

Date Published February 1999

Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

P.O. Box 1000
Richland, Washington

Hanford Management and Integration Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

RELEASE AUTHORIZATION

Document Number:

HNF-EP-0182-129

Document Title:

WASTE TANK SUMMARY REPORT FOR MONTH ENDING DECEMBER

31, 1998

This document, reviewed in accordance with DOE Order 241.1,
"Scientific and Technical Information Management," and 241.1-1,
"Guide to the Management of Scientific and Technical
Information," does not contain classified or sensitive unclassified
information and is:

APPROVED FOR PUBLIC RELEASE

Mark A. Williams

Lockheed Martin Services, Inc.
Document Control/Information Clearance

Reviewed for Applied Technology, Business Sensitive, Classified, Copyrighted, Export Controlled, Patent, Personal/Private, Proprietary, Protected CRADA, Trademark, Unclassified Controlled Nuclear Information.

LEGAL DISCLAIMER. This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, not any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof. This report has been reproduced from the best available copy. Printed in the United States of America.

APPROVALS

Prepared by:

Responsible Manager:

C. DeFigh-Price, Manager Process Engineering

This page intentionally left blank.

WASTE TANK SUMMARY REPORT

B. M. Hanlon

ABSTRACT

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 63 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U. S. Department of Energy-Richland Operations Office Order 5820.2A, Chapter I, Section 3.e. (3) (DOE_RL, 1990, Radioactive Waste Management, U. S. Department of Energy-Richland Operations Office, Richland, Washington) requiring the reporting of waste inventories and space utilization for Hanford Tank Farm tanks.

This page intentionally left blank.

CONTENTS

	Page
St	JMMARY
I.	WASTE TANK STATUS
\mathbf{II}	
Ш	SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS
Aı	opendixes:
A.	WASTE TANK SURVEILLANCE MONITORING TABLES A-1
	<u>Tables</u> :
	1 Watch List Tanks A-2
	2 Additions/Deletions to Watch List Tanks by Year A-3
	3 Temperature Monitoring in Watch List Tanks
	4 Temperature Monitoring in Non-Watch List Tanks
	5 Single-Shell Tanks Monitoring Compliance Status
	7 ENRAF Surface Level Gauge Installation and Data Input Methods
	8 Tank Monitor and Control System (TMACS) Monitoring Status
	C remember and Comment (1221 CO) 122 months of the control of the
В.	DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION
	Tables:
	1 Double-Shell Tank Waste Type and Space Allocation B-2
	2 Double-Shell Tank Waste Inventory
	Figures:
	1 Total Double-Shell Tank Total Inventory B-5
C.	TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS
	1 Tank and Equipment Code/Status Definitions
_	TANTE TARA CONTROL ATTON OTATIO AND FACILITY OF A DEC
D.	TANK FARM CONFIGURATION, STATUS AND FACILITY CHARTS D-1
	Figures: 1 High-Level Waste Tank Configuration
	2 Double-Shell Tank Instrumentation Configuration D-3
	3 Single-Shell Tank Instrumentation Configuration
	4 Hanford Tank Farms Facilities Chart: 200-East Area
	5 Hanford Tank Farms Facilities Chart: 200-West Area
E.	MONTHLY SUMMARY E-1
	1 Monthly Summary
	2 Tank Use Summary
	3 Pumping Record, and Liquid Status and Pumpable Liquid Remaining
	In Tanks
	4 Inventory Summary by Tank Farm E-5 5 Inventory and Status by Tank - Double-Shell Tanks E-6
	6 Inventory and Status by Tank - Single-Shell Tanks E-8
	o mitums, and busine of their business business and their transfer their box
Ŧ	PERFORMANCE SUMMARY F-1
≖.	Table:
	1 Performance Summary F-2
	2 Summary of Waste Transactions in the Double-Shell Tanks F-4
	3 Comparison of Projected Versus Actual Waste Volumes for
	TTC I P Illian.

G.	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE
	FACILITIES
	Tables:
	1 Misc. Underground Storage Tanks and Special Surveillance Facilities (Active). G-2
	2 East Area Inactive Underground Storage Tanks and Special Surveillance
	Facilities (Inactive) G-3
	3 West Area Inactive Underground Storage Tanks and Special Surveillance
	Facilities (Inactive)
H.	LEAK VOLUME ESTIMATES H-1
	Table:
	1 Single-Shell Tank Leak Volume Estimates
т	SINGLE-SHELL TANKS INTERIM STABILIZATION, AND CONTROLLED, CLEAN
1.	
	AND STABLE STATUS
	Tables:
	1 Single-Shell Tanks Interim Stabilization Status
	2 Tri-Party Agreement Single-Shell Tank Interim Stabilization
	Schedule I-5
	Figure:
	1 Single-Shell Tanks Interim Stabilization Progress Summary I-7/8
J.	CHARACTERIZATION PROGRESS STATUS
₹.	Figure:
	1 Characterization Progress Status

M	ETRIC CONV	ERSION CHART		
1 inch	=	2.54 centimeters		
1 foot	=	30.48 centimeters		
1 gallon	=	3.80 liters		
1 ton	=	0.90 metric tons		
	$^{\circ}\mathbf{F} = \left(\frac{9}{5}\right)$	°C)+32		
1 Btu/h = 2.930711 E-01 watts (International Table)				

WASTE TANK SUMMARY REPORT FOR MONTH ENDING DECEMBER 31, 1998

Note: Changes from the previous month are in bold print.

I. WASTE TANK STATUS

Category	Quantity	Date of Last Change
Double-Shell Tanks ^c	28 double-shell	10/86
Single-Shell Tanks ^a	149 single-shell	07/88
Assumed Leaker Tanks	67 single-shell	7/93
Sound Tanks	28 double-shell 82 single-shell	1986 7/93
Interim Stabilized Tanks ^{b,d}	119 single-shell	11/97
Not Interim Stabilized f	30 single-shell	11/97
Intrusion Prevention Completede	108 single-shell	09/96
Controlled, Clean, and Stable ^I	36 single-shell	09/96
Watch List Tanks ^g	22 single-shell 6 double-shell	12/98^k 6/93
Total	28 tanks	

^a All 149 single-shell tanks were removed from service (i.e., no longer authorized to receive waste) as of November 21, 1980.

^b Of the 119 tanks classified as Interim Stabilized, 64 are listed as Assumed Leakers. The total of 119 Interim Stabilized tanks includes one tank that does not meet current established supernatant and interstitial liquid stabilization criteria. (See Table I-1 footnotes, item #2)

^c Six double-shell tanks are currently included on the Hydrogen Watch List and are thus prohibited from receiving waste in accordance with "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510.

d Of the 22 single-shell tanks on Watch Lists, only one (SX-109) has been Interim Stabilized.

Of the 22 single-shell tanks on Watch Lists, only one (SX-109) has completed Intrusion Prevention (this category replaced Interim Isolation). (See Appendix C for "Intrusion Prevention" definition).

¹ Three of these tanks are Assumed Leakers (BY-105, BY-106, SX-104). (See Table H-1)

⁸ See Section A tables for more information on Watch List Tanks.

^h Dates for the Watch List tanks are "officially added to or removed from the Watch List" dates. Eighteen tanks were removed from the Organics Watch List in December 1998; two tanks still remain on this watch list. See Table A-1, Watch List Tanks. for further information.)

¹ The TY tank farm was officially declared Controlled, Clean, and Stable in March 1996. The TX tank farm and BX tank farms were declared CCS in September 1996. (BX-103 has been declared to have met current interim stabilization criteria, and is included in CCS - see also Appendix I).

II. WASTE TANK INVESTIGATIONS

This section includes all single-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

There are currently no tanks under investigation for ILL decreases or drywell radiation level increases which exceed the criteria. Drywell monitoring is done on an "as needed basis" with the exception of tanks C-105 and C-106 which are monitored monthly.

A. Assumed Leakers or Assumed Re-leakers: (See Appendix C for definition of "Re-leaker")

This section includes all single- or double-shell tanks or catch tanks for which an off-normal or unusual occurrence report has been issued, or for which a waste tank investigation is in progress, for assumed leaks or re-leaks. Tanks/catch tanks will remain on this list until either a) completion of Interim Stabilization, b) the updated occurrence report indicates that the tank/catch tank is not an assumed leaker, or c) the investigation is completed.

There are currently no tanks for which an off-normal or unusual occurrence report has been issued for assumed leaks or re-leaks.

B. Tanks with increases indicating possible intrusions:

This section includes all single-shell tanks and related receiver tanks for which the surveillance data show that the surface level or ILL has met or exceeded the increase criteria, or are still being investigated.

<u>Candidate Intrusion List:</u> Increase criteria in the following tanks indicate possible intrusions; however, no funds were allocated for performing intrusion investigations in FY 1999 due to higher priority work in the area of safe storage.

Tank 241-B-202
Tank 241-BX-101
Tank 241-BX-103
Tank 241-BY-103
Tank 241-C-101
Tank 241-U-111

244-AR Tanks and Sumps: Currently, all ventilation systems at 244-AR are shut down. Based on the weight factor gauges for the sumps and tanks, Tank 001 contains 1,300 gallons, Tank 002 contains 12,250 gallons, Tank 003 contains 2,000 gallons, and Tank 004 contains 250 gallons. Sump 001 contains 15.5 gallons, Sump 002 contains 0-2 gallons, and Sump 003 contains 3,300 gallons. There was no change in tank/sump contents as of December 31, 1998. Status of jet pumping: first attempts at jetting were unsuccessful. There is no funding foreseeable for jet pumping in FY99.

Catch Tank 241-AX-152: The liquid level in this catch tank was steady around 66.75 inches from the startup of Project W-030, Tank Farm Ventilation System," in March 1998 until late August 1998. The level then began to decrease. The October reading of 65 inches is 1.75 inches below the summer average. This is an active catch tank, routinely pumped, and deviations from baseline are not applicable per OSD-31. The decrease represents a significant change in trend and it is apparent that tank conditions changed around the end of August 1998.

<u>Resolution Status</u>: Discrepancy Report #98-853 was issued on November 4, 1998. One possible cause under investigation is a change in flow path, causing an increase in evaporation. The tank was pumped down to 2.25 inches on November 13, 1998. Since that time the level has decreased to 0.00 inches. The Discrepancy Report will remain open and the tank will remain on the alert list until an engineering investigation is complete.

III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

1. Single-Shell Tanks Saltwell Jet Pumping (See Table E-6 footnotes for further information)

<u>Tank 241-C-106</u> – Waste removal operations were initiated on November 18, 1998. Commencement of sluicing (sludge removal) began the process of waste removal in the highest heat-generating single-shell storage tank. Wastes from C-106 will be pumped underground through a new specially constructed pipeline to AY-102. The ventilation system for AY-102 is designed for the anticipated heat load of the waste from C-106.

Through mid-December 1998, sluicing of tank C-106 was on hold for evaluation of stack gaseous emissions that occurred during the first sluicing batch on November 18, 1998. A Process Test Plan was developed and conducted on December 16, 1998, to obtain better gas sample data under controlled sluicing conditions. The Process Test was aborted early due to a jumper leak in the tank C-106 sluice pit. Approximately 0.8 inches (2,300 gallons) of sludge was transferred to tank AY-102 during this Process Test. Following the Process Test, temperature readings on the thermocouple tree in Riser 14 increased to approximately 220-225 degrees; this has been attributed to the improved contact between the sludge and the thermocouple tree as a result of sluicing.

<u>Tank 241-SX-104</u> - Pumping resumed October 7, 1998, and was shut down for several periods during each succeeding month for other priority work, transfer of waste, and cold weather problems. 3.7Kgallons were pumped in December; 7,330 gallons of dilution water and 966 gallons of water for transfer line flushes were used during December pumping operations. A total of 162.2 Kgallons has been pumped from this tank.

<u>Tank 241-SX-106</u> – Pumping started on October 7, 1998, and was shut down for several periods during each succeeding month for other priority work, transfer of waste, and cold weather problems. 3.2 Kgallons were pumped in December; 2,846 gallons of dilution water and 1,120 gallons of water for transfer line flushes were used during December pumping operations. A total of 14.9 Kgallons has been pumped from this tank.

Tank 241-T-104 - Pumping resumed on June 7, 1998; 2.1 Kgallons were pumped in December. Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be adjusted as porosity data becomes available with continued pumping; 1,066 gallons of raw water were used during December for pumping operations. A total of 144.8 Kgallons has been pumped from this tank.

<u>Tank 241-T-110</u> - Pumping resumed in July after the pump was replaced; 1.9 Kgallons were pumped in December. Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be adjusted as porosity data becomes available with continued pumping; 786 gallons of raw water were used during December for pumping operations. A total of 39.0 Kgallons has been pumped from this tank.

Saltwell Screens - Saltwell screens have been installed in Tanks S-102, S-106, S-109, and S-111. Screens are expected to be installed in Tank U-103 in January 1999, and in Tank U-102 in February 1999.

2. Single-Shell Tank TPA Interim Stabilization Milestones

All M-41-xx Milestones are being renegotiated. See also Table I-2, Tri-Party Agreement Single-Shell Tank Interim Stabilization Schedule.

3. Tank Waste Remediation System Safety Initiatives

The U. S. Secretary of Energy has directed that six safety initiatives be implemented in the Tank Waste Remediation System Program to accelerate the mitigation/resolution of the high priority waste tank safety issues at the Hanford Site. Forty-two milestones were established for accomplishing the initiatives.

Safety Initiative SI 6d - Initiate C-106 Accelerated Retrieval, was completed on November 18, 1998; however, the letter to DOE-HQ has not been transmitted yet.

The following Safety Initiatives remain to be completed:

SI 4a - Upgrade Alarm Panels in Seven Tank Farms

SI 4c - Complete Accelerated Walk-Downs and Field Verify Essential Drawings Completion dates for Safety Initiatives 4c and 6d have been missed.

SI 4a - An assessment of the Completion Record is being evaluated for this Safety Initiative.

4. Double-Shell Tank 241-SY-101 Waste Level Increase

Although the waste level in tank SY-101 has risen slowing and steadily since last February, the surface level and hydrogen venting are within safety and operating limits. A mixer pump was installed in the tank in July 1993, which circulates liquid wastes from the tank's upper layer down to the bottom where jet nozzles discharge the fluid about two feet from the bottom. This prevents gas bubbles from building up at the bottom, and results in venting of small steady gas releases, rather than in large infrequent gas releases. Investigations continue on why the surface level is rising.

Several void fraction instrument (VFI) readings have been completed which gives the void fraction at depth in the riser through which it is deployed. The VFI readings indicate that the level increase is due to gas trapped in the crust, which comprises the upper approximately 60 inches of waste. The results of the core sampling (of both retained gas sampling and regular cores) and the VFI results, are in agreement.

Resolution Status: On February 11, 1998, the PRC recommended that the DOE-RL declare an Unreviewed Safety Question (USQ) over the continued level growth observed in this tank. The PRC implemented a standing order (SO) that placed operational restrictions on mixer pump operations. The SO released Operations from required actions at waste levels of 402 inches as measured by the Riser IC ENRAF. Riser 1A was rebaselined from 403.65 to 417.5 inches in August, USQ approval #TF-98-0852. Riser 1C has readings of 405.24 inches. DOE has modified the 406-inch and 422-inch mixer pump operational controls to allow additional mixer pump and characterization operations. Tank Farms has implemented TWO Standing Order 99-01 to reflect the relaxation of mixer pump operating controls at 406 and 422 inches. The contractor has established a multi-disciplinary team to solve the level growth issues in SY-101.

5. Closure of Unreviewed Safety Question (USQ) for Organic Watch List Tanks

In October 1998, DOE-RL closed the USQ for Condensed-Phase Organic Nitrate for single-shell tanks, double-shell tanks, and double-contained receiver tanks. This USQ is still open as it applies to inactive miscellaneous underground storage tanks (MUSTs). Closure of this USQ does not resolve the Organic Safety Issue or grant authorization to amend the current Basis for Interim Operation or Authorization Basis.

In December 1998, DOE-RL approved the request to remove the following 18 organic complexant tanks from the organic complexant Watch List: 241-A-101, AX-102, B-103, S-102, S-111, SX-103, SX-106, T-111, TX-105, TX-118, TY-104, U-103, U-105, U-106, U-107, U-111, U-203, U-204. Eight of these tanks are also on the Hydrogen (Flammable Gas) Watch List.

Two tanks (C-102 and C-103), which contain organic solvents, will also remain on the Organic Watch List until DOE receives and analyzes the technical data on resolution of the organic solvent safety issue expected in early 1999.

Twenty-eight tanks are currently on Watch Lists: 25 tanks on the Hydrogen Watch List (19 SSTs and 6 DSTs), 2 tanks on the Organic solvent Watch List, and 1 tank (C-106) on the High Heat Watch List.

6. Characterization Progress Status (See Appendix J)

Characterization is the understanding of the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

Characterization Progress for December:

In December 1998, requirements for closed safety issues such as organic complexants and hazardous vapors were removed. This action has resulted in upgrading the status for 15 tanks (B-101, B-106, B-112, B-201, B-203, B-204, BX-101, BX-109, C-203, SX-113, T-108, TX-107, TY-106, U-201, and U-202) to "complete." No further sampling is required for these tanks.

However, 12 new tanks (AN-102, AN-103, AN-104, AN-105, AN-107, AP-108, AW-101, AY-102, AZ-101, AZ-102, C-104, and C-106) have been added to the requirements matrix as a result of high-and low-level waste requirements for retrieval. This addition has resulted in the downgrading of two tanks (AN-103 and C-104) from being "complete" to being in the sampling and analysis process.

Core sampling in December was done for tank SY-101; the analysis has not been completed. Grab samples were taken from AY-102.

7. New Pumping Estimates for Remaining Single-Shell Tanks Which Are Not Yet Stabilized

Document HNF-2978, "Updated Jet Pump Durations for Interim Stabilization of Remaining Single-Shell Tanks," Rev. 0, dated July 15, 1998, provides the technical bases for the new volume estimates for the remaining twenty-nine single-shell tanks (excluding Tank C-106), which will be interim stabilized. Included are the estimates of the volume by waste phase (supernate, saltcake, sludge) and volumes important to pumping operations (drainable liquid remaining, drainable interstitial liquid, pumpable liquid remaining).

These new volumes have been incorporated in Appendix E of this report. Note that the volumes reported in document HNF-2978 are as of July 1998, and do not reflect pumping which occurred in Tanks SX-104, SX-106, T-104 and T-110 since that date.

8. PMHC-TANKFARM-1998-0156, Off-Normal Occurrence Report, "Potential Inadequacy of Authorization Basis (USQ)," Initial Update December 31, 1998.

On December 31, 1998, the Plant Review Committee (PRC) concluded that a Potential Inadequacy in the Authorization Basis (PIAB) exists.

The Unreviewed Safety Question (USQ) screening results indicate drainage volume from some transfer routes could potentially exceed the assumptions used in the Basis for Interim Operation (BIO) on the volume of liquid that could drain from a pipe in the event of a leak.

Immediate Actions: (1) Stop all waste transfers, (2) Standing Order TWO-99-005 was issued, which describes actions and approvals necessary prior to performing each transfer.

The USQ states: Based on HNF-3612, "Hydraulic Calculations for Cross Site Transfer System and Selected Physically Connected Routes," a larger transfer line drainback of volume than previously analyzed in the Authorization Basis appears to be possible.

During preparation for an upcoming cross-site transfer, piping runs associated with the Cross Site Transfer System were identified that result in larger transfer line drainback volumes than analyzed in the Authorization. The USQ screening determines if the increase in drainback volume represents an analytical error, omission, or deficiency in the authorization basis.

Conclusion: The USQ screening determined that the piping runs available drainback represent a deficiency in the Authorization basis. As other transfer routes (e.g., 244-BX to 241-AP-106) may have piping runs yielding larger drainback volumes than previously analyzed, this PIAB is extended to cover <u>any</u> transfer route. Based on the increased length of pipe leading to larger volume of drainback (i.e., increase the material at risk), a potential deficiency in the Authorization Basis exists that could lead to increased consequences over that previously analyzed for any transfer route.

9. TEMP-NR-001, Off-Normal Report, "241-C-106 Riser #14 Thermocouple Temperature Exceeded 218 Degrees," Notification Report, dated December 29, 1998.

The temperature reported by Riser 14, thermocouple #1 in tank 241-C-106 exceeded the 218-degree limit at 1920 hours through 1994 hours on December 27, 1998. The temperature dropped below 218 degrees at 1944 hours, and can be expected to exceed the 218-degree limit until the sluicing process resumes.

The Administrative Control directs the implementation of a recovery plan if the temperature limit is exceeded. The Recovery Plan directs operations to initiate the following recovery actions:

Stop all waste transfers, verify cover blocks are on the pump pits, start up the 296-P-16 exhauster and inlet air chiller system to enhance waste cooling.

All recovery actions were initiated with the exception of the inlet air chiller system which will not be started until the ambient air temperature increases. This action will be initiated when the ambient temperature is acceptable to prevent damage to the chiller compressors and heat addition from the glycol pumps.

APPENDIX A

WASTE TANK SURVEILLANCE MONITORING TABLES

TABLE A-1. WATCH LIST TANKS December 31, 1998

These tanks have been identified as Watch List Tanks in accordance with Public Law 101-510, Section 3137, "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," (1990). These tanks have been identified because they "... may have a serious potential for release of high-level waste due to uncontrolled increases in temperature or pressure."

		Officially			Officially
Single-Shell Ta	anks	Added to	Double-Shell Tank	S.	Added to
Tank No.	Watch List	Watch List	Tank No.	Watch List	Watch List
A-101	Hydrogen	1/91	AN-103	Hydrogen	1/91
			AN-104	Hydrogen	1/91
AX-101	Hydrogen	. 1/91	AN-105	Hydrogen	1/91
AX-103	Hydrogen	1/91	AW-101	Hydrogen	6/93
			SY-101	Hydrogen	1/91
C-102	Organics	5/94	SY-103	Hydrogen	1/91
C-103	Organics	1/91	6 Tanks		
C-106	High Heat	1/91			
S-102	Hydrogen	1/91	TANKS BY WA	TCH LIST	
S-111	Hydrogen	1/91			
S-112	Hydrogen	1/91	<u>Hydrogen</u>	Organics	
			A-101	C-102	-
SX-101	Hydrogen	1/91	AX-101	C-103	
SX-102	Hydrogen	1/91	AX-103	2 Tanks	
SX-103	Hydrogen	1/91	S-102		4
SX-104	Hydrogen	1/91	S-111		
SX-105	Hydrogen	1/91	S-112		
SX-106	Hydrogen	1/91	SX-101	•	
SX-109	Hydrogen because	other tanks	SX-102		
	vent thru it	1/91	SX-103	High Heat	
			SX-104	C-106	
T-110	Hydrogen	. 1/91	SX-105	1 Tank	
			SX-106		
U-103	Hydrogen	1/91	SX-109		
U-105	Hydrogen .	1/91	T-110		
U-107	Hydrogen	12/93	U-103	•	
U-108	Hydrogen	1/91	U-105		
U-10 9	Hydrogen	1/91	U-107		
			U-108		
			U-109		
			AN-103		
			AN-104		
			AN-105		
			AW-101	<u>.</u>	
			SY-101		
			SY-103		
			25 Tanke	3 Tanka	
	•				
				e-Shell tanks	
				<u>le-Shell tanks</u> s on Watch Lists	
22 Tanke	·			- VII TT WALL LADID	

All tanks were removed from the Ferrocyanide and 18 tanks from Organics Watch Lists; see Table A-2.

TABLE A-2. ADDITIONS/DELETIONS TO WATCH LISTS BY YEAR December 31, 1998

Added/Deleted dates may differ from dates that tanks were officially added to the Watch Lists. (See Table A-1).

.`			•			To	al Tan	ks (1)
	Ferroc	vanide	Hydrogen	Organics	High Heat		DST	
1/91/Original List Response to Public Law 101-5			28	8	1	47		
Added 2/91 (revision to Original List)	1	T-107				1		1
Total - December 31, 1991	24		23		i seculturias	48	. 6	4 4 6 3
Added 8/92			1 · AW-101		24		1	1
Total - December 31, 1892	24		24	8		48	- 6	54
Added 3/93				1 U-111		1		
Deleted 7/93	-4	(BX-110)			l [3	-4		
	1	(BX-111)					l	
		(BY-101) (T-101)] [5			ŀ
Added 12/93	i	(1-101)	1 (U-107)			٥	1	
Total - December 31, 1993	20		25	9		45	_	61
Added 2/94	1258 (192-1-1-16) (193-16)			1 T-111		1		
Added 5/94				10 A-101		4		ł
				AX-102	l lå			
				C-102				ŀ
				S-111				
•	1	•		SX-103	10		i	
•	1			TY-104 U-103			1	1
				U-105			l	j
	1			U-203				l
	1			U-204			i	
Deleted 11/94	-:	2 (BX-102)				-2		l
		(BX-106)						
Total December 1934 thru December 1995	10000 00000 10000000	publication artistic	26	20	1986			54
Deleted 6/96	-4	(C-108)				-4	1	
		(C-109) (C-111)						1
		(C-112)						
Deleted 9/96	-14	(BY-103)	•			-12		1
5 3.0.02 4 755		(BY-104)						
	l .	(BY-105)						
		(BY-106)					Ī	
	l	(BY-107)			l â			
		(BY-108)						
•	1	(BY-110)						
	1	(BY-111) (BY-112)						ł
		(T-107)					ŀ	}
	ł	(TX-118)					ļ	
•	ł	(TY-101)						l
		(TY-103)			i.		l	ŀ
		(TY-104)]
Deleted 12/98			İ	18 (A-101)	i i	-10	l	1
	ŀ			(AX-102)	l B			1
	1			(B-103) (S-102)			1	1
				(S-102) (S-111)				
			1	(SX-103)			1	
	1		1	(SX-106)	1 100			
	1			(T-111)			1	
	1			(TX-105)			1	
	1			(TX-118)			I	
	1			(TY-104) (U-103)			1	
	1		l .	(U-103) (U-106)			1	
				(U-106)	J			ŀ
]			(U-107)				
	1		i	(U-111)			ŀ	
•				(U-203)				l ·
•				(U-204)			<u> </u>	<u> </u>
Total - December 1995 thru December 1998	0	du manasantos	25	2	14 15 1 15 15 15	72	1 8 B	28

^{(1) 18} tanks were removed from the Organics Watch List in December 1998: eight of these are also on the Hydrogen Watch List; two tanks (C-102 and C-103) are still on the Organics List. Total tanks added/deleted depends upon whether a tank is also on another list. See table A-1.

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (Sheet 1 of 2) December 31, 1998

All Watch List tanks are reviewed for increasing temperature trends. Temperatures in these tanks are monitored by the Tank Monitor And Control System (TMACS), unless indicated otherwise.

Temperatures are taken in the waste unless in-waste thermocouples are out of service. Temperatures below are the highest temperatures recorded in these tanks during this month, and do not exceed the maximum criteria limit for this month.

Temperatures in Degrees F. Total Waste in Inches

(Total waste in inches is calculated from Inventory tables and size of tank, not surface level readings)

Hydrogen (F	lammable Ga	s)	Orga	nics
İ	•	Total		Total
Tank No.	Temp.	Waste	Tank No.	Temp Waste
A-101	148	347	C-102	83 149
AX-101	130	272	C-103	117 66
AX-103	111	40	2 Tanks	
S-102	104	207		
S-111	90	224] .	
S-112	84	239		
SX-101	134	171		Total
SX-102	142	203	Tank No.	Temp Waste
SX-103	161	243	C-106 (2)	220 72
SX-104	145	229	1 Tank	
SX-105	168	254		
SX-106	105	201	(Sluicing began N	lovember 18,
SX-109 (1)	141	96	1998, in this tank	k) .
T-110	65	133		
U-103	86	166		
U-105	89	147	į	
U-107	79	143		
U-108	87	166		
บ-109	84	164		
AN-103	109	348		
AN-104	109	384	·	
AN-105	106	410		· · ·
AW-101	101	410		ļ
SY-101	122	405		l
SY-103	95	270		İ
25 Tanke	·		3 Tanks	

All tanks have been removed from the Ferrocyanide Watch List. See Table A-2 for list and dates. 18 tanks have been removed from the Organics Watch List. See Table A-2 for list and dates.

²² Single-Shell Tanks and 6 Double-Shell Tanks remain on the Watch List

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (sheet 2 of 2)

Notes:

Unreviewed Safety Question(USQ):

When a USQ is declared, special controls are required, and work in the tanks is limited. There are currently no USQs on the tanks.

Hydrogen/Flammable Gas:

These are tanks which are suspected of having a significant potential for hydrogen/flammable gas generation, entrapment, and episodic release. The USQ associated with these tanks was closed in September 1998. Twenty-five tanks (19 SST and 6 DST) remain on the Hydrogen Watch List.

Organic Salts:

These are single-shell tanks containing concentrations of organic salts ≥3 weight% of total organic carbon (TOC)(equivalent to 10 wt% sodium acetate). The USQ associated with these tanks was closed in October 1998, and 18 organic complexant tanks were removed from the Organic Watch List in December 1998. Two organic solvent tanks (C-102 and C-103) remain on the Organic Watch List.

High Heat:

These are tanks which contain heat generating strontium-rich sludge and require drainable liquid to be maintained in the tank to promote cooling. Only tank C-106 is on the High Heat Watch List because in the event of a leak, without water additions the tank could exceed temperature limits resulting in unacceptable structural damage. The tank is cooled through evaporation in conjunction with active ventilation. Water is periodically added as evaporation takes place.

There is no USO associated with tank C-106.

Active ventilation:

There are 15 single-shell tanks on active ventilation (eight are on the Watch List as indicated by an asterisk):

C-105	SX-107
C-106 *	SX-108
SX-101 *	SX-109 *
SX-102 *	SX-110
SX-103 *	SX-111
SX-104 *	SX-112
SX-105 *	SX-114
SX-106 *	

Note: A-104, 105 and 106 exhauster has been out of service since 1991 and is no longer considered actively ventilated. Although C-104 has a cascade line with C-105, it is not considered to be actively ventilated.

Footnotes:

- (1) Tank SX-109 has the potential for flammable gas accumulation only because other SX tanks vent through it.
- (2) Tank C-106 is on the Watch List because in the event of a leak without water additions the tank could exceed temperature limits resulting in unacceptable structural damage.

TABLE A-4. TEMPERATURE MONITORING IN NON-WATCH LIST TANKS December 31, 1998

SINGLE-SHELL TANKS WITH HIGH HEAT LOADS (>40,000 Btu/hr)

Ten tanks have high heat loads for which temperature surveillance requirements are established by OSD-T-151-00013. Only one of these tanks (241-C-106) is on the High Heat Watch List. In an analysis, WHC-SD-WM-ER-333, "Evaluation of Heat Sources in High Heat Single Shell Tanks," Bander, 1994, it was determined that six of the ten tanks have heat sources greater than 40,000 Btu/h. Additionally, although four tanks have heat loads less than 40,000 Btu/h, it is recommended that these tanks remain on the High Heat Load List because of uncertainties in the parameters used in these analyses. It is estimated that the current analysis predicts the heat loads within +/- 20%.

Temperatures in these tanks did not exceed OSD requirements for this month. All high heat load tanks, with the exception of 241-A-104 and 241-A-105, are on active ventilation. All high heat load tanks are monitored by the Tank Monitor and Control System (TMACS), with the exception of A-104 and A-105, which are taken manually on a weekly basis.

	Tempera	ature	Total Waste	(Total Waste In Inches is
Tank No.	(F.)		in Inches	calculated from inventory table
A-104	175		10	and tank size, not surface level
A-105	139	•	07	readings)
C-106 (*)	220	(Riser 14)	72	·
	148	(Riser 8)	72	
SX-107	165		43	
SX-108	186		37	
SX-109	141		96	•
SX-110	162		· 28	
SX-111	186		51	<u>.</u>
SX-112	148		39	
SX-114 10 Tanks	179		71	

(*) C-106 on High Heat Load Watch List. Sluicing began November 18, 1998. Highest temperature in 34 lateral thermocouples beneath A-105: 237

SINGLE SHELL TANKS WITH LOW HEAT LOADS (<=40,000 Btu/hr)

There are 118 low heat load non-watch list tanks. Temperatures in tanks connected to TMACS are monitored by TMACS; temperatures in those tanks not yet connected to TMACS are manually taken semiannually in January and July. Temperatures obtained were within historical ranges for the applicable tank.

No temperatures have been obtained for several years in the tanks listed below. Most of these tanks have no thermocouple tree.

Tank No.	Tank No.
BX-104	TX-101
BY-102	TX-110
BY-109	TX-114
C-204	TX-116
SX-115	TX-117
T-102	U-104
T-105	•

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS

149 TANKS (Sheet 1 of 6) December 31, 1998

The following table indicates whether Single-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month:

NOTE:

All Watch List and High Heat tank temperature monitoring is in compliance. (4)

All Dome Elevation Survey monitoring is in compliance.

All Psychrometrics monitoring is in compliance (2). Drywell monitoring is done "as needed" (9). In-tank photos/videos are taken "as needed" (3)

LEGEND:	
(Sheded)	= in compliance with all applicable documentation
N/C	= noncompliance with applicable documentation
0 <i>/</i> S	= Out of Service
Neutron	= LOW readings taken by Neutron probe
POP	= Plant Operating Procedure, TO-040-650
MT/FIC/ ENRAF	= Surface level measurement devices
OSD	■ Operating Specifications Doc., OSD-T-151-00013, -00031
N/A	= Not applicable (not monitored, or no monitoring schedule)
None	= Applicable equipment not installed

	Tank	Category	Temperature	Primary Leak	Surface Level Readings (1)			LOW Readings
Tank Number	Watch List	High Heat	Readings (4)	Detection Source (5)	МТ	(OSR,OSD)	T ENRAF	(OSD)(5,7) Neutron
A-101	List	tidar	(4)	LOW	None	None	4HIA	100000
A-101 A-102				None	None	1,010	None	None
A-102 A-103				LOW	None	None		
A-103 A-104	0.000	X		None	None	None		- None
A-104 A-105		X	74.000	None		None	None	None
A-106				None	None	None	3,4	None
AX-101	×			Low	None	None		(10)
AX-102	10000			None	None	None		None
AX-102	×			None	None	None		None
AX-103	Α			None	None	None		None
B-101				None	None	degree (C.)	None	None
B-102	2000 2000 2000		ACCURATE AND ADDRESS OF	ENRAF	None	None		None
B-103	AND POST OF THE PARTY.	NY ROMANDON'S		None	None	r svenosenskara. De	None	0/6
B-104	10.000000000000000000000000000000000000	o y managency making	ENGARGERAL PROPERTY	LOW	ngal ngalanbah kanasan sanga ka	None	None	(United Level (School Prophysics 1971)
B-105				LOW	PR \$12 0 P (\$1.00 C)	None	None	mer recommon tamental program.
B-106				FIC	None		None	None
B-107	100000000000000000000000000000000000000			None		None	None	None'
B-107				None	None		None	None
B-109	200			None	A CONTRACTOR OF THE CONTRACTOR	None	None	None
B-110	1000000000		152,011216-00406-00	LOW		ALLE None	None	zacione culturale mate
B-111	1500-0000 5500	o a comana da	Plane and Donald St.	LOW	None Land	3320 845 6464 64870	None (Care)	GGGAATASKAMTAAT
B-112	(0.02.2000)	e e passere concer	960000000000000000000000000000000000000	ENRAF	None 1945	Mill None	Property and the second of	None ""
B-201	nervalia, hape	20 7.580 890 A.A.	of the second second	MT	property supplies	None	None	None
B-202	100000000000000000000000000000000000000		PURPLEMENT OF STREET	MT	GREEN CONTRACTOR OF THE STATE	None	None	None
B-203				MT		None	None	None
B-204				MT		None	None	None
BX-101	STATE OF THE STATE			ENRAF	None	. None	250000000000000000000000000000000000000	s None
BX-102	0.000 (0.000)	20 30 30 30 30 30	20000000000000	None	- None	None		None
BX-103	(1)	91 172 WAVE	3190243977577550	ENRAF	All None 260	None W	10. at 36.7 % 10.00	None
BX-104	7.000.000	e seggi de de de de	None ""	ENRAF	None	None	10.00	None
BX-105	1000000000000	(a) (h) (h) (a (a) (a)	470 ± 2000 0000	None	/// None	None	100000000000000000000000000000000000000	None
BX-106		11 11 11 11 11 11 11 11 11	300 S (\$100 S (\$100 S (\$100 S)	ENRAF	None	None		None
BX-107				ENRAF	None	. None	100	None

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS
149 TANKS (Sheet 2 of 6)

		Category	Temperature	Primary Leak	Surfac	ngs (1)	LOW Readings		
Tank Number	Watch List	High Heat	Readings (4)	Detection Source (5)	MI	(OSD)	I ENRAF	(OSD)(5,7) Neutron	
BX-108	Property Sec		(**)	None	Mark None Mark	I see a None was		None	
BX-109	Grand drawn			None	None	None		None	
BX-110	0.000000000000	a incomens	0.0000000000000000000000000000000000000	None	None	None	e Program versey	None	
BX-111				LOW	None	None		110.00	
BX-112				ENRAF	None	None		None	
BY-101				LOW		None	None	30.00	
BY-102	30.5000444.000		None	LOW	O/S	None	None	area de calculation de la	
BY-103	plicate the second	A POPE REPRESE		LOW	None	None as a	and a prescribe Built for any appropriate of		
BY-104	apropriate to		te de la companya de la companya de la companya de la companya de la companya de la companya de la companya de	Low	0/8	None	None	ara i de desenvações da seco	
BY-105	633,628,378	SC BURGOS PERMITERA	(22/08/2004/03/2010)	LOW	en en til til til skrivet skille	None	None	endanga persebata	
BY-106	G SAMPLE CONTROL	an anakaran baharan	0.800.0000.0000	LOW	Section and the land	None	None	resident til forskriverskelde	
BY-107	14.000000000000000000000000000000000000		20.500000000000000000000000000000000000	LOW	0.100.300.000.000.000	None	None	teriori e e e e e e e e e e e e e e e e e e e	
BY-108				None		None	None	None	
BY-109			None	LOW	None	0/\$	None	(CALC	
BY-110				LOW	None	None	54 a 54 a 54 a 54 a 54 a 54 a 54 a 54 a		
BY-111				LOW	None	None			
BY-112	3422333433			LOW	****	None	None	A company to the company of the comp	
C-101	800000000000000000000000000000000000000			None	Planeta and an agent	None	None	None	
C-102	X			None	None		None	None	
C-103	X			ENRAF	None	None	HOTE	None	
C-104				None	None	O/S	None	None	
C-105				None	None	None		None	
C-106 (3)	x	X		ENRAF	None	None		None	
C-107				ENRAF	None	None		None	
C-108		a la va a companyo da companyo da companyo da companyo da companyo da companyo da companyo da companyo da comp		None	NOIR	None	None	None	
C-109				None		None	None	None	
C-110	00.500.0000.00			MT	ela de zaca Constituira.	None	None	None	
C-111	50.000 (10.000)			None		None	None	None	
C-112	900000000000000000000000000000000000000			None	None	None	NOIB	None	
C-201				None	31074	None	None	None	
C-202				None		None	None	None	
C-203			oran (a to see see est and a to	None		None	None	None	
C-204			None	None		None	None	None	
S-101			31 4 1.00	ENRAF	None	None	NOIR	SAC OF SAC SAC	
S-101	T X			ENRAF	None	None			
S-103	SALES SERVICES		rasangen, careras saka	ENRAF	None	None		100	
S-104			as comment	LOW	1010	None	None		
S-105				LOW	None	None	11080		
S-106	900000000000000000000000000000000000000			ENRAF	None	None			
S-107	144		S 40 (1) 4 (1) 4 (1) 4 (1)	ENRAF	None			None"	
S-108				LOW	None	None	O DECEMBER OF THE OWNER OWNE	100760	
S-109		TOCOGGGGGGGGGGGGGGGGGGGGGGGGGGGGGGGGGGG	PRATER OF THE PROPERTY OF THE	LOW	None	None			
S-109				LOW	None	None			
5-110 5-111	X			ENRAF	None	Ivone None			
S-112	X			LOW	None	None		DENTERON DE PROPERTIE DE POST	
SX-101	X		Programme and the state of	LOW	None	None			
SX-101 SX-102				LOW					
				LOW	None	None			
SX-103 SX-104	X				None None	None:			
				LOW	And the second s	None			
5X-105	X			LOW	None	None			
SX-106 SX-107	. X	•		ENRAF	None	None	New Year		
SX-107 SX-108		X		None None		None None	None None	None None	

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 3 of 6)

	Same and the same	ategory	Temperature	Primary Leak	Surfa	ce Level Readir	ngs (1)	LOW Readings
Tank	Watch	High Heat	Readings (4)	Detection Source (5)	MT	(OSD)	I ENRAF	(OSD)(5,7) Neutron
Number	List			None	None	None		None
SX-109 (3)	X			None	54.4.1 1.010	None	None	None
SX-110		X		None		None	None	None
SX-111 SX-112		X		None		None	None	None
SX-112 SX-113	80.000.000.000.00		19	None		None	None	None -
6X-113		1 x		None		None	None	None
5X-115			None	None		None	None	None
r-101				None	None	None		None
Γ-102	Account to the	¥ 217.000000000	None	ENRAF	None	None	معاما المدعون الأران ووجيادين	None La
r-103	5243			None	None	Nane	Publication College	None was
r-104		3 77 37 77 77	100000000000000000000000000000000000000	LOW	None	Nane	2014/1996/00/52011/99	100000000000000000000000000000000000000
r-105	2.32.00.00.00.00	Company of the	None	None	None	Nane	promove a promove medical pr	None"
r-106			1	None	None	None	Grand Recommendation of	None.
r-107				ENRAF	None	None		None
T-108		A STREET, STRE	A PROPERTY OF STREET	ENRAF	None	None		None
T-109				None	None	None	cycles allow to the control	None
T-110	X. X.			LOW	None	None	Complete Complete Complete Complete	arang kalanggapasan
T-111	320000000000000000000000000000000000000	100000000000000000000000000000000000000		LOW	None None	Mana None	nuslasemostiaiom.	CONGRESSION OF THE
T-112	9/13/2009		(ENRAF	None	None	termore more con-	None
T-201	10.00000 (2.1000)	parameter (2004)	and promote school street	MT	(AND CONTRACTORS OF CASE)	None	None	None
T-202	18.5			MT	a martin sala santa bilanda	None	None	None
F-203				None		None	None	None
T-204	410000000000000000000000000000000000000	5,000,000		MT		None	None	None
TX-101	Residence (Sec.	a dispulsario	None	ENRAF	None	None	4 (0.00)	None
TX-102	1210000041120	i podpojenjaka	in dealth and and an arminist	LOW	None	None	dentical during the first	and previous res
TX-103	981500 H (550) SA (4	0.0430300000000000000000000000000000000	20000000000000000000000000000000000000	None	None (None was	emolectropessus and a	None -
TX-104	01/1003/27/09/57:05		g sources course to	None	None	None	Company of the second	Nane
TX-105	ver de processor proces	0.000	Li Company se manggarah	None	None	None		None (7)
TX-106	Today (1991)			LOW .	None	None		Chromotopic Co.
TX-107				None	None	None		None
TX-108	F. 980442072140			None	None	None		None
TX-109	3K Editor Students		n. Industry in the first of the	LOW	None	None		404274
TX-110	September 1	a Dogesti te iz 7850	s same None sesso	LOW	None	None	and the second second	A STATE OF THE PARTY.
TX-111	J89141901118650	a bryterileitheth	s acceptations collec	LOW	None	None None	SCOOK GRADES	Magazi estat est
TX-112	(80,51) (30,000)	e de la company	ar in proposition and the	LOW	None 1	None None	ajulistikus aiteksis	CESSOR SECTION
TX-113	age of a court in disk	e marchanach		row	None	None	70 K (A) (417 NO)	erichtenschriften.
TX-114	seine der Joseph Mi	er Australia displate	None	LOW	None	None		24 (14 TH) (2.00)
TX-115	200000000000000000000000000000000000000			LOW	None	None	\$3,000 \$505 \$500 Block	
TX-116			None	None	None	None		None
TX-117	. 2000, 2000, 200		None seems	LOW	None	None	*****************	portugal en la tractica de la constanta de la
TX-118	P(#50)75(75(5)	i jasa saar		LOW	None	None .	35 April 1989	Contraction of the Contraction o
TY-101	s, capa, basa a			None	None	Mone None	34.000.000	None
TY-102	58.63(30)(50)(2		a) tellerining der Principalit	ENRAF	None :	None		None
TY-103		a Projection (1)		LOW	None	None	92.72.28.83.83.83.83.88	
TY-104				ENRAF	None	None	a company	None
TY-105				None	None	None	MUNICIPAL STATE	None
TY-106	20-2-20-2-20-7-3	MAN DOMONOANDOMOCOCOCOCOCO		None	None	None		None
U-101	40 M 44 M			MT	gjagaja, Pranskama	None	None	None
U-102	22,016,000	A A		LOW	w/ None	None	14. 146.07.62.54	
U-103	X X		St. Commission & 40/444	ENRAF	* **None	None		
U-104		275	None	None		None	None	None
U-105	- X			ENRAF	None	None:		
U-106				ENRAF	None	None	Autorit Angeloscille). (a),(a),(a),(a),(b)

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 4 of 6)

Number Lis U-107 U-108 U-109 U-110 U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	X San	High Heat From Market From Market From Market NIA NIA NIA NIA NIA NIA NIA NI	Readings (4) Figure 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Detection Source (5) ENRAF LOW ENRAF None LOW None MT MT None ENRAF	None None None None None None None None	face Level Read (OSD) FIC None None None None None None None None	ENRAF STATE OF THE STATE OF TH	das in Rije is naast legelags als rijn
U-107 U-108 U-109 U-110 U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-302-A S-304	X X X X X X X X X X X X X X X X X X X	veillance Fa N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A	ENRAF LOW ENRAF None LOW None MT MT None ENRAF	None None None None None None None None	None None None None None None None None	None None None None None None None None	None None None None None None None None
U-108 U-109 U-110 U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A	veillance Fe N/A N/A N/A N/A N/A N/A N/A N/A N/A N/A	customers of the control of the cont	LOW ENRAF None LOW None MT MT None ENRAF	None None None None None None None None	None None None None None None None None	None None None None None None None None	None None None None None None None None
U-109 U-110 U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A	Berners as seen	ENRAF None LOW None MT MT None ENRAF (6) (6) (6) (6) (6)	None None None None None None None None	None None None None None None None None	None None None None None None None None	None None None None None None None None
U-110 U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A	None LOW None MT MT None ENRAF (6) (6) (6) (6) (6)	None None None None None None None	None None None None None None None None	None None None None None None None None	None None None None None None None None
U-111 U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	LOW None MT MT None ENRAF (6) (6) (6) (6) (6)	None None None None None	None None None None None None None None	None None None None None None None	None None None None None None None None
U-112 U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	None MT MT None ENRAF (6) (6) (6) (6) (6)	None None None None	None None None None None None None None	None None None None None None None	None None None None None None None None
U-201 U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	MT MT None ENRAF (6) (6) (6) (6) (6) (6)	None None None	None None None None None None None None	None None None None None None None	None None None None None None None None
U-202 U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	MT None ENRAF (6) (6) (6) (6) (6) (6)	None None None	None None None None None None None	None None None None None None None	None None None None None None None None
U-203 U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	None ENRAF (6) (6) (7) (6) (6) (6) (6)	None None None	None None None None None None	None None None None None None	None None None None None None None None
U-204 Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A N/A	veillance Fa N/A N/A N/A N/A N/A N/A N/A N/A	acilities N/A N/A N/A N/A N/A N/A N/A N/A N/A	ENRAF (6) (6) (7) (6) (6) (6) (6) (6)	None None None	None None None None	None None None None None	None sand None None None None None None None None
Catch Tanks and S A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	Special Sur N/A N/A N/A N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A N/A	(6) (6) (6) (6) (6)	None None None	None None None	None None None None None	None None None None None
A-302-A A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A	N/A N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A N/A	(6) (5) (6) (6) (6)	None None	None None None	None None None None	None None None None None None None
A-302-B ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A	(6) (5) (6) (6) (6)	None None	None None None	None None None None	None None None None None None None
ER-311 AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A	N/A N/A N/A N/A N/A	(6) (6) - (6) - (6)	None	Norie Norie	None None None None	None None None None
AX-152 AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A N/A N/A N/A	N/A - N/A N/A N/A	N/A N/A N/A	(6) (6) (6)	None	entre Normania	None None None None	None None None None
AZ-151 AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A N/A N/A	N/A N/A N/A	N/A N/A N/A	(6) (6)		entre Normania	None	None None None
AZ-154 BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A N/A	N/A N/A N/A	N/A N/A	(6) (6)			None	Mone Service
BX-TK/SMP A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A N/A	N/A	n san/A	(6)			the annual contract of the con	DEST CONTROL OF THE PROPERTY O
A-244 TK/SMP AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A N/A	N/A	na makambandan mengangan menangan m		Machine Control of th	None :	the annual contract of the con	
AR-204 A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A		N/A			THE PROPERTY OF STREET STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET,		 Grad Riccollance or Latest Lettering at grain
A-417 A-350 CR-003 Vent Sta. S-302 S-302-A S-304	energytenskeptenett (2	AV/A		ner er verver traue 🕶 a stationer value	None	None	None	None
A-350 CR-003 Vent Sta. S-302 S-302-A S-304	N/A		N/A	(6)		e established by	None	None
CR-003 Vent Sta. S-302 S-302-A S-304	5000 美国法国国际政策管理库	N/A	N/A	(6)	None	None	None	None
Vent Sta. S-302 S-302-A S-304	N/A	N/A	N/A	1(6)	None	None	None	None
S-302 S-302-A S-304	N/A	N/A	N/A	(6)	None	None	None	None
S-302-A S-304	N/A	N/A	N/A	(6)		None	None	None
S-304	N/A	N/A	Seese N/A	(6)	None	None		. None
910(898)	N/A	* *N/A	N/A	** ** (6)	None	a Merce Const	" None	None
7/ 000 0	N/A 💮	N/A	N/A	(6)	None	None		None
TX-302-B	N/A	-N/A	N/A	(6)	To a distance of	None	None	None
TX-302-C	N/A	N/A	N/A	(6)	None	None	po postelaciones	None
J-301-B	N/A	N/A	N/A	(6)	None	None		None
JX-302-A	N/A	N/A	N/A	(6)	None	None		None
S-141	N/A	N/A	N/A	. (6)	O/S (12)	None	None	None
S-142	N/A	N/A		(6)	. O/S (12)	None	None	None
Totals:	22	10	N/C: 0		N/C: O	N/C: O	N/C: 0	N/C: 0
	Vatch List Tanks (4)	High Heat Tanks						

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS -149 TANKS (Sheet 5 of 6)

Footnotes:

- 1. All SSTs have either manual tape, FIC, or ENRAF surface level measuring devices. Some also have zip cords.
 - ENRAF gauges are being installed to replace FICs (or sometimes manual tapes). The ENRAF gauges are being connected to TMACS, but many are currently being read manually from the field. See Table A-7 for list of ENRAF installations.
- 2. High heat tanks have active exhausters; psychrometrics can be taken in the high heat tanks. Psychrometric readings are taken on an "as needed" basis with the exception of tanks C-105 and C-106. Hanford Federal Facility Agreement and Consent Order," Washington State Department of Ecology, U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment 1994 (Tri-Party Agreement) requires psychrometric readings to be taken in C-105 and C-106 on a monthly frequency. Tank C-105 exhauster was shut down for C-106 sluicing; but was back on line during parts of December and psychrometrics were performed on C-105 and C-106. Also, SX-The farm now has psychrometrics taken monthly.
- 3. C-106 and SX-109 these tanks are on both category lists (Watch List and high heat list) C-106 is the only tank on the high heat list included on the High Heat Watch List; SX-109 is on the Hydrogen Watch List, and also on the high heat list (but not on the High Heat Watch List).
- 4. Temperature readings may be regulated by OSD or POP. Temperatures cannot be obtained in 13 low heat load tanks (see Table A-4). The OSD does not require readings or repair of out-of service thermocouples for the low heat load (<40,000 Btu/h) tanks. However, the POP requires that attempts are to be made semiannually in January and July to obtain readings for these tanks. There are no in-waste temperatures for tanks AX-102 and B-103. The waste level in this tanks is lower than the lowest thermocouple in these trees.
 - Temperatures for many tanks are monitored continuously by TMACS; see Table A-8, TMACS Monitoring Status.
 - 5. Document WHC-OSD-T-151-00031, "Operating Specifications for Tank Farm Leak Detection," requires that single-shell tanks with the surface level measurement device contacting liquid, partial liquid, or floating crust surface, will be monitored for leak detection on a daily basis. Tanks with a solid surface will be monitored for leak detection on a weekly basis by taking neutron scan data from a Liquid Observation Well (LOW), if an LOW is present. Tanks with a solid surface but without LOWs will not be monitored for leak detection if the tank has been interim stabilized, until an LOW is installed. Non-interim-stabilized tanks will have drywell surveys taken as a backup on a monthly basis if surface or interstitial level measurement equipment is unavailable. The OSD specifies what leak detection methods are to be used for each tank, and the requirements if the readings are not taken on the required frequency or if equipment is out of service.
 - 6. Leak detection for the catch tanks is performed by monitoring for the buildup of liquid in the secondary containment (for most tanks with secondary containment) or for decrease in the liquid level for those tanks without secondary containment or secondary containment monitoring.
 - Catch tanks 240-S-302 and 241-S-302-A are monitored for intrusions only, and are not subject to leak detection monitoring requirements until liquid is present above the intrusion level.
 - Weight Time Factor is the surface level measuring device currently used in A-417, A-350 and 244-A-Tank/Sump. DCRT CR-003 is inactive and measured in gallons.
 - 7. Document WHC-SD-WM-TI-605, REV. 0, dated January 1994, describes the rationale for Liquid Observation Well (LOW) installation priority. This priority is based on tank leak status, tank surface condition, and tank stabilization status. Also included is a listing of tanks with the waste level being below two feet which have no

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 149 TANKS (Sheet 6 of 6)

priority assigned because no effort will be made to install LOWs in the near future. LOW probes are unable to accurately monitor interstitial liquid levels less than two feet high.

Tanks which will not receive LOWs:

A-102	BX-101	C-201	T-106
A-104	BX-103	C-202	T-108
A-105	BX-105	C-203	T-109
AX-102	BX-106	C-204	TX-107
AX-104	BX-108	SX-110	TY-102
B-102	C-108	SX-113	TY-104
B-103	C-109	SX-115	TY-106
B-112	C-111	T-102	U-101
		T-103	U-112

Total - 34 Tanks

- 8. TX-105 the riser has been removed; the LOW has not been monitored since January 1987. Liquid levels are being taken.
- 9. All drywell scans are done by request only, when required in addition to, or as a BACKUP for, a PRIMARY leak detection method, per OSD-T-151-00031. Currently, there are only two tanks which require drywell scans (C-105 and C-106); these were taken monthly until sluicing began in November 1998. Drywell scans in these tanks are expected to be discontinued soon; the OSD is being rewritten.

Only two tank farms, A and SX, have laterals. There are currently no functioning laterals and no plans to prepare these for use.

- 10. AX-101 LOW readings are taken by gamma sensors.
- 11. SX-101 ENRAF data suspect: core sampling done displacer sticks on top of crust or goes into hole. LOW is primary device. ENRAF was flushed and recalibrated September 1, 1998, and the reading was back to near normal. Data marked suspect since September 10, when readings began fluctuating daily from 163 inches to 169 inches (new baseline established November 19, 1998, at 166.0 inches). Readings still suspect; fluctuating from 169.83 to 161.82 inches. ENRAF was flushed December 29, 1998, and readings are now at 161.82 inches. Engineering evaluating, may need to be rebaselined again.
- 12. Catch Tanks S-141 and S-142 have no M.T. readings.

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS 28 TANKS (Sheet 1 of 2) December 31, 1998

The following table indicates whether Double-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month.

NOTE:

Dome Elevation Surveys are not required for DSTs.

Psychrometrics and in-tank photos/videos are taken "as needed" (2)

LEGEND: (Shaded) = In compliance with all applicable documentation = Noncompliance with applicable documentation N/C FIC/ENRAF = Surface level measurement devices M.T. = OSD-T-151-0007, OSD-T-151-0031 OSD None = no M.T., FIC or ENRAF installed 0/8 = Out of Service W.F. = Weight Factor Rad. = Radiation

						Re	ediation Reading	8	
Tank		Temperature Readings (3)	Surfa	ace Level Read (OSD)	ings (1)		Leak Detection Pits (4) (OSD)		
Number	Watch List	(OSD)	M.T.	FIC	ENRAF	W.F.	Rad. (8)	(OSD)	
AN-101	and a process of the angular confe	sticing bearing paint you call	Assessed Section	None	APEDES, TONOS OVERSA	ar i servasiani, distant	risa (a) (a) sexua.	35 9 00442995	
AN-102	596350350600560	Birthings (Breathings)	100000000000000000000000000000000000000	SS Swiffelijkrik	None	a lugar little stabil	(8)	ANNING	
AN-103	Website X (Salt)	er er er er er er er er er er er er	4401466364444	None	2000		(8)	加热照 码	
AN-104	X	STATE OF THE STATE	april to the second section of the	None	erster stricts address		(8)		
AN-105	X	eracini asa gape erancini	0/5	None		a generalis dell'addicati	(8)		
AN-106			0.0000		None	100000000000000000000000000000000000000	(8)		
AN-107					None		(8)		
AP-101	9 30 30 40 40 40 70 70 70 70	A Commence of the Section	0/\$	Synthesis in the	None	O/S (8)	(8)	estance es	
AP-102 -	466000000000000000000000000000000000000	Contract No. of No. of No.	2.000		None	O/S (9)	. :- (8)		
AP-103		Charles at the state of	Janes California		None	0/5 (8)	(8)		
AP-104		10 THE RESERVE OF THE	0/5		None	O/S (9)	(8)	and the same	
AP-105			10000000000000		None	0/8 (9)	(8)	100 CO (100 CO)	
AP-106	1715/2008 BB (1888)				None	0/5 (9)	(8)	radels y blee	
AP-107					None	O/5 (9)	(8)	se verenance	
AP-108			200000000000000000000000000000000000000		None	0/5 (9)	(8)		
AW-101	X		# O/S-94	None	Acres de martin	2 3 4 5 5 7 7 7	(8)	14224555	
AW-102	Contract Contract		30,20,000,000,000	Appellant and a contract	(6)		(8)	7. X (1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	
AW-103	14000	and the second second		None'	A DE AL PROPERTY OF THE	***************	(8)	5/2-30333	
AW-104	And Ship But 1980			None		7.13	(8)	and the state of	
AW-105	23.500 (4.000)		an entre de marches	None	ALL AND DECIMAL PROPERTY.	BAR COR BELLEVIA	(8)	dalesio sali	
AW-106	Cabical Police		1.00 (A. 4.10)	None	Considerate Indiana	n Markender	(8)	anera es	
AY-101	ALLEGIS DE PART	all the field of the state of	Calculation (None	n ni Si siante Ma	0/5	(8)	(6)	
AY-102	Signify Call (Colors)	AND TO SHALL	roome passages of	None - 4	0/6 mg/s	e we sixuatenya	g week at (8) comme	i de desegration	
AZ-101	(24/2009/1900/1909/19	Salay Chestar (Eq. 10) (E.S.	0/8	None	1941 J. G. G. G. G. G. G. G. G. G. G. G. G. G.	(1.424(3)2390en/006	(8)	(6)	
AZ-102	Surviva, Carl Printers	44-446-1520-5-110-5 9 775-7	Agricus de estado	a respective agreement	None**	d galaxana assur usar	(8)	(5) ***	
SY-101	7 / 7 / X	and the state of the state of	'' 'O/S''	None	TAX TO SECURE OF SECURE	The section of the	(8)	Commercial Control	
SY-102	200.00000000000000000000000000000000000		17.00	None	7.97.71.92	227	(8)		
SY-103	Х.	STATE OF LIVE AND A STATE OF	Section Laboratory	None	and the second second	(7)	(8)	YARRING LAND	
Totals:	6	N/C: O	N/C: O	N/C: 0	N/C: O	N/C: 0	N/C: O	N/C: O	
28 tanks	Watch List Tanks	Ì		[1	1	1	1	

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 28 TANKS (Sheet 2 of 2)

Footnotes:

- Some double-shell tanks have both FIC and manual tape which is used when the FIC is out of service.
 Noncompliance (N/C) will be shown when no readings are obtained. ENRAF gauges are being installed to replace FICs. The ENRAF gauges are being connected to TMACS, but some are currently being read manually.
- 2. Psychrometric readings are taken on an "as needed" basis. No psychrometric readings are currently being taken in the double-shell tanks.
- 3. OSD specifies double-shell tank temperature limits, gradients, etc.
- Applicable OSD and HNF-IP-0842, latest revisions, are used as guidelines for monitoring Leak Detection Pits.
 See also (8) below.
- 5. AY-101 and AZ-101/102 are monitored only by the annulus Leak Detection Probe Measurement device.
- 6. AW-102 has ENRAF, FIC and M.T. At some point the FIC will be removed.
- 7. SY-103 CWF reading is above normal range of 24 inches.
- 8. USQ TF-97-0038, dated April 28, 1997, specifies discontinuing the use of leak detection pit radiation monitoring equipment in all double-shell tank farms where the leak detection pits are used as tertiary leak detection. This applies to all double-shell tank farms.
- 9. Weekly readings are being obtained by Instrument Technicians in these tanks:

AP-103C (for tanks AP-101 - 104)

AP-105C (for tanks AP-105 - 108)

TABLE A-7. ENRAF SURFACE LEVEL GAUGE INSTALLATION AND DATA INPUT METHODS

December 31, 1998

LEGEND	CASS	= Computer Automated Surveillance System
	SACS	= Surveillance Analysis Computer System
	TMACS	= Tank Monitor and Control System
	Auto	= Automatically entered into TMACS and electronically transmitted to SACS
	Manuai	= EITHER manually entered into CASS by field operators and electronically transmitted to SACS
		OR manually entered directly into SACS by surveillance personnel, from Field Data sheets

Tank	EAST A	AREA							WEST	AREA					
No. Date Method A-101 09/95 Auto 8-201 S-101 09/95 Auto 8-201 S-101 09/95 Auto 8-202 S-102 06/96 Auto 17x-102			Input	*	Tank	Installed	Input		Tank	Installed	Input		Tank	Installed	input
A-101 09/95 Auto 8-201	i i			×	31		1		8		_		1	Date	
A-102				***		Date	Medica								
A-104		09/95	Auto	***				388	*						
A-106		07/06	A 1 10 11	***				*				2000 2000			
A-106				***				***		00/04	Acto				
A-106 01/96 Auto		00/80	Manda	333 333	1	04/96	Auto	***	3	07/95	Manual	***			
AN-101 08/96 Auto		01/96	Auto	333 333				***							
AN-102				***				***							Auto
AN-103 08/95 Auto		00,00		**							Manual		TX-108	04/96	Auto
ARI-102 08/95 Auto 8X-106 07/84 Auto \$-110 08/95 Manual TX-110 05/96 Auto ARI-105 08/95 Auto 8X-107 06/96 Auto \$-111 08/94 Auto TX-111 05/96 Auto ARI-105 08/95 Auto \$-111 08/94 Auto TX-111 05/96 Auto ARI-107 8X-108 08/95 Auto \$-112 05/95 Auto TX-111 05/96 Auto TX-111 05/96 Auto ARI-107 8X-110 08/96 Auto SX-101 04/95 Auto TX-113 05/96 Auto ARI-107 8X-110 08/96 Auto SX-102 04/95 Auto TX-113 05/96 Auto ARI-107 8X-110 08/96 Auto SX-102 04/95 Auto TX-113 05/96 Auto ARI-102 8X-111 05/96 Auto SX-102 04/95 Auto TX-113 05/96 Auto ARI-102 8X-111 05/96 Auto SX-102 04/95 Auto TX-115 05/96 Auto ARI-103 8X-112 03/96 Auto SX-103 04/95 Auto TX-115 05/96 Auto ARI-104 8Y-101 SX-103 04/95 Auto TX-116 05/96 Auto ARI-106 8Y-101 SX-106 05/95 Auto TX-117 06/96 Auto ARI-106 8Y-102 8X-104 05/95 Auto TX-117 06/96 Auto ARI-106 8Y-103 12/96 Manual SX-107 TX-101 07/95 Auto ARI-107 8Y-104 ARI-108 8Y-103 12/96 Manual SX-107 TX-101 07/95 Auto ARI-108 8Y-108		08/95	Auto	***							Manual	***	-		Auto
AN-105 08/95 Auto 8X-107 06/96 Auto 8X-108 05/96 Auto 8X-108 05/96 Auto 8X-108 06/96 Auto 8X-108 06/96 Auto 8X-108 06/96 Auto 8X-101 06/96 Auto XX-111 05/96 Auto XX-101 06/96 Auto XX-102 04/95 Auto XX-113 05/96 Auto XX-103 04/95 Auto XX-114 05/96 Auto XX-103 04/95 Auto XX-114 05/96 Auto XX-103 04/95 Auto XX-115 05/96 Auto XX-103 04/95 Auto XX-116 05/96 Auto XX-103 04/95 Auto XX-116 05/96 Auto XX-103 04/95 Auto XX-116 05/96 Auto XX-103 04/95 Auto XX-116 05/96 Auto XX-103 04/95 Auto XX-116 05/96 Auto XX-103 08/96 Auto XX-103 08/95 Auto XX-104 05/95 Auto XX-104 05/95 Auto XX-104 05/95 Auto XX-104 05/96 Auto XX-103 08/96 Auto XX-104 05/95 Auto XX-104 05/96 Auto XX-118 03/96 Auto XX-105 06/96 Auto XX-107 08/96 Auto XX-107 08/96 Auto XX-104 08/96				***									TX-110	05/96	Auto
ANY-106 BX-108 OS/96 Auto S-112 OS/95 Auto TX-112 OS/96 Auto ANY-107 BX-109 OS/95 Auto SX-101 O4/95 Auto TX-113 OS/96 Auto Auto Auto TX-113 OS/96 Auto Auto Auto Auto TX-113 OS/96 Auto				*					3	08/94	Auto		TX-111	05/96	Auto
AN-107 BX-109 BX-101 O8/95 Auto SX-101 O4/95 Auto TX-113 O5/96 Auto AP-101 BX-111 O5/96 Auto SX-102 O4/95 Auto TX-114 O5/96 Auto		00,00	71000	***								*		05/96	Auto
AP-101 BX-110 O6/96 Auto SX-102 O4/95 Auto TX-114 O5/96 Auto AP-102 BX-111 O5/96 Auto SX-103 O4/95 Auto TX-115 O5/96 Auto AP-103 BX-111 O5/96 Auto SX-103 O4/95 Auto TX-115 O5/96 Auto AP-103 BX-112 O3/96 Auto SX-104 O5/95 Auto TX-115 O5/96 Auto AP-104 BY-104 BY-105 BY-107 SX-105 O6/95 Auto TX-118 O3/96 Auto AP-105 BY-105 BY-107 SX-105 O6/95 Auto TX-119 O3/96 Auto AP-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-107 BY-106 BY-108 BY-107 BY-108 BY-108 BY-108 BY-108 BY-108 BY-108 BY-109 O8/98 Auto TY-102 O9/95 Auto AW-102 O5/96 Auto BY-108 BY-108 BY-108 BY-109 O8/98 Auto BY-107 BY-108 BY-108 BY-108 BY-109 BY-108 BY-109 BY-108 BY-109 BY-108 BY-109									*						Auto
AP-102 BX-111 O5/86									4						Auto
AP-103 BX-112 O3/96				×				*	4		Auto		TX-115	05/96	Auto
AP-104 BY-101 SX-105 O5/85 Auto TX-117 O6/96 Auto AP-106 BY-102 SX-106 O8/84 Auto TX-118 O3/86 Auto AP-106 BY-103 12/86 Manual SX-107 TY-101 O7/85 Auto AP-107 BY-108 BY-105 SX-108 SX-108 TY-101 O7/85 Auto AP-108 BY-106 SX-108 SX-108 TY-101 O7/85 Auto AP-108 BY-106 SX-108 SX-109 O9/88 Auto TY-102 O9/95 Auto AW-101 O8/95 Auto BY-106 SX-110 TY-104 O6/95 Auto AW-102 O5/96 Auto BY-108 SX-110 TY-106 12/95 Auto AW-103 O5/96 Auto BY-108 SX-111 TY-106 12/95 Auto AW-103 O5/96 Auto BY-108 SX-111 TY-106 12/95 Auto AW-104 O6/96 Auto BY-108 SX-113 U-101 AW-105 O6/96 Auto BY-108 SX-113 U-101 AW-106 O6/96 Auto BY-110 Z/97 Manual SX-115 U-101 U-102 O1/96 Manual AW-106 O6/96 Auto BY-111 2/97 Manual SX-115 U-102 O1/96 Manual AX-104 O9/95 Auto BY-112 SY-101 O7/94 Auto U-103 O7/94 Auto AX-102 O9/98 Manual C-101 SY-102 O6/94 Manual U-106 O7/94 Auto AX-104 O9/95 Auto C-103 O8/94 Auto SY-103 O7/94 Auto U-104 O6/96 AX-104 O6/96 Auto C-103 O8/94 Auto SY-103 O7/94 Auto U-106 O7/94 Auto AX-104 O6/96 Manual C-104 SY-102 O6/94 Manual U-106 O7/94 Auto AX-104 O6/96 Manual C-108 O8/96 Auto C-103 O8/94 Auto T-101 O5/95 Manual U-107 O8/94 Auto AX-104 O6/96 Manual C-106 O6/96 Manual C-108 O8/96 Auto C-108 O8/96 Auto T-103 O7/96 Manual U-109 O7/94 Auto AX-104 O6/96 Manual C-108 O2/96 Auto T-106 O7/95 Manual U-109 O7/94 Auto AX-104 O6/96 Manual C-108 O2/96 Auto T-106 O7/96 Manual U-109 O7/96 Manual U-108 O6/96 Manual C-108 O2/96 Auto T-106 O7/96 Manual U-109 O7/98 Manual U-108 O6/96 Manual C-109 O2/96 Auto T-106 O7/96 Manual U-107 O2/96 Manual U-108 O6/98 Manual U-109 O7/94 Auto U-108 O6/96 Manual U-109 O7/94 Auto U-108 O6/96 Manual U-109 O7/96 Manual U-109 O7/96 Manual U-108 O6/96 Manual U-109 O7/96 Manual U-109				*											Auto
AP-106 BY-102 BY-103 12/96 Manual SX-107 TY-101 07/95 Auto AP-106 BY-103 12/96 Manual SX-107 TY-101 07/95 Auto AP-107 BY-104 SX-108 TY-101 07/95 Auto AP-108 SY-105 SX-109 08/98 Auto TY-103 09/95 Auto AW-101 08/95 Auto BY-106 SX-109 08/98 Auto TY-103 09/95 Auto AW-101 08/95 Auto BY-106 SX-110 TY-104 06/95 Auto AW-102 05/96 Auto BY-107 SX-111 TY-105 12/95 Auto AW-102 05/96 Auto BY-108 SX-111 TY-105 12/95 Auto AW-104 01/96 Auto BY-108 SX-112 TY-106 12/95 Auto AW-104 01/96 Auto BY-109 SX-113 UL-101 UL-101 AW-104 01/96 Auto BY-110 2/97 Manual SX-114 UL-102 01/96 Manual AW-105 06/96 Auto BY-111 2/97 Manual SX-115 UL-101 UL-102 01/96 Manual AX-101 08/95 Auto BY-112 SY-101 07/94 Auto UL-104 UL-104 O8/95 Auto BY-112 SY-101 07/94 Auto UL-104 UL-104 O8/95 Auto BY-112 SY-102 06/94 Manual UL-105 07/94 Auto AX-101 08/95 Auto BY-112 SY-103 07/94 Auto UL-104 UL-104 O8/95 Auto BY-110 O8/95 Auto BY-112 SY-103 07/94 Auto UL-104 UL-104 O8/95 Auto BY-110 08/95 Auto BY-112 SY-103 07/94 Auto UL-104 UL-104 O8/95 Auto BY-110 08/95 Auto BY-111 SY-105 06/94 Manual UL-106 07/94 Auto UL-106 08/94 Auto UL-106 08/94 Auto UL-108 O8/95 Auto BY-102 08/96 Manual UL-107 08/94 Auto UL-108 08/94 Auto UL-108 08/94 Auto UL-108 08/95 Auto BY-102 08/96 Manual UL-107 08/95 Auto BR-104 DR-104 UL-108 08/95 Auto UL				***				**				***	TX-117	06/96	Auto
AP-108 BY-103 12/96 Manual SX-107 TY-101 07/95 Auto AP-107 BY-104 SX-108 TY-102 09/95 Auto AP-107 BY-104 SX-108 TY-102 09/95 Auto AP-108 BY-106 SX-108 O9/98 Auto TY-102 09/95 Auto AW-101 08/95 Auto BY-106 SX-110 TY-104 06/95 Auto AW-102 06/98 Auto BY-107 SX-111 TY-105 12/95 Auto AW-102 06/98 Auto BY-108 SX-111 TY-105 12/95 Auto AW-103 05/96 Auto BY-108 SX-112 TY-105 12/95 Auto AW-104 01/98 Auto BY-109 SX-113 U-101 AW-105 06/98 Auto BY-110 2/97 Manual SX-114 U-102 01/98 Manual AW-106 06/98 Auto BY-111 2/97 Manual SX-115 U-102 01/98 Manual AW-106 09/98 Auto BY-112 SY-105 06/94 Manual U-106 07/94 Auto AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-106 07/94 Auto AX-102 09/98 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/98 Auto C-103 08/94 Auto T-101 05/95 Manual U-108 05/95 Auto AX-101 03/96 Manual C-104 T-101 05/95 Manual U-108 05/95 Auto AX-101 08/98 Auto C-105 05/98 Manual T-103 07/95 Manual U-108 05/95 Auto AX-101 08/98 Manual C-108 T-106 07/95 Manual U-109 07/94 Auto AX-101 08/98 Manual C-106 02/98 Auto T-103 07/95 Manual U-108 05/95 Auto AX-101 08/98 Manual C-108 T-106 07/95 Manual U-109 07/94 Auto AX-101 08/98 Manual C-108 T-106 07/95 Manual U-109 07/94 Auto AX-101 08/98 Manual C-108 T-106 07/95 Manual U-109 07/94 Auto AX-101 08/98 Manual C-108 T-106 07/95 Manual U-110 01/98 Manual B-101 C-108 T-109 09/94 Manual U-201 B-103 09/98 Manual B-104 C-109 T-107 06/94 Manual U-201 B-104 U-201 B-103 C-204 T-106 07/95 Manual U-203 09/98 Manual B-106 C-201 T-111 T-108 09/95 Manual U-203 09/98 Manual B-107 C-202 T-111 0 T-108 09/95 Manual U-204 6/98 Manual B-108 C-201 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 C-200 T-111 0 T-109 09/95 Manual B-109 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200 T-200				***	-			*						·	Auto
AP-107				***		12/96	Manual					***		07/95	Auto
AP-108 SY-105 SX-109 O9/98 Auto TY-103 O9/96 Auto Auto Auto BY-106 SX-110 TY-104 O6/95 Auto Auto Auto Auto BY-107 SX-111 TY-105 12/95 Auto Auto Auto Auto BY-108 SX-111 TY-106 12/95 Auto Auto Auto BY-108 SX-112 TY-106 12/95 Auto Auto Auto Auto BY-108 SX-113 U-101 Auto Auto Auto BY-110 Z/97 Manual SX-114 U-101 Auto Auto BY-110 Z/97 Manual SX-114 U-102 O1/98 Manual Auto O6/98 Auto BY-111 Z/97 Manual SX-114 U-102 O1/98 Manual Auto Auto Auto BY-112 SY-101 O7/94 Auto U-104 Auto AX-101 O9/95 Auto BY-112 SY-101 O7/94 Auto U-106 O7/94 Auto AX-102 O9/98 Manual C-101 SY-102 O6/94 Manual U-105 O7/94 Auto AX-103 O9/95 Auto C-102 SY-103 O7/94 Auto U-106 O8/94 Auto AX-104 O1/96 Auto C-103 O8/94 Auto T-101 O5/95 Manual U-107 O8/94 Auto AX-104 O3/96 Manual C-104 T-102 O6/94 Auto U-108 O5/95 Auto AX-101 O3/96 Manual C-105 O5/96 Manual T-103 O7/95 Manual U-109 O7/94 Auto AX-101 O8/96 Manual C-106 O2/96 Auto T-106 O7/95 Manual U-109 O7/96 Manual AZ-101 O8/96 Manual C-106 OZ/96 Auto T-106 O7/95 Manual U-109 O7/96 Manual AZ-101 O8/96 Manual C-106 OZ/96 Auto T-106 O7/95 Manual U-110 O1/96 Manual AZ-101 O8/96 Manual U-110 O1/96 Manual U-111 O1/96 Manual U-107 O8/98 Manual U-108 O7/95 Manual U-109 O7/98 Manu				*					-				TY-102	09/95	Auto
AW-101 08/95 Auto BY-108 SX-110 TY-104 06/95 Auto AW-102 05/98 Auto BY-107 SX-111 TY-105 12/95 Auto AW-103 05/98 Auto BY-108 SX-113 U-101 U-101 AW-105 08/98 Auto BY-110 Z/97 Manual SX-113 U-101 U-102 01/98 Manual AX-105 08/98 Auto BY-111 2/97 Manual SX-114 U-102 01/98 Manual AX-101 09/95 Auto BY-111 2/97 Manual SX-115 U-103 07/94 Auto AX-101 09/95 Auto BY-112 SY-102 06/94 Manual U-105 07/94 Auto AX-101 09/95 Auto C-102 SY-102 06/94 Manual U-105 07/94 Auto AX-103 09/95 Auto C-102 SY-102 06/94 Manual U-105 07/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AX-101 09/96 Manual C-104 T-101 05/95 Manual U-108 06/96 Auto AX-102 01/98 Auto C-105 05/98 Manual T-103 07/95 Manual U-108 05/95 Auto AX-101 08/96 Manual C-106 02/98 Auto T-104 12/95 Manual U-108 05/95 Auto AX-101 08/96 Manual C-105 05/98 Auto T-104 12/95 Manual U-108 05/96 Auto AX-101 08/96 Manual C-106 02/98 Auto T-104 12/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-106 02/98 Auto T-104 12/95 Manual U-110 01/98 Manual AX-101 C-108 02/95 Manual C-109 T-108 05/95 Manual U-110 01/98 Manual B-105 C-107 04/95 Auto T-105 07/95 Manual U-112 D-112 D				***					·	09/98	Auto		TY-103	09/95	Auto
AW-102 05/96 Auto BY-107 SX-111 TY-106 12/95 Auto AW-103 05/96 Auto BY-108 SX-112 TY-106 12/95 Auto AW-104 01/96 Auto BY-108 SX-112 U-101 AW-104 01/96 Auto BY-109 SX-113 U-101 AW-105 06/96 Auto BY-110 2/97 Manual SX-114 U-102 01/96 Manual AW-106 06/96 Auto BY-111 2/97 Manual SX-115 U-103 07/94 Auto AX-101 09/95 Auto BY-112 SY-101 07/94 Auto U-104 U-104 SY-102 06/94 Manual U-105 07/94 Auto AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-106 07/94 Auto AX-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AX-101 03/96 Manual C-104 SY-102 06/94 Auto U-108 05/95 Auto AX-101 03/96 Manual C-104 T-103 07/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-106 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-106 02/96 Auto T-106 07/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-106 02/96 Auto T-106 07/95 Manual U-109 07/94 Auto AX-101 08/96 Manual C-108 T-106 07/95 Manual U-110 01/96 Manual AX-102 C-107 04/95 Auto T-105 07/95 Manual U-110 01/96 Manual AX-104 D-109 T-108 T-108 T-109 09/94 Manual U-109 07/98 Manual B-104 C-110 T-108 T-108 T-109 09/94 Manual B-105 C-201 T-111 00/95 Manual B-106 C-201 T-111 00/95 Manual B-107 C-202 T-111 00/95 Manual B-108 C-203 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-204 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual B-109 C-200 T-111 00/95 Manual		08/95	Auto	*					4				TY-104	06/95	Auto
AW-103 05/86 Auto 8Y-108 SX-112 U-101 U-101 AW-105 06/96 Auto 8Y-110 2/97 Manual SX-113 U-101 U-102 01/96 Manual AW-105 06/96 Auto 8Y-111 2/97 Manual SX-115 U-103 07/94 Auto AX-101 09/95 Auto 8Y-111 2/97 Manual SX-115 U-103 07/94 Auto U-104 AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-105 07/94 Auto AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-106 08/94 Auto AX-103 09/95 Auto C-102 SY-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AX-101 03/96 Manual C-104 SY-102 06/94 Manual U-107 08/94 Auto AX-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AX-101 08/96 Manual C-106 05/96 Manual T-103 07/95 Manual U-107 08/94 Auto AX-101 08/96 Manual C-106 05/96 Manual T-103 07/95 Manual U-108 05/95 Auto AX-101 08/96 Manual C-106 05/96 Auto T-104 12/95 Manual U-110 01/96 Manual B-101 C-108 D-108 Auto T-106 07/95 Manual U-110 01/96 Manual B-101 C-108 T-108 D-109 T-106 07/95 Manual U-111 01/96 Manual B-103 C-107 04/95 Auto T-106 07/95 Manual U-111 01/96 Manual B-103 C-108 T-108 T-108 07/95 Manual U-111 01/96 Manual B-104 C-108 D-109 T-106 07/95 Manual U-111 01/96 Manual B-103 C-110 T-108 T-108 07/95 Manual U-109 U-201 B-103 C-110 T-108 D-109 T-108 U-109 U-201 B-104 D-109 U-201 B-104 D-109 U-201 B-104 D-109 U-201 D-109 U-								***					TY-105	12/95	Auto
AW-104 01/96 Auto BY-109 SX-113 U-101 AW-106 06/96 Auto BY-110 2/97 Manual SX-114 U-102 01/96 Manual AW-106 06/96 Auto BY-111 2/97 Manual SX-115 U-103 07/94 Auto AX-101 09/95 Auto BY-112 SY-101 07/94 Auto U-104 AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-105 07/94 Auto AX-103 09/95 Auto C-102 SY-102 06/94 Manual U-105 07/94 Auto AX-103 09/95 Auto C-103 08/94 Auto T-101 05/95 Manual U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AX-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AX-101 08/96 Manual C-106 02/96 Manual T-103 07/96 Manual U-107 08/94 Auto AX-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-109 07/94 Auto AX-102 C-107 04/95 Auto T-104 12/95 Manual U-110 01/96 Manual AX-102 C-107 04/95 Auto T-106 07/95 Manual U-110 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-103 C-110 T-106 07/95 Manual U-107 C-108 T-106 07/95 Manual U-107 C-108 T-106 07/95 Manual U-108 U-201 C-110 T-108 09/94 Manual U-203 C-110 T-108 09/94 Manual U-203 C-110 T-108 09/94 Manual U-203 C-111 T-108 09/94 Manual U-203 C-112 03/96 Manual T-110 05/95 Manual U-204 6/98 Manual B-105 C-202 T-111 07/95 Manual U-204 6/98 Manual B-106 C-202 T-112 03/96 Manual T-201 T-202 C-203 T-112 09/95 Manual B-109 T-204 6/98 Manual B-106 C-204 T-201 T-203 T-204 T-203 T-204				*									TY-106	12/95	Auto
AW-105 O6/96 Auto BY-110 2/97 Manual SX-114 U-102 O1/96 Manual AW-106 O6/96 Auto BY-111 2/97 Manual SX-115 U-103 O7/94 Auto AX-101 O9/95 Auto BY-112 SY-101 O7/94 Auto U-103 O7/94 Auto AX-102 O9/98 Manual C-101 SY-102 O6/94 Manual U-105 O7/94 Auto AX-103 O9/95 Auto C-102 SY-103 O7/94 Auto U-106 O8/94 Auto U-106 O8/94 Auto AX-104 10/96 Auto C-103 O8/94 Auto T-101 O5/95 Manual U-107 O8/94 Auto AX-101 O3/96 Manual C-104 T-102 O6/94 Auto U-108 O5/95 Auto AX-101 O8/96 Manual U-105 O5/95 Auto U-108 O5/95 Auto T-102 O6/94 Auto U-108 O5/95 Auto AX-101 O8/96 Manual U-106 O2/96 Auto T-104 12/95 Manual U-109 O7/94 Auto AX-101 O8/96 Manual C-106 O2/96 Auto T-104 12/95 Manual U-110 O1/96 Manual AZ-101 O8/96 Manual C-106 O2/96 Auto T-104 12/95 Manual U-110 O1/96 Manual AZ-102 C-108 T-106 O7/95 Manual U-111 O1/96 Manual D-102 O2/95 Manual C-109 T-106 O7/95 Manual U-111 O1/96 Manual D-102 O2/95 Manual C-109 T-106 O7/95 Manual U-112 D-112 D				*	BY-109		<u> </u>	*					U-101		
AW-106 06/96 Auto BY-111 2/97 Manual SX-115 U-103 07/94 Auto AX-101 09/95 Auto BY-112 SY-101 07/94 Auto U-104 AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-105 07/94 Auto AX-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AY-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AY-101 08/96 Manual C-106 06/96 Manual T-103 07/95 Manual U-109 07/94 Auto AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-109 07/94 Auto AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-110 01/96 Manual AZ-102 C-108 T-106 07/95 Manual U-111 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-103 C-110 T-106 T-106 07/95 Manual U-112 B-103 C-111 T-108 10/95 Manual U-202 B-103 C-110 T-106 T-108 10/95 Manual U-202 D-111 D-112 B-105 D-106 C-112 03/96 Manual T-110 07/95 Manual U-203 09/98 Manual B-106 C-112 03/96 Manual T-110 07/95 Manual U-203 09/98 Manual B-107 C-202 T-111 T-108 09/94 Manual U-203 09/98 Manual B-108 C-201 T-112 03/96 Manual T-110 07/95 Manual B-109 C-202 T-112 09/95 Manual B-109 C-203 T-201 T-111 07/95 Manual B-109 C-204 T-120 D-109 T-204 B-109 T-203 D-1099 Manual B-109 C-204 T-120 D-1099 T-203 D-1099 Manual B-109 C-204 T-120 D-1099 T-203 D-1099 Manual B-109 C-204 T-203 T-204 D-1099 Manual B-109 C-204 T-203 D-1099 Manual B-109 T-200 D-1099 Manual B-110 T-200 D-1099 Manual B-111 T-200 D-1099 Manual			Auto	**	BY-110	2/97	Manual	*	SX-114			***	U-102	01/96	Manual
AX-101 09/95 Auto 8Y-112 SY-101 07/94 Auto U-104 AX-102 09/98 Manuel C-101 SY-102 06/94 Manuel U-105 07/94 Auto AX-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manuel U-107 08/94 Auto AY-101 03/96 Manuel C-104 T-102 06/94 Auto U-108 05/95 Auto AY-102 01/98 Auto C-105 05/96 Manuel T-103 07/95 Manuel U-108 05/95 Auto AZ-101 08/96 Menuel C-106 02/96 Auto T-104 12/96 Manuel U-109 07/94 Auto AZ-101 08/96 Menuel C-106 02/96 Auto T-105 07/95 Manuel U-110 01/98 Manuel AZ-102 C-107 04/95 Auto T-105 07/95 Manuel U-111 01/98 Manuel B-101 C-108 T-106 07/95 Manuel U-112 B-103 C-110 T-106 07/95 Manuel U-112 B-104 C-110 T-106 07/95 Manuel U-201 B-105 C-111 T-108 10/95 Manuel U-202 B-106 C-201 T-111 05/95 Auto U-204 6/98 Manuel B-107 C-202 T-111 07/95 Manuel B-108 C-203 T-201 B-109 C-204 T-203 T-203 B-109 C-204 T-203 T-204			Auto		BY-111	2/97	Manual	×	SX-115				U-103	07/94	Auto
AX-102 09/98 Manual C-101 SY-102 06/94 Manual U-105 07/94 Auto AX-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AY-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AY-102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-107 07/94 Auto AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-109 07/94 Auto AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-110 01/98 Manual AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-110 01/98 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-102 02/95 Manual C-109 T-106 07/95 Manual U-112 B-103 C-110 T-108 10/95 Manual U-201 B-104 C-111 T-108 10/95 Manual U-202 B-104 C-111 T-109 09/94 Manual U-203 09/98 Manual B-106 C-201 T-111 07/95 Manual U-204 6/98 Manual B-107 C-202 T-111 07/95 Manual U-204 6/98 Manual B-108 C-201 T-112 09/95 Manual U-204 B-108 B-109 C-204 T-203 T-201 B-109 T-203 T-204				*	BY-112				SY-101	07/94	Auto		U-104		
AX-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AY-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AY-102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto AY-101 08/96 Manual C-106 02/96 Auto T-104 12/96 Manual U-109 07/94 Auto AZ-101 08/96 Manual C-107 04/95 Auto T-104 12/96 Manual U-110 01/96 Manual AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-110 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-101 C-108 T-106 07/95 Manual U-112 D1/96 Manual U-112 D1/96 Manual U-109 T-107 06/94 Auto U-201 D1/96 D1/96 D1/96 D1/96 Manual U-109 T-108 10/95 Manual U-202 D1/96 D1/96 D1/96 D1/96 Manual U-203 09/98 Manual D1/96 D1/96 D1/96 D1/96 D1/96 Manual D1/96 D1/9	AX-102		Manual	×	C-101				SY-102	06/94	Manual		U-105	07/94	Auto
AX-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto AY-101 03/96 Manual C-104 T-102 06/94 Auto U-108 05/95 Auto AY-102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-110 01/96 Manual AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-110 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-102 02/95 Manual C-109 T-106 07/95 Manual U-112 B-103 C-110 T-108 10/95 Manual U-201 B-104 C-111 T-108 10/95 Manual U-202 B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual B-106 C-201 T-111 07/95 Manual B-107 C-202 T-112 09/95 Manual B-108 C-203 T-201 T-201 B-109 C-204 T-203 T-204 B-110 T-203 B-110	AX-103	09/95	Auto	*	C-102				SY-103	07/94	Auto	8	U-106	08/94	Auto
AY-102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-110 01/96 Manual AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-111 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual B-102 02/95 Manual C-109 T-107 06/94 Auto U-201 B-103 C-110 T-108 10/95 Manual U-202 B-104 C-111 T-109 09/94 Manual U-202 B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual B-106 C-201 T-111 07/95 Manual B-107 C-202 T-112 09/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 T-204	AX-104	10/96	Auto	▓	C-103	08/94	Auto	*	T-101	05/95	Manual		U-107	08/94	Auto
AZ-101 08/96 Manual C-106 02/96 Auto T-104 12/95 Manual U-110 01/96 Manual AZ-102 C-107 04/95 Auto T-105 07/95 Manual U-111 01/96 Manual B-101 C-108 T-106 07/95 Manual U-111 01/96 Manual U-112 T-102 02/95 Manual C-109 T-107 06/94 Auto U-201 T-108 10/95 Manual U-202 T-108 T-108 10/95 Manual U-202 T-109 D9/94 Manual U-203 09/98 Manual B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual T-106 T-111 07/95 Manual U-204 G9/98 Manual T-110 05/95 Auto U-204 G9/98 Manual T-107 D9/95 Manual T-112 09/95 Manual T-112 09/95 Manual T-108 T-201 T-201 T-203 T-204 T-	AY-101	03/96	Manual		C-104				T-102	06/94	Auto		U-108		Auto
AZ-102 C-107 O4/95 Auto T-105 O7/95 Manual U-111 O1/96 Manual B-101 C-108 T-106 O7/95 Manual U-112 C-109 T-107 O6/94 Auto U-201 C-110 T-108 T-108 T-109 O9/94 Manual U-202 C-111 T-109 O9/94 Manual U-203 O9/98 Manual C-112 O3/96 Manual T-110 O5/95 Auto U-204 G/98 Manual C-107 C-202 T-112 O9/95 Manual C-203 T-201 C-204 T-203 C-204 T-203 C-204 T-203 C-204 T-204 C-204 T-204 C-204 C-204 T-204 T-204 C-204 T-204	AY-102	01/98	Auto		C-105	05/96	Manual		T-103	07/95				·	
B-101 C-108 T-106 O7/95 Manual U-112	AZ-101	08/96	Manuai		C-106	02/96	Auto		T-104	12/95	Manual			 	Manual
B-102 02/95 Manual C-109 T-107 06/94 Auto U-201 B-103 C-110 T-108 10/95 Manual U-202 B-104 T-109 09/94 Manual U-203 09/98 Manual B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual B-106 C-201 T-111 07/95 Manual B-107 C-202 T-112 09/95 Manual B-108 C-203 T-201 B-109 T-203 T-204 B-110 T-204	AZ-102			₩	C-107	04/95	Auto		T-105					01/96	Manual
B-103 C-110 T-108 10/95 Manual U-202 B-104 C-111 T-109 09/94 Manual U-203 09/98 Manual B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual B-106 C-201 T-111 07/95 Manual B-107 C-202 T-112 09/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 T-204 B-111 T-204 B-111 T-204 B-111 T-204 T-204 B-111 T-204	B-101			***	1				-						
B-104 C-111 T-108 09/94 Manual U-203 09/98 Manual B-105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual B-106 C-201 T-111 07/95 Manual B-107 C-202 T-112 09/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 T-203 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 T-	B-102	02/95	Manual	*											
B-105 C-112 O3/96 Manual T-110 O5/95 Auto U-204 6/98 Manual B-106 C-201 T-111 O7/95 Manual B-107 C-202 T-112 O9/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 T-203 B-111 T-204 B-111 T-204 B-111 T-204 T-20	B-103			▓	C-110				-						
B-106 C-201 T-111 O7/95 Manual B-107 C-202 T-112 O9/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 B-111 T-204 B-11	B-104			▓											
B-107 C-202 T-112 O9/95 Manual B-108 C-203 T-201 B-109 C-204 T-202 B-110 B-111 T-204 B-109 C-204 T-204 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 B-111 T-204 B-11	B-105			*		03/96	Manuai	***					U-204	6/98	Manual
B-108	B-106														
B-109 C-204 T-202 B-110 B-111 T-204	B-107									09/95	Manual				
B-110 T-203 T-204	B-108						ļ						 		
B-111 T-204	B-109				C-204				3				·	 	
	B-110			▩			ļ		3——				 		
2.1.2 02/05 Manual	B-111								1-204						
D-112 U3/30 mailual	B-112	03/95	Manual				<u> </u>						<u> </u>	<u> </u>	<u> </u>
Total East Area: 43 Total West Area: 69	Total Eas	t Area: 43							Total W					· · · · · · · · · · · · · · · · · · ·	

¹¹² ENRAFs installed: 80 automatically entered into TMACS, 32 manually entered into CASS

TABLE A-8. TANK MONITOR AND CONTROL SYSTEM (TMACS) December 31, 1998

Note: Indicated below are the number of tanks having at least one operating sensor (some tanks have more than one sensor: multiple sensors of the same type in a tank are not shown in the table) for example: 10 tanks in BY-Farm have at least one operating TC sensor and 3 tanks in BY-Farm have at least one operating RTD sensor.

Acceptance Testing Completed: Sensors Automatically Monitored by TMACS

	Temper				<u> </u>	
	·	Resistance				
EAST AREA	Thermocouple	Thermal	ENRAF			Gas
	Tree	Device	Level	Pressure	Hydrogen	Sample
Tank Farm	(TC)	(RTD)	Gauge	(b)	(c)	Flow
A-Farm (6 Tanks)	1	(1,1,0)	3		1 1	1
AN-Farm (7 Tanks)	. 7	·	4	7	3	3
AP-Farm (8 Tanks)			<u> </u>		 	l
AW-Farm (6 Tanks)	6		6		1	1
AX-Farm (4 Tanks)	3		3		(d)	
AY-Farm (2 Tanks)			1		1	
AZ-Farm (2 Tanks)						
B-Farm (16 Tanks)	1		· · · · · · · · · · · · · · · · · · ·			
BX-Ferm (12 Tanks)	11		12			
BY-Farm (12 Tanks)	10	3				
C-Farm (16 Tenks)	15	1	. 3	1		
TOTAL EAST AREA						
(91 Tanks)	54	4	32	8	5	5
WEST AREA			•			
S-Farm (12 Tanks)	12		6	1	3	3
SX-Farm (15 Tanks)	. 14		7	1	7	7
SY-Farm (3 Tanks) (a)	3		2	1	2	2
T-Farm (16 Tanks)	14	1	3		1	1
TX-Ferm (18 Tanks)	13		18			
TY-Farm (6 Tanks)	6	3	6			
U-Farm (16 Tanks)	15		6	4	6	6
TOTAL WEST AREA						
(86 Tanks)	81	4	48	7	18	18
TOTALS (177 Tanks)	131	8	80	15	23	23

⁽a) Tank SY-101 has 2 gas sample flow sensors plus 2 vent flow sensors, and 2 ENRAFs.

⁽b) Each tank has low and high range sensors (9x2=18 sensors)

⁽c) Each tank has low and high range sensors (17x2=34 sensors)

⁽d) AX-101 Hydrogen was ATP'd in TMACS on September 21, 1998, but not transmitting yet - lines plugged.

APPENDIX B

DOUBLE SHELL TANK WASTE TYPE AND SPACE ALLOCATION

TABLE B-1. DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION

DECEMBER 1998

DOUBLE-SHELL TANK INVENTORY B	Y WASTE TYPE	SPACE DESIGNATED FOR SPECIFIC USE				
Complexed Waste (AN-102, AN-106, AN-107, SY-101, SY-103, (AY-101 , AP-108 (DC))	3;97 Mgal	Spare Tanks (3) (1 Aging & 1 Non-Aging Waste Tank)	2:28 Mgal			
Concentrated Phosphate Waste (AP-102)	1:09 Mgal	Watch List Tank Space (AN-103, AN-104, AN-105, AW-101, SY-101, SY-103)	0.67 Mgal			
Double-Shell Slumy and Slumy Feed (AN-103, AN-104, AN-105, AP-101, AW-101, AW-106)	4.4 Mgal	Segregated Tank Space (AN-102, AN-107, AP-102, AZ-101, AZ-102	0.43 Mgal			
Aging Waste (NCAW) at 5M Na Dilute in Aging Tanks (AZ-101, AZ-102)	1,23 Mgat 0,37 Mgal	Receiver/Operational Tank Space (2) (AP-106, AP-108, AW-102, AW-106, SY-102)	2.94 Mgal			
Dilute Waste (1) (AN-101, AP-103, AP-105, AP-104, AP-108, AP-107, AW-102, AW-103, AW-104, AW-105, AY-102, SY-102)	3.65 Mgal	Total Specific Use Space (12/31/98)	6.32 Mgal			
,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	. [TOTAL DOUBLE-SHELL TANK SPACE				
NCRW, PFP and DST Settled Solids (All DST's)	4:04 Mgal	24 Tanks at 1140 Kgal 4 Tanks at 980 Kgal	27,36 Mgal 3.92 Mgal 31,28 Mgal			
Total Inventory≖	18:75 Mgal	Total Available Space Double-Shell Tank Inventory Space Designated for Specific Use Remaining Unallocated Space	31:28 Mgal 18:75 Mgal 6:32 Mgal 6:21 Mgal			

⁽¹⁾ Was reduced in volume by -0.00 Mgal this month (Evaporator WVR)

Note: Net change in total DST inventory since last month: +0.006 Mgal

⁽²⁾ Tank Space Reduced by Facility Generations and Saltwell Liquid pumping

^{(3) 241-}AY-101: A minumum liquid level is set to provide extra protection against any bottom uplifting of the tank's steel liner. Because of space availability, waste is stored in AY-102, the aging waste spare tank. In case of a leak the contents of AY-102 will be distributed to any other DST(s) having available space.

AN-103=

Table B-2. Double Shell Tank Waste Inventory for December 31, 1998

TANKS	INVENTORY	SOLIDS	TYPE	LEFT
AN-101=	158	33	DN	982
AN-102=	1064	89	CC	76
AN-103=	957	410	DSS	183
AN-104=	1053	449	DSSF	87
AN-105=	1126	489	DSSF	14
AN-108#	39 .	17	CC	1101
AN-107=	1047	247	CC	93
AP-101=	1115	ο	DSSF	25
AP-102=	1093	0	CP	47 -
AP-103=	24	1	DN	1116
AP-104=	24	0	DN	1116
AP-105=	766	89	DSSF	374
AP-106=	389	0	DN	751
AP-107=	22	0	DN	1118
AP-108=	254	0	DC	886
AW-101=	1125	306	DSSF	15
AW-102=	591	40	DN	549
AW-103=	511 ·	347	NCRW	629
AW-104=	1119	231	DN	21
AW-105=	432	280	NCRW	708
AW-106=	580	228	CC	560
AY-101=	167	108	DÇ	813
AY-102=	483	32	DN	517
AZ-101=	849	47	NCAW	131
AZ-102=	898	104	NCAW	82
SY-101=	1170	41	CC	-30
SY-102=	974	88	DN/PT	166
SY-103=	740	362	CC	400
SY-103= TOTAL#	740 18750	362 4038	CC	400 125

NOTE: Solids Adjusted to Most Current Available Data NOTE: All Volumes in Kilo-Gallons (Kgals)

TOTAL	ST SPACE AVAILABLE	DST INVENTORY CHANG		
NON-AGING	= 27360	11/98 TOTAL		
AGING =	3920	12/98 TOTAL		
TOTAL	31280	INCREASE		
\				
		USABLE SPACE		
		AN-101=		
		AN-106=		

183

AN-103=	אר
AN-104=	8
AN-105=	14
AW-101=	1
SY-101=	-3
SY-103=	. 40
	000000000000000000000000000000000000000
	66 CE (CC,CP,AW)
TOTAL* SEGREGATED SPACE AN-102=	CE (CC,CP,AW)
	CE (CC,CP,AW)
SEGREGATED SPAC AN-102=	CE (CC,CP,AW) 7 '9
SEGREGATED SPAC AN-102= AN-107=	DE (CC,CP,AW) 7 19 4
SEGREGATED SPAG AN-102= AN-107= AP-102=	

WATCH LIST SPACE

WASTE RECEIVER S	PACE
AP-106 (200E/DN)=	751
AP-108 (200E/DN)=	886
SY-102 (200W/DN)=	166
TOTAL=	1803

USABLE SPACE	
AN-101=	982
AN-106=	1101
AP-101=	25
AP-103=	1116
AP-104=	1116
AP-105=	374
AP-107=	1118
AW-102=	549
AW-103=	629
AW-104=	21
AW-105=	708
AW-106=	580
AY-101=	813
AY-102=	517
TOTAL=	9629
EVAP. OPERATIONS	-1140
SPARE SPACE	-2280
USABLE LEFT*	6209

18744 18750

USABLE SPACE CHANGE	
3306	
6209	
2903	

WASTE RECEIVER SPACE C	HANGE
11/98 TOTAL SPACE	1920
12/98 TOTAL SPACE	.1803
CHANGE*	-117

inventory Calculation by Waste Type:

COMPLEXED WASTE		
AN-102=	975 (CC)	
AN-106=	22 (CC)	
AN-107=	800 (CC)	
AP-108=	254 (DC)	
AW-106=	352 (CC)	
AY-101=	59 (DC)	
SY-101=	1129 (CC)	
SY-103=	378 (CC)	
TOTAL DC/CC=	3969	
TOTAL SOLIDS=	1092	

NCRW SOLIDS (PD)		
347		
280		

PFP SOLIDS (PT)			
SY-102=	88		
(O) AL®	88		

	CONCENTRATED PHOSPHATE (CP)		
102-AP=	1093		
TOTAL=	1093		

DILUTE WASTE (DN)	
AN-101=	125
AP-103=	23
AP-104=	24
AP-108≃	389
AP-107=	22
AW-102=	55°
AW-103=	164
AW-104=	888
AW-105=	152
AY-102=	43 [,]
SY-102=	886
TOTAL DN=	3650
TOTAL SOLIDS#	33

NCAW (AGING WASTE) (@ 5M Na)	
AZ-102=	434
TOTAL @ ~5M N##	122
TOTAL DN=	37
TOTAL SOLIDS*	15

DSS/DSSF	
AN-103=	547
AN-104=	604
AN-105=	637
AP-101=	1115
AP-105=	677
AW-101=	819
TOTAL DSS/DSSF#	4399
TOTAL SOLIDS#	1743


GRAND TOTALS	
NCRW SOLIDS=	627
DST SOLIDS=	3172
PFP SOLIDS≖	88
aging solids=	151
cc=	3656
DC=	313
CP=	1093
NCAW=	1596
DSS/DSSF=	4399
DILUTE=	3655
TOTAL	18760

NOTE: Tank AW-106 (evaporator receiver) has Concentrated Complexed (CC) waste in it and will be transferred to Tank 106-AN.

Table B-2. Double Shell Tank Waste Inventory for December 31, 1998

TOTAL AVAILABLE SPACE AS O	F DECEMBER	R 31, 1998:	12530 KGALS
WATCH LIST TANK SPACE:	TANK	WASTE TYPE	AVAILABL SPACE
Unusable DST Headspace - Due to Special Restrictions	AN-103	DSS	183 KGALS
Placed on the Tanks, as Stated in the "Wyden Bill"	AN-104	DSSF	87 KGALS
·	AN-105	DSSF	14 KGALS
	AW-101	DSSF	15 KGALS
•	SY-101	CC	-30 KGALS
•	SY-103	CC	400 KGALS
		TOTAL=	669 KGALS
		AVAILABLE TANK SPACE=	12530 KGALS
	М	INUS WATCH LIST SPACE≃	-669 KGALS
TOTAL AVAILABLE SPACE AFTER W	ATCH LIST S	PACE DEDUCTIONS#	11861 KGALS
SEGREGATED TANK SPACE:	TANK	WASTE TYPE	AVAILABL SPACE
DST Headspace Available to Store Only Specific Waste T	- •		
	AN-102	CC	76 KGALS
	AN-107	CC ·	93 KGALS
	AP-102	CP	47 KGALS
	AZ-101	AW	131 KGALS
·	AZ-102	AW	82 KGALS
•		TOTAL=	429 KGALS
AVAILABLE SPAC	E AFTER WA	ATCH LIST DEDUCTIONS=	11861 KGALS
·	-	S SEGREGATED SPACE=	-429 KGALS
TOTAL AVAILABLE SPACE AFTER SEC	REGATEDS	PACE DEDUCTIONS=	11432 KGALS
JSABLE/WASTE RECEIVER TANK SPACE:	TANK	WASTE TYPE	AVAILABL SPACE
DST Headspace Available to Store Facility Generated	AN-101	DN	982 KGALS
and Evaporator Product Waste	AN-106	CC	1101 KGALS
	AP-101	DSSF	25 KGALS
	AP-103	DN	1116 KGALS
	AP-104	DN	1116 KGALS
	AP-105	DSSF	374 KGALS
FACILITY WASTE RECEIVER TANK	AP-106	DN	751 KGALS
	AP-107	DN	1118 KGALS
FACILITY WASTE RECEIVER TANK	AP-108	DC	886 KGALS
EVAPORATOR FEED TANK	AW-102	DN	549 KGALS
•	AW-103	NCRW	629 KGALS
•	AW-104	DN	21 KGALS
	AW-105	NCRW	708 KGALS
•			560 KGALS
EVAPORATOR RECEIVER TANK		CC	
EVAPORATOR RECEIVER TANK	AW-106	CC DC	813 KGALS
EVAPORATOR RECEIVER TANK	AW-106 AY-101	DC	813 KGALS
•	AW-106 AY-101 AY-102		813 KGALS 517 KGALS
FACILITY WASTE RECEIVER TANK	AW-106 AY-101 AY-102 SY-102	DC DN	813 KGALS
FACILITY WASTE RECEIVER TANK	AW-106 AY-101 AY-102 SY-102	DC DN DN	813 KGALS 517 KGALS 166 KGALS 11432 KGALS
FACILITY WASTE RECEIVER TANK	AW-106 AY-101 AY-102 SY-102	DC DN DN	813 KGALS 517 KGALS 166 KGALS

SEG1298

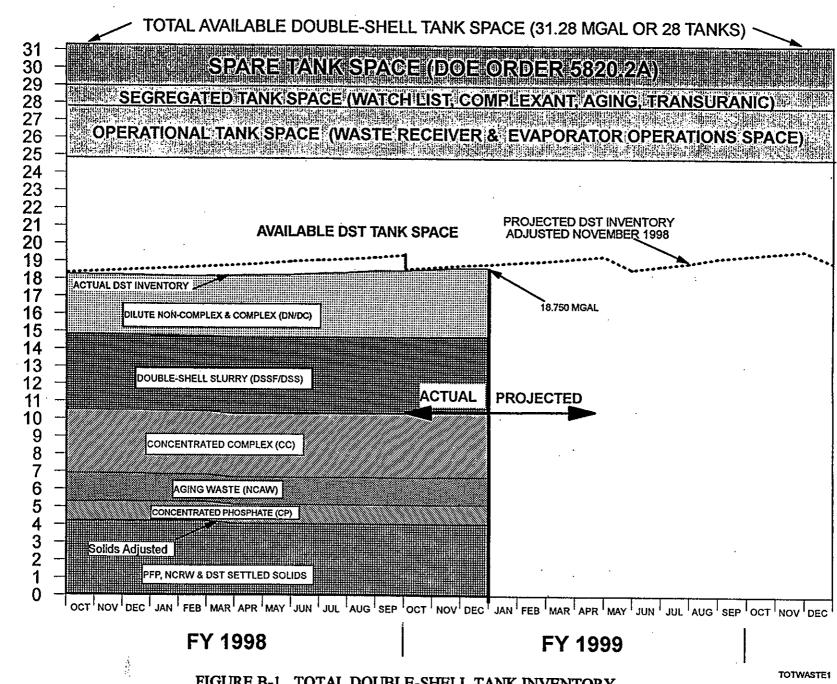

MILLIONS OF GALLONS

FIGURE B-1. TOTAL DOUBLE-SHELL TANK INVENTORY

This page intentionally left blank

APPENDIX C

TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS

C. TANK AND EQUIPMENT CODE/STATUS DEFINITIONS

December 31, 1998

1. TANK STATUS CODES

WASTE TYPE (also see definitions, section 3)

AGING Aging Waste (Neutralized Current Acid Waste [NCAW]) CC Complexant Concentrate Waste CP Concentrated Phosphate Waste DC Dilute Complexed Waste Dilute Non-Complexed Waste DN DSS Double-Shell Slurry DSSF Double-Shell Slurry Feed Non-Complexed Waste NCPLX PD/PN Plutonium-Uranium Extraction (PUREX) Neutralized Cladding

Removal Waste (NCRW), transuranic waste (TRU)

Plutonium Finishing Plant (PFP) TRU Solids

TANK USE (DOUBLE-SHELL TANKS ONLY)

CWHT Concentrated Waste Holding Tank
DRCVR Dilute Receiver Tank

EVFD Evaporate Feed Tank SRCVR Slurry Receiver Tank

2. SOLID AND LIQUID VOLUME DETERMINATION METHODS

F Food Instrument Company (FIC) Automatic Surface Level Gauge

E ENRAF Surface Level Gauge (being installed to replace FICs)

M Manual Tape Surface Level Gauge

P Photo Evaluation

S Sludge Level Measurement Device

3. **DEFINITIONS**

PT

WASTE TANKS - GENERAL

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition.

Watch List Tank

An underground storage tank containing waste that requires special safety precautions because it may have a serious potential for release of high level radioactive waste because of uncontrolled increases in temperature or pressure. Special restrictions have been placed on these tanks by "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the *National Defense Authorization Act for Fiscal Year 1991*, November 5, 1990, Public Law 101-510, (also known as the Wyden Amendment).

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to insure safe storage and interim operation, and ultimate disposition of the waste.

WASTE TYPES

Aging Waste (AGING)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW)

Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste.

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants: ethylenediaminetetra-acetic acid (EDTA), citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA), being the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from T and S Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernate).

Double-Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

Non-complexed (NCPLX)

General waste term applied to all Hanford Site (NCPLX) liquors not identified as complexed.

PUREX Decladding (PD)

PUREX Neutralized Cladding Removal Waste (NCRW) is the solids portion of the PUREX plant neutralized cladding removal waste stream; received in Tank Farms as a slurry. NCRW solids are classified as transuranic (TRU) waste.

PFP TRU Solids (PT)

TRU solids fraction from PFP Plant operations.

Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces, and will therefore migrate or move by gravity. (See also Section 4 below – page C-7)

Supernate

The liquid above the solids in waste storage tanks. (See also Section 4 below – page C-7)

Ferrocyanide

A compound of iron and cyanide commonly expressed as FeCN. The actual formula for the ferrocyanide anion is $[Fe(CN)_6]^{-4}$.

INTERIM STABILIZATION (Single-Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant liquid. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow must also have been at or below 0.05 gpm before interim stabilization criteria is met.

Jet Pump

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 gallons to about 4 gpm.

Saltwell Screen

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches.

Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure (WFIE) with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

INTRUSION PREVENTION (ISOLATION) Single-Shell Tanks only

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993, Interim Isolation was replaced by Intrusion Prevention.

Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" - provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusuable equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

TANK INTEGRITY

Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicates a <u>new</u> loss of liquid attributed to a breach of integrity.

TANK INVESTIGATION

Intrusion

A term used to describe the infiltration of liquid into a waste tank.

SURVEILLANCE INSTRUMENTATION

Drywells

Drywells are vertical boreholes with 6-inch (internal diameter) carbon steel casings positioned radially around SSTs. These wells range between 50 and 250 feet in depth, and are monitored between the range of 50 to 150 feet. The wells are sealed when not in use. They are called drywells because they do not penetrate to the water table and are therefore usually "dry." There are 759 drywells.

Monitoring is done by gamma radiation or neutron-moisture sensors to obtain scan profiles of radiation or moisture in the soil as a function of well depth, which could be indicative of tank leakage.

Two single-shell tanks (C-105 and C-106) are currently monitored monthly by gamma radiation sensors. The remaining drywells are monitored on request by gamma radiation sensors. Monitoring by neutron-moisture sensors is done only on request.

Laterals

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Computer Automated Surveillance System (CASS).

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Company (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape

reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and also transmit the reading to the CASS. Some tanks have gauges connected to CASS and others are read manually. FICs are being replaced by ENRAF detectors (see below).

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the Tank Monitor and Control System (TMACS). The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Annulus

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. Alarms from the annunciators are received by CASS. Continuous Air Monitoring (CAM) alarms are also located in the annulus. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Liquid Observation Well (LOW)

In-tank liquid observation wells are used for monitoring the interstitial liquid level (ILL) in single-shell waste storage tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL, a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends and have a nominal outside diameter of 3.5 inches. Two probes are used to monitor changes in the ILL; gamma and neutron, which can indicate intrusions or leakage by increases or decreases in the ILL. There are 65 LOWs (64 are in operation) installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid, and in two DSTs only. The LOWs installed in two DSTs, (SY-102 and AW-103 tanks), are used for special, rather than routine, surveillance purposes only.

Thermocouple (TC)

A thermocouple is a thermoclectric device used to measure temperature. More than one thermocouple on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are thermocouple elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed. A single thermocouple (probe) may be installed in a riser, or lowered down an existing riser or LOW. There are also four thermocouple laterals beneath Tank 105-A in which temperature readings are taken in 34 thermocouples.

In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

TERMS/ACRONYMS

CASS Computer Automated Surveillance System

CCS Controlled, Clean and Stable (tank farms)

II Interim Isolated

IP Intrusion Prevention Completed

IS Interim Stabilized

MT/FIC/ENRAF Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement

devices)

OSD Operating Specifications Document

PI Partial Interim Isolated

SAR Safety Analysis Reports

SHMS Standard Hydrogen Monitoring System

TMACS Tank Monitor and Control System

TPA Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology,

U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment, 1994

(Tri-Party Agreement)

USO Unreviewed Safety Ouestion

Wyden Amendment "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510.

4. <u>INVENTORY AND STATUS BY TANK - VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE E-6 (SINGLE-SHELL TANKS)</u>


COLUMN HEADING	VOLUME CALCULATIONS/DEFINITIONS
Total Waste	Solids volume plus Supernatant liquid. Solids include sludge and saltcake (see definitions below)
Supernate Liquid	Drainable Liquid Remaining minus Drainable Interstitial. Supernate is the clear liquid floating on the surface of the waste. Supernate is usually derived by subtracting the solids level measurement from the liquid level measurement. In some cases, the supernatant volume includes floating solid crusts because their volume cannot be measured. In-tank photographs or videos are useful in estimating the liquid volumes; the area of solids covered and the average depth can be estimated.
Drainable Interstitial Liquid	Drainable Liquid Remaining minus Supernate. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using average porosity values or actual data for each tank, when available. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes in the tank. The sum of the interstitial liquid contained in saltcake and sludge is the initial volume of drainable interstitial liquid. The volume reported as Drainable Interstitial

HNF-EP-0182-129

COLUMN HEADING	VOLUME CALCULATIONS/DEFINITIONS
	Liquid is the initial volume of drainable interstitial liquid minus interstitial liquid removed by pumping.
Pumped This Month	Net total gallons of liquid pumped from the tank during the month. If supernate is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume. The total pumped volume is subtracted from drainable liquid remaining and pumpable liquid remaining. Pump production takes into account the amount of water added to the tank during the month (if any).
Total Pumped	Cumulative net total gallons of liquid pump from 1979 to date.
Drainable Liquid Remaining	Supernate plus Drainable Interstitial. (See Supernatant Liquid and Drainable Interstitial Liquid above for definitions). The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernate minus total gallons pumped.
Pumpable Liquid Remaining	Drainable Liquid Remaining minus undrainable heel volume. (Dish bottom tanks have a "heel" where liquids can collect: flat bottom tanks do not). (See Drainable Liquid Remaining and Pumped this Month for definitions). Not all drainable interstitial liquid is pumpable. It is assumed that drainable interstitial liquid on top of the undrainable heel in sludge or saltcake, is not jet pumpable. Therefore, pumpable interstitial liquid is the initial volume of drainable interstitial liquid minus the amount of interstitial liquid on top of the heel. The volume shown as Pumpable Liquid Remaining is the sum of pumpable interstitial liquid and supernate minus total gallons pumped.
Sludge	Solids formed during sodium hydroxide additions to waste. Sludge usually was in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator. If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	Indicates the latest update of any change in the solids volume.
Solids Update Source - See Footnote	Indicates the source or basis of the latest solids volume update.
Last In-tank Photo	Date of last in-tank photographs taken.
Last In-tank Video	Date of last in-tank video taken.
See Footnotes for These Changes	Indicates any change made the previous month. A footnote explanation for the change follows the Inventory and Status by Tank section (Table E-6).

APPENDIX D

TANK FARM CONFIGURATION, STATUS, AND FACILITY CHARTS

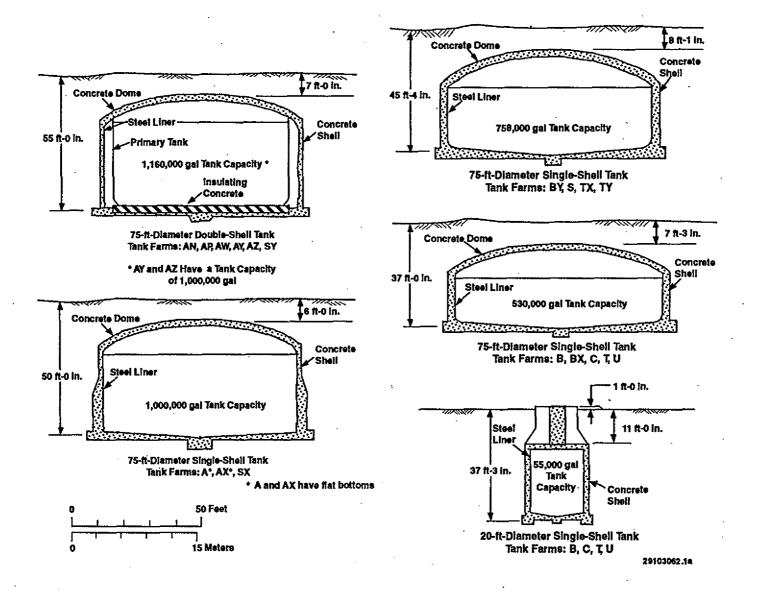

HNF-EP-0182

FIGURE D-1. HIGH-LEVEL WASTE TANK CONFIGURATION

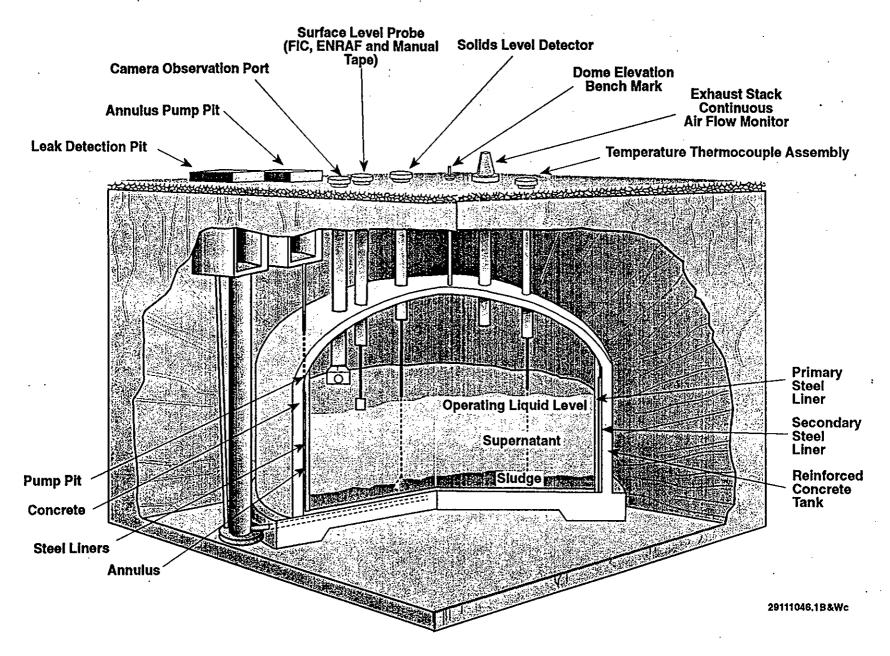


FIGURE D-2. DOUBLE-SHELL TANK INSTRUMENTATION CONFIGURATION



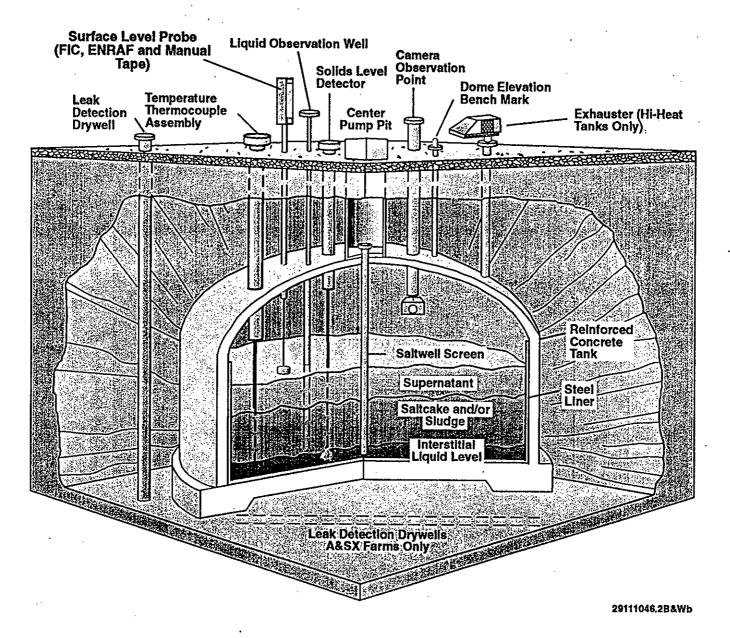


FIGURE D-3. SINGLE-SHELL TANK INSTRUMENTATION CONFIGURATION

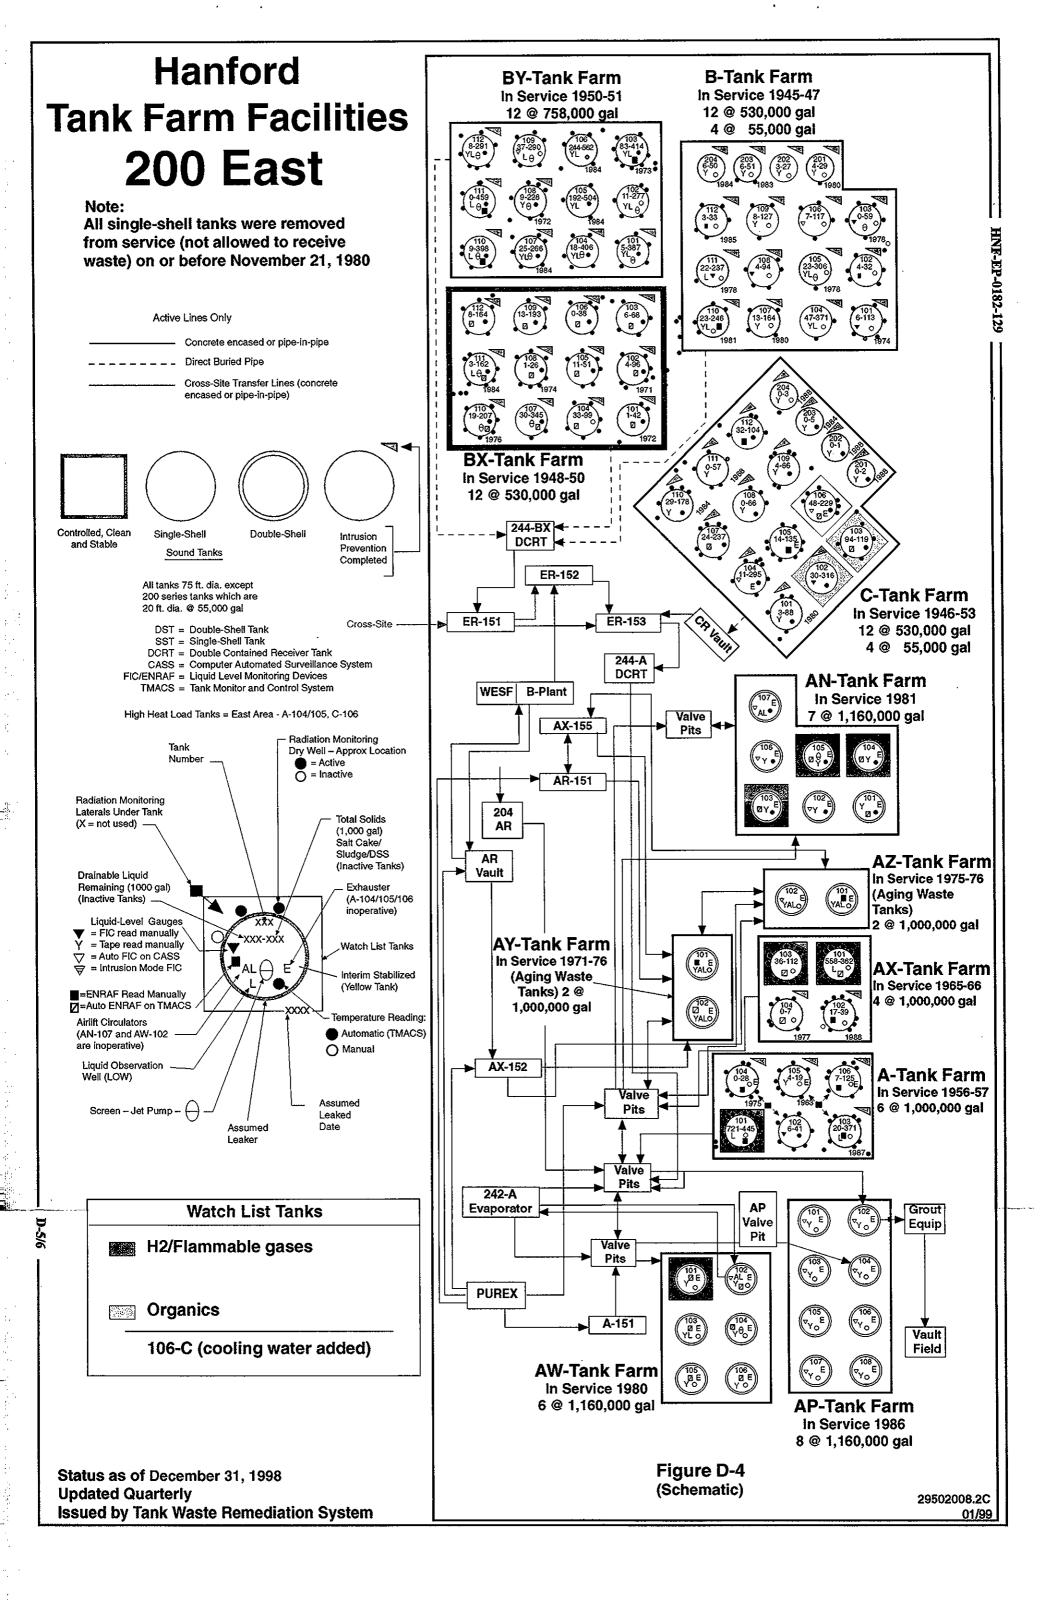

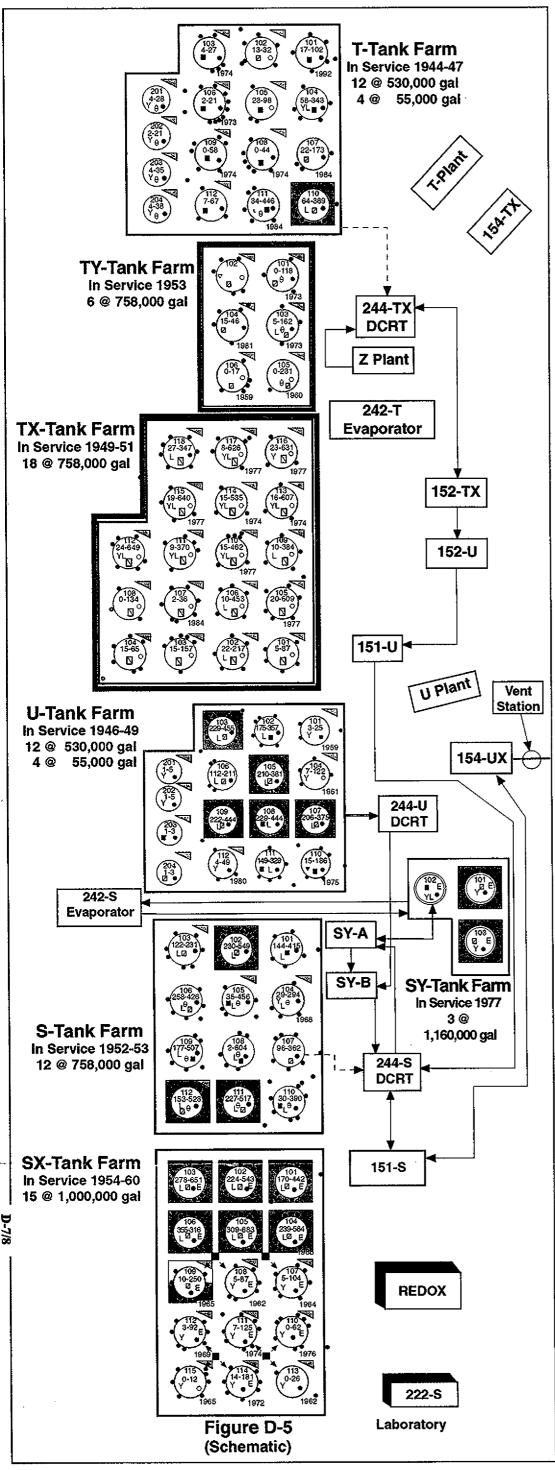

Updated Quarterly Issued by Tank Waste Remediation System

> 29502008.1C 01/99

APPENDIX E

MONTHLY SUMMARY
TANK USE SUMMARY
PUMPING RECORD, LIQUID STATUS AND PUMPABLE
LIQUID REMAINING IN TANK FARMS
INVENTORY SUMMARY BY TANK FARM
INVENTORY AND STATUS BY TANK

E-2

TABLE E-1. MONTHLY SUMMARY TANK STATUS

December 31, 1998

	200	200	
	EAST AREA	WEST AREA	TOTAL
IN SERVICE	25	03	28 (1)
OUT OF SERVICE	66	83	149
SOUND	59	51	110
ASSUMED LEAKER	32	35	67
INTERIM STABILIZED	60	59	119 (2)
ISOLATED			
PARTIAL INTERIM	11	30	41
INTRUSION PREVENTION COMPLETE	5 5	. 53	108
CONTROLLED, CLEAN, AND STABLE	12	24	36

		WASTE VO	LUMES (Kgallo	ns)			
		200	200		SST	DST	
		EAST AREA	WEST AREA	TOTAL	TANKS	TANKS	TOTAL
SUPERN	ATANT						
AGING	Aging waste	1596	0	1596	0	1596	1596
CC	Complexant concentrate waste	2152	1503	3655	3	3652	3655
CP	Concentrated phosphate waste	1093	0	1093	0	1093	1093
DC.	Dilute complexed waste	865	0	865	1	864	865
DN	Dilute non-complexed waste	1912	0	1912	0	1912	1912
DN/PD	Dilute non-complex/PUREX TRU solid	315	. 0	315	0	315	315
DN/PT	Dilute non-complex/PFP TRU solids	0	886	886	0	886	886
NCPLX	Non-complexed waste	157	498	655	655	0	655
DSSF	Double-shell slurry feed	5302	48	5350	951	4399	5350
TOTAL	LSUPERNATANT	13392	2935	16327	1610	14717	16327
SOLIDS			1		. The same a common or a manuscript design of distributions and a state of state of state of state of state of	BD 14-354-1-3007-3000-4840-0-300-1-30-1-30-1-30-1-30-1-30-1-30-1	24-24-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-
Doubl	le-shell slurry	410	0	410	0	410	410
Sludg	.	9334	6273	15607	12063	3544	15607
Saitca	ak o	5188	16390	21578	21499	79	21578
TOTA	AL SOLIDS	14932	22663	37595	33562	4033	37595
TÖ	DTAL WASTE	28324	25598	53922	35172	18750	53922
AVAILA	BLE SPACE IN TANKS	11994	566	12560	0	12560	12560
DRAINA	BLE INTERSTITIAL	1745	4532	6277	5995	282	6277
DRAINA	BLE LIQUID REMAINING	15204	7663	22867	7868	14999	22867

(1) includes six double-shell tanks on Hydrogen Watch List not currently allowed to receive waste, AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103.

(2) Includes one tank (8-202) which does not meet current established supernatant and interstitial liquid stabilization criteria.

TABLE E-2, TANK USE SUMMARY

December 31, 1998

					ISOLATED TAI			
					INTRUSION	CONTROLLED	INTERIM	
TANK	TANKS RECEIVING		ASSUMED	PARTIAL	PREVENTION	CLEAN, AND	TABILIZED	
<u>EARMS</u>	WASTE TRANSERS	SOUND	LEAKER	<u>INTERIM</u>	COMPLETED	STABLE	<u>TANKS</u>	
EAST						:		
A	"	3	3	2	4	0	5	
AN	7 (1)	7	0	0	0		0	
AP	8	8	0	0	0		0	
AW	6 (1)	6	0	. 0	0		0	
AX	0	2	. 2	1	3		3	
AY	2	2	0	0	0		0	
ΑZ	-2	2	0	0	. 0		0	
В	0	6	10	0	16		16	(2)
вх	0	7	5	0	12	12	12	
BY	0	7	5	5	7		10	
BY C	0 0	7 9	5 7	5 3	7 13		10 14	
C 【【Total) WEST	o 3 17 26	9 59	7 32	3 11	13 56 ÷	12	60	
C Total WEST S	o 3	9 59 11	7 32 1	3 11 \$ 1	13 55 4	12	14	
C WEST S S SX	0 26 0 0 0	9 59 11 5	7 32 1 10	3 11 10 6	13 55 ± 2 9	12	14 60 4 9	
C WEST S S SX SY	0 26 0 0 0 3 (1)	9 59 11 5 3	7 32 1 10 0	3 11 10 6 0	13 55 2 9 0		14 60 4 9 0	
C WEST S S SX SY T	0 26 0 0 0 3 (1) 0	9 59 11 5 3 9	7 32 1 10 0 7	3 11 10 6 0 5	13 55 4 2 9 0		14 60 4 9 0 14	
	0 26 0 0 0 3 (1)	9 59 11 5 3	7 32 1 10 0	3 11 10 6 0	13 55 2 9 0	12 18 6	14 60 4 9 0	

(1) Six Double-Shell Tanks on the Hydrogen Tank Watch List are not currently receiving waste transfers (AN-103, 104, 105, AW-101, SY-101 and 103).

(2) Includes tank B-202 which no longer meets established supernatant interstitial liquid stabilization criteria.

TABLE E-3. PUMPING RECORD, LIQUID STATUS AND PUMPABLE LIQUID REMAINING IN TANK FARMS

December 31, 1998

			Waste Ve	olumes (Kgallons)			
TANK	PUMPED	PUMPED FY	CUMULATIVE TOTAL PUMPED	SUPERNATANT	DRAINABLE INTERSTITIAL	DRAINABLE LIQUID	PUMPABLE LIQUID
<i>EARMS</i> East	THIS MONTH	TO DATE	1979 TO DATE	<u>LIQUID</u>	<u>REMAINING</u>	<u>REMAINING</u>	REMAINING
A	0.0	0.0	150.5	517	217	758	697
AN	N/A	N/A	N/A	3710	127	3837	N/A
AP	N/A	N/A	N/A	3597	3	3600	N/A
٩W	N/A	N/A	N/A	2925	142	3067	N/A
AX	0.0	0.0	13.0	389	198	611	540
AY	N/A	N/A	N/A	500	5	505	N/A
AZ	N/A	N/A	N/A	1596	5	1601	N/A
В	0.0	0.0	0.0	15	164	179	80
BX	N/A	0.0	200.2	21	107	129	N/A
BY	0.0	0.0	1567.8	0	584	596	431
С	0.0	0.0	103.0	122	193	321	227
Total	0.0	0.0	2034.5	13392	1745	15204	1975
WEST.						-	
S	0.0	0.0	853.6	120	1313	1505	1392
SX	6.9	38.9	- 177.1	. 222	1390	1657	1555
SY	N/A	N/A	N/A	2389	0	2389	N/A
T	4.0	20.1	229.7	28	218	258	188
TX	N/A	0.0	1205.7	5	250	255	N/A
TY [.]	N/A	0.0	29.9	3	31	34	N/A
U	0.0	0.0	0.0	168	1330	1565	1474
Total	10.9	59.0	2496.0	2935	4532	7663	4609

⁽¹⁾ Volume based on 21% (sludge waste) and 50% (saltcake waste) liquid in solid (porosity) value, per WHC-SD-W236A-ES-012, Rev .1, dated May 21, 1996, a re-evaluation of the non-stabilized tanks.

N/A = Not applicable for Double-Shell Tank Farms, and Single-Shell Tank Farms which have been declared Controlled, Clean and Stable (BX, TX, TY).

TABLE E-4. INVENTORY SUMMARY BY TANK FARM December 31, 1998

					SUPERN	ATANT	LIQUII	O VOL	<u>UMES</u>	(Kgallo	ns)			SOLID	S VOLUN	NE
TANK	TOTAL	AVAIL													SALT	
<u>FARM</u>	WASTE	_SPACE	_AGING	CC	CP	DC	DN	DN/PD	DN/PT	DSSE	NCPLX	_TOTAL	DSS	SLUDGE	_CAKE	TOTAL
EAST																
A	1537	0	0	0	0	0	0	0	0	517	0	517	0	556	464	1020
AN '	5449	2531	0	1797	0	0	125	0	0	1788	0	3710	410	1324	0	1734
AP	3689	5431	. 0	0	1093	254	458	. 0	0	1792	0	3597	0	90	0	90
AW	4359	2481	0	352	0	551	888	315	0	819	0	2925	0	1358	75	1433
AX	906	0	0	3	0	0	0	0	0	386	0	389	0	19	498	517
AY	635	1325	0	0	0	59	441	0	0	0	0	500	0	130	0	130
AZ	1749	211	1596	. 0	0	0	0	0	0	0	0	1596	- 0	151	0	151
В	2057	0	0	0	0	0	0	0	0	0	15	15	0	1697	345	2042
BX	1493	0	0	. 0	0	0	0	0	0	0	21	21	0	1351	121	1472
BY	4561	0	0	0	0	0	. 0	0	0	0	0	0	0	797	3685	4482
C	1976	0	0	0	0	1	0	0	Ó	0	121	122	0	1861	0	1861
Total	28411	11979	1598	2152	1093	865	1912	315	O	5302	157	13392	410	9334	5188	14932
hacesaeriaeria	Contractor in Notice Assessed assets as the Salabase	CONTRACT STATES STATES STATES														
WEST																
s	5300	0	0	0	0	0	0	0	0	103		120	0	1206	3913	5119
sx	4407	0	0	. 0	0	0	0	0	0	0	222	222	0	1310	2842	4152
SY	2863	582	0	1503	0	0	0	0	886	0		2389	0	491	4	495
T	1879	0	٥	0	0	0	0	0	0	. 0		28	0	1875	0	1875
TX	7009	0	0	0	0	0	0	0	0			5	0	241	6763	7004
ΤΥ	638	0	0	0	. 0	0	0	0	0			3	٥	571	64	635
U	3550	0	0	0	0	0	0	0	0	31	137	168	0	579	2804	3383
Total 🐉 🐧	25646	\$ 582	0	1503	0.5	0	0 8	i o	888	134	412	2935	Ö	8273	16390	22863
	54057				1093.					5436		16327			21578	3759

HNF-EP-0182-129

		TANK S	TATUS					LIQU	ID AOTHY	ΛE	S	DLIDS VOI	LUME	VOLU	ME DETERM	INATION	PHOTOS	/VIDEOS	
		•					1	DRAIN-	DRAIN-	PUMP-				1					SEE
				EQUIVA-			SUPER-	ABLE	ABLE	ABLE				1					FOOTNOT
				LENT	TOTAL	AVAIL.	NATANT	INTER-	LIQUID	LIQUID -	i			FIGUID	SOLIDS	SOLIDS	LAST	LAST	FOR
	WAST	TANK	TANK	WASTE	WASTE	SPACE	FIGUID	STIT.	REMAIN	REMAIN	DSS	SLUDGE	SALT	VOLUM	E VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MATL	INTEGRITY	USE	INCHES	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)		CAKE	METHO	METHOD	UPDATE	РНОТО	VIDEO	CHANGES
							•		AN TANI	K FARM	TATIIS				•				·
AN-101	DN	SOUND	DRCVR	57.5	158	982	125	0	125	125	l o	: 33	0	FM	s	04/30/96	0/0/0		1
AN-102		SOUND	CWHT	386.9	1064	76	975	3	978	975	ő	89	0	FM	S	08/22/89	0/0/0		1
AN-103		SOUND	CWHT	348.0	957	183	547	0	547	575 547	410	0	7	FM	S	03/31/97	10/29/87		
	DSSF	SOUND	CWHT	382.9	1053	87	604	48	652	630	0	449	0	FM	S	03/31/97			1
	DSSF	SOUND	CWHT	409.5	1126	14	637	53		•	ľő		0	i			08/19/88		ŀ
AN-106		SOUND	CWHT	14.2	39	1101	22	0	690 22	668 .22	٥	489 17	0	FM FM	S	03/31/97	01/26/88		1
AN-107		SOUND	CWHT	380.7	1047	93	1				0		_	1	S	08/22/89	0/0/0]
AN-107		300ND	CWITT	380.7	1047	83	800	23	823	801	١	247	o	FM	. S	08/22/89	09/01/88		l
7 DOUE	LE-SHEL	L TANKS		TOTALS	5444	2536	3710	127	3837	3768	410	1324	0						
			•						AD TANI	K FARM S	TATE			,					
AP-101	DSSF	SOUND	DRCVR	405.5	1115	25	1115	0	1115	1115	0	· • •	0	FM	s	OE (01 190	م مرمر م		
AP-102		SOUND	GRTFD	397.5	1093	47	1093	ő	1093	1093	0	0	-	FM		05/01/89 07/11/89	0/0/0		!
AP-103		SOUND	DRCVR	8.7	24	1116	23	0	23	23	ő	1	0	FM	s s	05/31/96	0/0/0		
AP-104		SOUND	GRTFD	8.7	24	1116	24	ő	24	23	ő	.0	0	i					`
	DSSF	SOUND	CWHT	278.5	766	374	677	3	680	677	0	_	-	FM	S	10/13/88	0/ 0/ 0	00/07/05	
AP-108		SOUND	DRCVR	141.5	389	751	1	_			`	89	0	FM	S	03/31/98	0/0/0	09/27/95	(a)
AP-100		SOUND	DRCVR	8.0	22		389	0	389	389	0	0	0	FM	S	10/13/88	0/0/0		
						1118	22	0	22	22	l °	. 0	0	FM	S	10/13/88	0/0/0		
AP-108	DC	SOUND	DRCVR	92.4	254	886	254	0	254	254	٥	0	0	FM	S	10/13/88	0/0/0		
8 DOU	BLE-SHEL	L TANKS		TOTALS	3687	5433	3597	3	- 3600	3597	0	90	0	<u> </u>			<u> </u>		
									AW TAN	K FARM	STATUS	ž		•					
AW-10	DSSF	SOUND	CWHT	409.1	1125	15	819	30	849	827	0	306	0	FM	s	03/31/97	03/17/88		1
AW-10	2 DC	SOUND	EVFD	214.9	591	549	551	0	551	551	ŏ	40		FM	s	08/31/97	02/02/83		
	3 DN/PD		DRCVR	185.8	511	629	163	35	198	176	ő	348	0	FM	S	03/31/98	i .		(a)
AW-10	-	SOUND	DRCVR	406.9	1119	21	888	30	918	896	ŏ	156	75	FM	S	03/31/98			1
	5 DN/PD		DRCVR	157.1	432	708	152	27	179	157	Ĭ	280		FM	S	03/31/98			(a)
AW-10		SOUND	SRCVR	210.9	580	560	352	20	372	352	ŏ	228		FM	S	08/31/97	02/02/83		(a)
s Doll	I E. CHE	L TANKS		TOTALS	4358	2482	2925	142	3067	0050		4050		 -		····	ļ <u></u>		
a rant	بابتا الاستور	CALINA		INIUES	4000	4404	1 4540	142	3/O/	2959	1 0	1358	75	1			ī		

إ

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

December 31, 1998

		TANK	STATUS					LIQU	IID VOLUN	AE .		SOLIDS V	OLUME	·VOL	UME DETE	RMINATION	PHOTO	S/VIDEOS	
								DRAIN-	DRAIN-	PUMP-									SEE
				EQUIVA-			SUPER-	ABLE	ABLE	ABLE							•		FOOTNOT
				LENT	TOTAL	AVAIL.	NATANT	INTER-	LIQUID	LIQUID				FIGUID	SOLIDS	SOLIDS	LAST	LAST	FOR
	WAST	TANK	TANK	WASTE	WASTE	SPACE	LIQUID	sm.	REMAIN	REMAIN	DSS	SLUDGE	SALT	VOLUME	VOLUME-	VOLUME	IN-TANK	IN-TANK	THESE
ANK	MATL	INTEGRITY	USE	INCHES	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)		CAKE	METHOE	METHOD	UPDATE	PHOTO	VIDEO	CHANGE
			•					A	Y TANK	FARM ST	FATUS								,
Y-101	DC	SOUND	DRCVR	60.7	167	813	59	. 6	64	59	C	108	0	FM	s	10/31/97	12/28/82		i .
Y-102		SOUND	DRCVR	168.4	463	517	441	ō	441	441	ŏ		ŏ	FM	S	10/31/97	04/28/81		
			D.1.0711	100.7		0.,	***	Ū	77.	77,	ľ		·	l ''''	•	10/01/07	0-1/20/01		
DOUB	LE-SHELI	. TANKS		TOTALS	630	1330	500	5	505	- 500	0	130	0						
									Ø 00 4 NIV	D. D. C	D A CHIETCH					· · · · · · · · · · · · · · · · · · ·			
								A	Z TANK		<u> </u>						1		
	AGING		CWHT	308.7	849	131	802	0	802	802	0	**	0	FM	S	10/31/97			
\Z-102	AGING	SOUND	DRCVR	326.5	898	82	794	5	799	794	٥	104	0	FM	S	10/31/97	10/24/84		
							<u> </u>							<u> </u>	•				
DOUB	LE-SHELI	LTANKS		TOTALS	1747	213	1596	5	1601	1596		151	0	L					<u></u>
								<u>s</u>	Y TANK	FARM SI	TATUS								
Y-101	CC	SOUND	CWHT	425.5	1170	0	1129	0	1129	1129	0	41	0	FM	s	05/31/96	04/12/89		(6)
Y-102	DN/PT	SOUND	DRCVR	354.2	974	186	886	0	886	886			0	FM	S	03/31/98			(a)
SY-103	CC	SOUND	CWHT	269.1	740	400	374	0	374	374	١٠		4	FM	s	06/30/96			ļ '`''
										•			•	1	_	20,00,00	,,		1
DOUB	LE-SHELI	LTANKS		TOTALS	2884	566	2389	0	2389	2389	0	491	4						1
RAND	TOTAL				18750	12560	14717	282	14999	14809	410	3544	79	<u> </u>					
MAIND	JUINE				10700	12000	14717	202	14333	14009	410	3044	19	<u> </u>			L		<u> </u>

Note: +/- 1 Kgal differences are the result of computer rounding

Available Space Calculations

Used in This Document (Most Conservative)

IOSR WHC-SD-WM-OSR-16 (AN, AP, AW, SY)

WHC-T-151-00009 (Aging Waste)

Tank Farms
AN, AP, AW, SY
AY, AZ (Aging Waste)

1,140,000 gat (414.5 in.) 980,000 gal (356.4 in.) 1,144,000 gel (416 in.)(AN, AP, SY)

1,127,500 (410 in.)(AW-Farm)

1,000,000 gal (363.6 in.){AY, AZ}

NOTE: Tanks AN-102, AN-107, AY-101, AY-102, AP-103, AP-104, AP-107 - These tanks currently contain waste that is outside of the current corrosion control specification. An alternate strategy of corrosion control (monitor using corrosion probes; adjust chemistry as required for control) is being proposed but has not been fully evaluated. Note that the supernate in AY-102 is within the corrosion specifications, however, the sludge layer is outside the specifications.

- (a) Solids levels in tanks AP-105, AW-103, AW-104, AW-105, and SY-102 were adjusted based on document HNF-SD-WM-Ti-806, "Gas Release Event Safety Analysis Tool Pedigree Database for Henford Tanks," Rov 2, dated December 28, 1998.
- (b) Tank SY-101 Total Waste exceeds the "most conservative" Available Space calculations used for these tanks, but does not exceed the OSR requirements

	TANK S	TATUS			<u> </u>		LIQ	NID AOTA	ME		SOLIDS	VOLUME	VOLUM	E DETERMIN	IATION	PHOTOS/	VIDEOS	
					SUPER-	DRAIN- ABLE	PUMPED		DRAIN- ABLE	PUMP- ABLE								SEE FOOTNOTE
			STABIL/	TOTAL	NATE	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION		rianip	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
ANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								A TA	NK FARM	STATUS					:			-
A-101	DSSF	SOUND	/Pt	953	508	189	0.0	0.0	721	697	3	442	' P	F	12/31/98	08/21/85		(6)
\-102	DSSF	SOUND	IS/PI	41	4	2	0.0	39.5	6	0	15	22	P	FP	07/27/89	07/20/89		i
\-103	DSSF	ASMD LKR	IS/IP	371	5	15	0.0	111.0	20	0	366	0		FP	06/03/88	12/28/88		ļ
\-104	NCPLX	ASMD LKR	IS/IP	28	0	0	0.0	0.0	0	0	28	0	М	PS	01/27/78	06/25/86		
\-105	NCPLX	ASMD LKR	IS/IP	19	0	4	0.0	0.0	4	0	19	0	P	MP	08/23/79	08/20/86		
\-106	CP	SOUND	IS/IP	125	0	7	0.0	0.0	7	0	125	0	P	M-	09/07/82	08/19/86		1
SING	LE-SHELL	TANKS	TOTALS	1537	517	217	0.0	150.5	758	697	556	464						
																·		
V-101	DSSF	SOUND	/PI	748	386	148	0.0	0.0	NK FARM 558		1	250	l p	F	10/01/00	004007		1
X-102		ASMD LKR	IS/IP	39	300	140	0.0			534	3				12/31/98			(6)
X-102		SOUND	IS/IP	112	ů	36	0.0	13.0 0.0	17 36	3	7 2	29	F	S S	09/06/88			
	NCPLX	ASMD LKR	IS/IP	7	ő	0	0.0	0.0	. 0	3	_	110 0		M	08/19/87 04/28/82			
·/- 10-	, MOI EX		10/11	•	ľ	·	0.0	0.0	·	Ū	'	·	'	tA1	V4/20/02	06/16/67		l .
SING	LE-SHELL	TANKS	TOTALS:	906	389	198	0.0	13.0	611	540	19	498						
								В ТАТ	VK FARM	STATUS	_							
3-101	NCPLX	ASMD LKR	IS/IP	113	0	6	0.0	0.0	6	0	113	0	P	F	04/28/82	05/19/83		1
-102	NCPLX	SOUND	IS/IP	32	4	0	0.0	0.0	4	0	18	10	P	· F	08/22/85	08/22/85		ļ
-103	NCPLX	ASMD LKR	IS/IP	59	0	0	0.0	0.0	0	0	59	0	F	F	02/28/85	10/13/88		İ
-104	NCPLX	SOUND	IS/IP	371	1	46	0.0	0.0	47	40	301	69	М	M	06/30/85	10/13/88		
-105	NCPLX	ASMD LKR	IS/IP	306	0	23	0.0	0.0	23	0	40	286	P	MP	12/27/84	05/19/88		
-106	NCPLX	SOUND	IS/IP	117	1	6	0.0	0.0	7	0	116	0	Į F	F	03/31/85	02/28/85		
-107	NCPLX	ASMD LKR	IS/IP	165	1	12	0.0	0.0	13	7	164	0	М	М	03/31/85	02/28/85		1
3-108	NCPLX	SOUND	IS/IP	94	0	4	0.0	0.0	4	0	94	0	F	F	05/31/85	05/10/85	•	
-109	NCPLX	SOUND	IS/IP	127	0	8	0.0	0.0	8	0	127	0	- M	M	04/08/85	04/02/85		
F110	NCPLX	ASMD LKR	IS/IP	246	1	22	0.0	0.0	23	17	245	0	MP	MP	02/28/85	03/17/88		
-111	NCPLX	ASMD LKR	IS/IP	237	1	21	0.0	0.0	22	16	236	0) F	F	06/28/85	06/26/85		1
-112	NCPLX	ASMD LKR	IS/IP	33	3	0	0.0	0.0	3	. 0	30	0	F	F	05/31/85	05/29/85	ů.	1
3-201	NCPLX	ASMD LKR	IS/IP	29	1	3	0.0	0.0	4	0	28	0	М	М	04/28/82	11/12/86	06/23/95	;
3-202	NCPLX	SOUND	IS/IP	. 27	0	3	0.0	0.0	3	0	27	0	P	М	05/31/85	1	06/15/95	;
3-203	NCPLX	ASMD LKR	IS/IP	51	1	5	. 0.0	0.0	6	0	50	0	PM	PM	05/31/84	1		1
3-204	NCPLX	ASMD LKR	IS/IP _,	50	1	Б	0.0	0.0	6	0	49	0	P	М	05/31/84			
R Chi	GLE-SHELL	TANKS	TOTALS	2057	15	164	0.0	0.0	179	80	1697	345						
~ ~ ~ ~ ~ ~				~~~/		_,07	V.V	0.0	1/3	•	,, ,,,,,,,		•			1		

ò

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

	TANK S	TATUS					LIO	UID VOLU	ME		SOLIDS	VOLUME	VOLUM	DETERMIN	IATION	PHOTOS/	VIDEOS	
						DRAIN-			DRAIN-	PUMP-			-					SEE
					1	ABLE	PUMPED		ABLE	ABLE	ŀ		Į.					FOOTNOTE
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgai)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
					•				NK FARM			_						1 ′
BX-101	NCPLX	ASMD LKR	IS/IP/CCS	43	1	0	0.0	0.0	1	0	42	0	P	M		11/24/88	11/10/94	
BX-102	NCPLX	ASMD LKR	IS/IP/CCS	96	0	4	0.0	0.0	4	0	96	0	Р	M	04/28/82			
BX-103	NCPLX	SOUND	IS/IP/CCS	68	6	0	0.0	0.0	6	0	62	0	P	F		10/31/88	10/27/94	ŀ
BX-104	NCPLX	SOUND	IS/IP/CCS	99	3	30	0.0	17.4	. 33	27	96	0	F	F		09/21/89		Ì
BX-105	NCPLX	SOUND	IS/IP/CCS	51	5	6	0.0	15.0	11	4	43	3	ļ F	S		10/23/86		
BX-106	NCPLX	SOUND	IS/IP/CCS	36	0	0	0.0	14.0	0	0	38	0	MP	PS		05/19/88	07/17/95	
BX-107	NCPLX	SOUND	IS/IP/CCS	345	1	29	0.0	23.1	30	23	344	0	MP	P	• •	09/11/90		
BX-108	NCPLX	ASMD LKR	IS/IP/CCS	26	0	1	0.0	0.0	1	0	26	0	M	PS	07/31/79	05/05/94		1
BX-109	NCPLX	SOUND	IS/IP/CCS	193	0	13	0.0	8.2	13	8	193	0	FP	P	09/17/90	09/11/90		
BX-110	NCPLX	ASMD LKR	IS/IP/CCS	207	3	16	0.0	1.5	19	13	195	9	MP	M		07/15/94		
BX-111	NCPLX	ASMD LKR	IS/IP/CCS	162	1	1	0.0	116.9	3	1	52	109	M	M		05/19/94	02/28/95	1
BX-112	NCPLX	SOUND	IS/IP/CCS	165	1	7	0.0	4.1	8	2	164	0	FP	P	09/17/90	09/11/90		
					<u> </u>								Ļ	<u> </u>				
12 SINC	LE-SHELL	TANKS	TOTALS:	1493	21	107	0.0	200.2	129	78	1351	121	<u> </u>			<u></u>		<u> </u>
								RV TA	NK FARM	STATUS								
m	NCPLX	SOUND	IS/IP	387	l 0	5	0.0	35.8	5	0	109	278	l p	М	05/30/84	09/19/89		1
			IS/PI	277	ő	11	0.0	159.0	11	o	"0		MP	M		09/11/87	04/11/95	:
	NCPLX	SOUND		414	0	38	0.0	95.9	38	32	1		MP	м		09/07/89		
	NCPLX	ASMD LKR	IS/PI		1	18	0.0	329.5	18	0	1 .		I	M		04/27/83	02,2 .,0,	
	NCPLX	SOUND	IS/IP	406			0.0		192	186			'	MP		07/01/86		(e)
	NCPLX	ASMD LKR	/PI	504		186 238	0.0		244	238			i '	MP		11/04/82		(e)
	NCPLX	ASMD LKR	/Pi	562	1					230				MP		10/15/86		1 ,0,
	NCPLX	ASMD LKR	IS/IP	266			0.0	56.4	25	o	1		1 '	M		10/15/86		
	NCPLX	ASMD LKR	IS/IP	228		_	0.0		9	_	1		1	PS		06/18/97		1
	NCPLX	SOUND	IS/PI	290			0.0		37	20	1			-		1 ' '		
	NCPLX	SOUND	IS/IP	398	i	•	0.0		9		ł .		į.	S		07/26/84		
	NCPLX	SOUND	IS/IP	459		-				_	1		1	M		10/31/86		
BY-112	NCPLX	SOUND	IS/IP	291	. 0	8	0.0	116.4	8	0	5	286	P	M	04/28/82	04/14/88		
					 	·			 	476	 		 			 		

Ó

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

101 102 103 104	WASTE MAT'L. NCPLX DC NCPLX CC	TANK INTEGRITY ASMD LKR SOUND	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER- NATE (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH	TOTAL	DRAIN- ABLE LIQUID	PUMP- ABLE								SEE FOOTNOTE
101 102 103	MAT'L. NCPLX DC NCPLX	ASMD LKR	ISOLATION STATUS	WASTE	NATE	STIT.			LIQUID									•
101 102 103	MAT'L. NCPLX DC NCPLX	ASMD LKR	STATUS				MONTH	D4144D#B		LIQUID	ļ	SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
101 102 103	NCPLX DC NCPLX	ASMD LKR		(Kgal)	(Kgal)	(Kgal)		PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
102 103	DC NCPLX		IS/IP				(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
102 103	DC NCPLX		IS/IP					C TA	NK FARM	STATUS							•	
103	NCPLX	SOUND		88	0	3	0.0	0.0	3	0	88	0	М	M	11/29/83	11/17/87		
			IS/IP	316	0	30	0.0	46.7	30	17	316	0	F	FP	09/30/95	05/18/76	08/24/95	1
104	CC	SOUND	/PI	202	83	5	0.0	0.0	94	88	119	0	F	S	12/31/98	07/28/87		(e)
		SOUND	IS/IP	295	0	11	. 0.0	0.0	11	5	295	0	FP	P	09/22/89	07/25/90		
105	NCPLX	SOUND	IS/PI	134	2	30	0.0	0.0	32	9	132	0	F.	s	10/31/95	08/05/94	08/30/95	
106	NCPLX	SOUND	/PI	229	32	30	0.0	0.0	62	52	197	0	F	PS	04/28/82	08/05/94	08/08/94	
107	DC	SOUND	IS/IP	237	0	24	0,0	40.8	24	15	237	0	F	S	09/30/95	00/00/00]
108	NCPLX	SOUND	IS/IP	66	0	0	0.0	0.0	0	0	66	0	М	S	02/24/84	12/05/74	11/17/94	1
109	NCPLX	SOUND	IS/IP	66	4	0	0.0	0.0	4	0	62	0	М	PS	11/29/83	01/30/76		
110	DC	ASMD LKR	IS/IP	178	1	28	0.0	15.5	29	15	177	. 0	F	FMP	06/14/95	08/12/86	05/23/95	
111	NCPLX	ASMD LKR	IS/IP	57	0	0	0.0	0.0	0	0	57	0	М	S	04/28/82	02/25/70	02/02/95	1
112	NCPLX	SOUND	IS/IP	104	0	32	0.0	0.0	32	26	104	0	м	PS	09/18/90	09/18/90]
201	NCPLX	ASMD LKR	IS/IP	2	0	0	0.0	0.0	0	0	2	0	P	MP	03/31/82	12/02/86		1
202	EMPTY	ASMD LKR	IS/IP	1	0	0	0.0	0.0	Ó	0	1	0	Р	M	01/19/79	12/09/86		ł
203	NCPLX	ASMD LKR	IS/IP	5	0	0	0,0	0.0	0	0	5	0	P	,MP	04/28/82	12/09/86		
204	NCPLX	ASMD LKR	IS/IP	3	0	0	0.0	0.0	0	0	3	0	Р	MP	04/28/82	12/09/86		1
SING	SLE-SHELL	TANKS	TOTALS:	1983	122	193	0.0	103.0	321	227	1861	0						
								S TA	NK FARM	STATUS			<u>-</u> .					
101	NCPLX	SOUND	/PI	427	12	126	0.0	0.0	144	138	211	204	F	PS	12/31/98	03/18/88		(e)
102	DSSF	SOUND	/PI	549	٥	224	0.0	0.0	230	224	105	444	P	FP	12/31/98			(e)
103	DSSF	SOUND	/PI	248	17	93	0.0	0.0	122	110	9	222	м	S	12/31/98			(e)
104	NCPLX	ASMD LKR	IS/IP	294	1 1	28	0.0	0.0	29	23	293	0	м	М	12/20/84			''
105	NCPLX	SOUND	IS/IP	458	0	35	0.0	114.3	35	13	2	454	MP	s	09/26/88	04/12/89		
106	NCPLX	SOUND	/P1	479	53	190	0.0	97.0	258	243	0	426	P	FP	12/31/98		09/12/94	(6)
107	NCPLX	SOUND	/PI	376	14	76	0.0	0.0	96	90	293	69	F	PS	12/31/98	03/12/87	•	(e)
108	NCPLX	SOUND	IS/Pi	450	0	4	0.0	199.8	4	0	4	446	P	MP	12/20/96	03/12/87	12/03/96	1
109	NCPLX	SOUND	/PI	507	0	167	0.0	111.0	177	167	13	494	F.	PS	09/30/75			. (e)
110	NCPLX	SOUND	1S/PI	390	0	30	0.0	203.1	30	23	131	259	F	PS	05/14/92		12/11/96	1 ' '
111	NCPLX	SOUND	/PI	540	23	198	0.0	3.3	227	221	139	378	P	FP	12/31/98	08/10/89		(e)
112	NCPLX	SOUND	/P1	523	0	142	0.0	125.1	153	140	6	517	P	FP	12/31/98		•	(e)
01515	SLE-SHELL	TANKS	TOTALS:	5239	120	1313	0.0	853.6	1506	1392	1206	3913	 -			<u></u>	·,-····	ļ

T-10

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

	TANK S	TATUS					LIQ	NO AOTA	ME		SOLIDS	VOLUME	VOLUI	ME DETERM	INATION			
		<u>-</u>]	DRAIN-			DRAIN-	PUMP-								SEE
				. •		ABLE	PUMPED		ABLE	ABLE			ŀ					FOOTNOT
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
T-109	NCPLX	ASMD LKR	IS/IP	58	l 0	0	0.0	0.0	0	0	58	o	j м	м	12/30/84	02/25/93		! .
T-110	NCPLX	SOUND	/PI	369	هٔ	58	1.9	39.0	64	58	369	0	P	FP	12/31/98			(d)(e)
T-111	NCPLX	ASMD LKR	IS/PI	446	o	34	0.0	9.6	34	29	446	0	P	FP	04/18/94		02/13/95	
T-112	NCPLX	SOUND	IS/IP	67	7	. 0	0.0	0.0	7	7	60	o	P	FP	04/28/82		,,	İ
T-201	NCPLX	SOUND	IS/IP	29	;	3	0.0	0.0	4	o	28	0	M	PS	05/31/78			
T-202	NCPLX	SOUND	IS/IP	21	ò	2	0.0	0.0	2	0	21	0	FP	P	07/12/81	07/06/89		
T-203	NCPLX	SOUND	IS/IP	35	o	4	0.0	0.0	4	0	35	0	м	PS	01/31/78	08/03/89		}
T-204	NCPLX	SOUND	IS/IP	38	0	4	0.0	0.0	4	0	38	0	FP	Р	07/22/81	08/03/89		
16 SIN	GLE-SHELL	TANKS	TOTALS:	1903	28	218	4.0	229.7	258	188	1875	0						
		V		-	<u> </u>													
								TX TA	NK FARM	STATUS			•					
	NCPLX	SOUND	IS/IP/CCS	87	3	2		0.0	5	0	84	0	F	₽	02/02/84			
	NCPLX	SOUND	IS/IP/CCS	217	0	22	0.0	94.4	22	0	0	217	M	S	08/31/84			
	NCPLX	SOUND	IS/IP/CCS	157	0	15	0.0	68.3	15	0	157	0	F	S	08/14/80			
TX-104	NCPLX	SOUND	IS/(P/CCS	65	1	14	0.0	3.6	15	0	0	64	F	FP	04/06/84	10/16/84		
TX-105	NCPLX	ASMD LKR	IS/IP/CCS	609	0	20	0.0	121.5	20	0	0		M	PS	08/22/77	10/24/89		l
TX-106	NCPLX	SOUND	IS/IP/CCS	453	0	10	0.0	134.6	10	0	0	453	M	· s	08/29/77	10/31/85		ł
TX-107	NCPLX	ASMD LKR	IS/IP/CCS	36	1	1	0.0	0.0	2	0	0	35	FP	FP	01/20/84	10/31/85		
TX-108	NCPLX	SOUND	IS/IP/CCS	134	0	0	0.0	13.7	0	0	0	134	Р	FP	05/30/83	09/12/89		
TX-108	NCPLX	SOUND	IS/IP/CCS	384	0	10	0.0	72.3	10	0	0	384	F	PS	05/30/83	10/24/89		
TX-110	NCPLX	ASMD LKR	IS/IP/CCS	462	0	15	0.0	115.1	15	0	0	462	М	PS	05/30/83	10/24/89		
TX-111	NCPLX	SOUND	IS/IP/CCS	370	0	9	0.0	98.4	9	0	0	370	M	PS	07/26/77	09/12/89		1
TX-112	NCPLX	SOUND	IS/IP/CCS	649	0	24	0.0	94.0	24	0	0	649	P	PS	05/30/83	11/19/87		1
TX-118	NCPLX	ASMD LKR	IS/IP/CCS	607	0	16	0.0	19.2	16	0	0	607	м	PS	05/30/83	04/11/83	09/23/94	:1
TX-114	NCPLX	ASMD LKR	IS/IP/CCS	535	0	15	0.0	104.3	15	0	0	535	М	PS	05/30/83	04/11/83	02/17/95	;
TX-118	NCPLX	ASMD LKR	IS/IP/CCS	640	0	19	0.0	99.1	19	0	0	640	М	S	03/25/83	06/15/88		
TX-116	NCPLX	ASMD LKR	IS/IP/CCS	631	0	23	0.0	23.8	23	0	0	631	M	PS	03/31/72	10/17/89		
TX-117	NCPLX	ASMD LKR	IS/IP/CCS	626	0	. 8	0.0	54.3	8	0	0	626	M	PS	12/31/71	04/11/83		
TX-118	B NCPLX	SOUND	IS/IP/CCS	347	0	27	0.0	89.1	. 27	0	0	347	F	s	11/17/80	12/19/79		
10 CIN	GLE-SHELL	TANKS	TOTALS:	7009	5	250	0.0	1205,7	255	0	241	6763	1		•	 		+

12

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS
December 31, 1998

	TANK S	TATUS					LIQ	UID VOLU	ME		SOLIDS	VOLUME		VOLUM	E DETERMIN	ATION		
				•		DRAIN- ABLE	PUMPED	-	DRAIN- ABLE	PUMP- ABLE								SEE FOOTNOT
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION		NATE	STIT.	MONTH	PUMPED			SLUDGE		VOLUME	AOTOWE	VOLUME	IN-TANK	IN-TANK	
ANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgai)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE.	PHOTO	VIDEO	CHANGE
								SX TA	NK FARM	STATUS								,
X-101	DC	SOUND	/PI	442	0	163	0.0	0.0	170	163	128	314	Р	FP	12/31/98	03/10/89		(e)
X-102	DSSF	SOUND	/PI	543	0	216	0.0	0.0	224	216	117	426	P	M	12/31/98	01/07/88		(e)
X-103	NCPLX	SOUND	/PI	651	0	271	0.0	0.0	278	271	115	538	F	S	12/31/98	12/17/87		(e)
	DSSF	ASMD LKR	/Pi	584	0	231	3.7	162.2	239	231	136	448	F	S	12/31/98		02/04/98	
	DSSF	SOUND	/PI	683	0	301	0.0	0.0	309	301	73	610	P	F	12/31/98			(d)(e)
	NCPLX	SOUND	/PI	538	222	126	3.2	14.9	355	348	52	264	F	PS	12/31/98			(b)(e)
	NCPLX	ASMD LKR	IS/IP	104	0	5	0.0	0.0	5	0	104	0	P	M	04/28/82	f		
	NCPLX	ASMD LKR	IS/IP	87	0	5	. 0.0	0.0	5	0	87	0	P	M	12/31/93			į
	NCPLX	ASMD LKR ASMD LKR	IS/IP	. 244	0	48	0.0	0.0	48	25 0	0	244		M	01/10/96			
	NCPLX NCPLX	ASMD LKR	IS/IP IS/IP	62 125	ľ	0 7	0.0 0.0	0.0 0.0	0	0	62 125	0	M	PS PS	10/06/76 05/31/74	02/20/87 06/09/94		1
	NCPLX	ASMD LKR	IS/IP	92	ľ	3	0.0	0.0	3	0	92	0	, m	rs M	04/28/82	03/10/87		Į.
	NCPLX	ASMD LKR	IS/IP	28	٥	. 0	0.0	0.0	0	ŏ	26	o	P	M	04/28/82	03/18/88		
	NCPLX	ASMD LKR	IS/IP	181	0	. 14	0.0	0.0	14	ō	181	ō	P	M	04/28/82	02/26/87		
	NCPLX	ASMD LKR	IS/IP	12	0	0	0.0	0.0	0	• 0	12	o	Р	M	04/28/82	-		,
5 SING	3LE-SHELL	TANKS	TOTALS:	4374	222	1390	6.9	177.1	1657	1555	1310	2842						
								ጥ ጥልክ	K FARM	CTATHC				, -				
-101	NCPLX	ASMD LKR	IS/PI	102	I 1	16	0.0	25.3	17	O PIALUS	101	0	F ·	s	04/14/93	04/07/93		i
r-102	NCPLX	SOUND	IS/IP	32	13	0	0.0	0.0	13	13	19	ő	6	FP	08/31/84			[·
Γ-103	NCPLX	ASMD LKR	IS/IP	27	4	o	0.0	0.0	4	0	23	ŏ	, F	FP	11/29/63			
r-104	NCPLX	SOUND	/Pt	343	0	52	2.1	144.8	58	52	343	ō	P	MP	12/31/98	-		(c)(e)
-105	NCPLX	SOUND	IS/IP	98	0	23	0.0	0.0	23	17	98	0	Р	F	05/29/87	05/14/87		'-,'-,
T-106	NCPLX	ASMD LKR	IS/IP	21	2	0	0.0	0.0	2	0	19	0	l P	FP	04/28/82	06/29/89	•	1
T-107	NCPLX	ASMD LKR	IS/PI	173	0	22	0,0	11.0	22	12	173	0	P	FP	05/31/96		05/09/96	
T-108	NCPLX	ASMD LKR	IS/IP	44	0	Ò	0.0	0.0	0	0	44	0	l p	М	04/28/82	07/17/84	•	l

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

	TANK S	TATUS					LIQ	NID AOTRI	ME		SOLIDS	VOLUM	VOLUM	E DETERMIN	IATION	PHOTOS/	VIDEOS	ļ
						DRAIN-			DRAIN-	PUMP-								SEE
					SUPER-	ABLE	PUMPED		ABLE	ABLE	į .							FOOTNOTE
			STABIL/	TOTAL	NATE	INTER-	THIS	TOTAL	LIQUID	LIQUID	1	SALT	riguids	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	LIQUID	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								TW TA	NK FARM	CTATES								
			10 110 1000	440	۱ ۸	•			0	0	118	o	l p	F	04/28/82	08/22/89		l .
	NCPLX	ASMD LKR	IS/IP/CCS	118	0	0	0.0	8.2			''°	64	P	, FP	06/28/82	07/07/87		1
	NCPLX.	SOUND	IS/IP/CCS	64	0	14	0.0	6.6	14	0	1 .			FP	07/09/82	08/22/89		
	NCPLX	ASMD LKR	IS/IP/CCS	162	0	5		11.5	5	. 0	162	0				11/03/87		
	NCPLX	ASMD LKR	IS/IP/CCS	46	3	12	0.0	0.0	15	0	43	0	, r	FP	06/27/90	09/07/89		
	NCPLX	ASMD LKR	IS/IP/CCS	231	0	0		3,6	0	0	231	0		M	04/28/82			
TY-106	NCPLX	ASMD LKR	IS/IP/CCS	17	°	0	0.0	0.0	0	0	17	0	P	М	04/28/82	08/22/89		
SING	LE-SHELL 1	TANKS	TOTALS:	638	3	31	0.0	29.9	34	0	571	64	<u> </u>					
								U TAI	IK FARM	<u>STATUS</u>								•
U-101	NCPLX	ASMD LKR	IS/IP	25	3	0	0.0	0.0	3	0	22	0	P	MP	04/28/82	06/19/79		l
J-102	NCPLX	SOUND	/PI	375	18	150	0.0	0.0	175	168	43	314	P	MP	12/31/98	06/08/89		(e)
U-103	NCPLX	SOUND	/Pi	468	13	205	0.0	0.0	229	218	12	443] P	FP	12/31/98	09/13/88		(e)·
U-104	NCPLX	ASMD LKR	IS/IP	122	0	7	0.0	0.0	7	0	122	0	P	MP	04/28/82	08/10/89		1
U-105	NCPLX	SOUND	/PI	418	37	167	0.0	0.0	210	204	32	349	FM	PS	12/31/98	07/07/88		(e)
U-106	NCPLX	SOUND	/PI	226	15	83	0.0	0.0	112	98	0	211	F	PS	12/31/98	07/07/88		(e)
U-107	DSSF	SOUND	/PI	406	31	165	0.0	0.0	206	196	15	360	F	S	12/31/98	10/27/88	•	(e)
U-108	NCPLX	SOUND	/PI	468	24	199	0.0	0.0	229	223	29	415	F	\$	12/31/98	09/12/84	•	(e)
U-109	NCPLX	SOUND	/PI	463	19	197	0.0	0.0	222	216	35	409	F	F	12/31/98	07/07/88		(e)
U-110	NCPLX	ASMD LKR	IS/PI	186	0	15	0.0	0.0	15	9	186	0	M	M	12/30/84	12/11/84		1
U-111	DSSF	SOUND	/PI	329	0	142	0.0	0.0	149	142	26	303	PS	FPS	12/31/98	06/23/88		(e)
U-112	NCPLX	ASMD LKR	IS/IP	49	4	0	0.0	0.0	4	0	45	0	P	MP	02/10/84	08/03/89		,
U-201	NCPLX	SOUND	IS/IP	5	1	0	0.0	0.0	1	0	4	. 0	М	s	08/15/79	08/08/89		
U-202	NCPLX	SOUND	IS/IP	5	1	0	0.0	0.0	1	0	4	. 0	м	S	08/15/79	08/08/89		
U-203	NCPLX	SOUND	IS/IP	3	1	o			1	0	2	. 0	М	s	08/15/79	06/13/89		
U-204	NCPLX	SOUND	IS/IP	3	1	0			1	0	2	. 0	м	s	08/15/79	06/13/89	•	
16 SIN	GLE-SHELL	TANKS	TOTALS:	3551	168	1330	0.0	0.0	1565	1474	579	2804	 					
GRANE	TOTAL	•		35172	1610	5995	10.9	4530.5	7868	6707	12063	21499						

13

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

FOOTNOTES:

Total Waste is calculated as the sum of Sludge and Saltcake plus Supernate.

The category "Interim Isolated" (II) was changed to "Intrusion Prevention" (IP) in June 1993. See section C. "Tank and Equipment Code and Status Definitions." Stabilization information from WHC-SD-RE-TI-178 SST STABILIZATION RECORD, latest revision, or SST Stabilization or Cognizant Engineer

(a) SX-104 Following information from Cognizant Engineer

Other priority work and cold weather problems combined to limit saltwell pumping in December. Pumping may be interrupted in January by work to relocate the alarm circuitry for some sme of the detectors in the transfer line.

Total Waste: 614 Kgal Supernate: 0 Kgal

Drainable interstitial: 151.8 Kgal Pumped this month: 3.7 Kgal Total Pumped: 162.2 Kgal

Drainable Liquid Remaining: 151.8 Kgal Pumpable Liquid Remaining: 145.8 Kgal

Siudge: 138 Kgal Saltoake: 478 Kgal

Pumping during December required 7,330 gal of dilution water and 966 gal of water for transfers,

(b) SX-106 Following information from Cognizant Engineer

Other priority work and cold weather problems combined to limit saltwell pumping in December. Pumping was also interrupted on December 30, 1998, in preparation for another transfer from 244-S to SY-102.

Total Waste: 523.1 Kgal Supernate: 46.1 Kgal

Drainable Interstitiel: 224 Kgal Pumped this month: 3.2 Kgal Total Pumped: 14.9 Kgal

Drainable Liquid Remaining: 270.1 Kgal Pumpable Liquid Remaining: 249,1 Kgal

Sludge: 12 Kgal Saltcake: 465 Kgal

Pumping during December required 2,846 gal of dilution water and 1,120 gal of water for transfer line flushes.

11.72.4

HNF-EP-0182-129

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1998

FOOTNOTES:

E-15

(c) T-104 Following information from Cognizant Engineer Pumping resumed June 7, 1998.

> Total Waste: 329 Kgal Supernate: O Kgal

Drainable Interstitial: 45.6 Kgal Pumped this month: 2.1 Kgal Total Pumped: 144.8 Kgal

Drainable Liquid Remaining: 45.6 Kgal Pumpable Liquid Remaining: 42.6 Kgal

Siudge: 329 Kgal Saltcake: 0 Kgal

Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be corrected as porosity data becomes available with continued pumping.

Pumping during December required I,086 gal of raw water.

A total of 24,594 gal of waste was removed from T-104 during 1998. No pumping occurred between the first of 1998 and June 6, 1998.

(d) T-110 Following information from Cognizant Engineer Pumping began May 21, 1997.

> Total Waste: 354 Kgal Supernate: O Kgal

Drainable interstitial: 54.5 Kgal

Pumped this month:1.9 Kgal
Total Pumped: 39.0 Kgal

Drainable Liquid Remaining: 54.5 Kgal Pumpable Liquid Remaining: 51.5 Kgal

Sludge: 354 Kgal Saltcake: 0 Kgal

Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will continue to be corrected as porosity data becomes available with continued pumping.

Pumping during December required 786 gal of raw water.

Dome elevation survey performed October 27, 1998; to correct "L" value to 41,053 on Data Sheet 2b with next procedure PCA.

A total of 21,749 gal of waste was removed from T-110 during 1998. No pumping occurred between mid-October 1997 and July 2, 1998.

(e) Volume estimates for the remaining 29 SSTs (excluding C-106) not yet Interim stabilized were revised per HNF-2978, "Updated Jet Pump Durations for Interim Stabilization of Remaining Single-Shell Tanks," Rev. O, R. D. Schrieber, July 15, 1998. This included supermate, saltcake, sludge, drainable liquid remaining, drainable interstitial liquid, and pumpable liquid remaining.

Note: These volumes are as of July 1998, and do not reflect pumping which occurred in Tanks SX-104, SX-106, T-104, and T-110 since that date. Actual pumping volumes shown in footnotes above.

This page intentionally left blank.

APPENDIX F

PERFORMANCE SUMMARY

iz J

TABLE F-1. PERFORMANCE SUMMARY (Sheet 1 of 2)

WASTE VOLUMES (Kgallons) December 31, 1998

INCREASES/DECREASES IN WASTE VOLUMES STORED IN DOUBLE-SHELL TANKS

CUMULATIVE EVAPORATION - 1950 TO PRESENT WASTE VOLUME REDUCTION

HNF-EP-0182-129

					
	THIS	FY1999	FACILITY		
SOURCE	MONTH	TO DATE	242-B EVAPORATOR (10)		7172
B PLANT	0	0	242-T EVAPORATOR (1950's) (1	0)	9181
PUREX TOTAL (1)	0	0	IN-TANK SOLIDIFICATION UNIT 1	(10)	11876
PFP (1)	0	0	IN-TANK SOLIDIFICATION UNIT 2	(10)	15295
T PLANT (1)	0	. 0	IN-TANK SOLID. UNIT 1 & 2 (10)	•	7965
S PLANT (1)	0	0	(after conversion of Unit 1 to a	cooler for Unit 2)	8833
300 AREAS (1)	0	. 0	242-T (Modified) (10)		24471
400 AREAS (1)	0	0	242-S EVAPORATOR (10)		41983
SULFATE WASTE -100 N (2)	0	0	242-A EVAPORATOR (11)		73689
C-106 SOLIDS (INCLUDING FLUSH)	2	11	242-A Evaporator was restarte	od April 15, 1994,	
TRAINING/X-SITE (9)	0	0	after having been shut down s	ince April 1989.	
TANK FARMS (6)	2	7	Total waste reduction since	e restart:	9486
SALTWELL LIQUID (8)	22	133	Campaign 94-1	2417 Kgai	
			Campaign 94-2	2787 Kgal	
OTHER GAINS	5	43	Campaign 95-1	2161 Kgal	
Slurry increase (3)	5		Campaign 96-1	1117 Kgal	
Condensate	5		Campaign 97-1	351 Kgal	
Instrument change (7)	0		Campaign 97-2	653 Kgal	
Unknown (5)	0	,	·		
OTHER LOSSES	-25	-42	1	•	
Slurry decrease (3)	-11	-			
Evaporation (4)	-6		1 1		
Instrument change (7)	-4		<u> </u>		
Unknown (5)	4				
EVAPORATED	0	0			
GROUTED	0	. 0] [
TOTAUtissis 7 4 7 4 7 1 Note: No waste due to BIO (Basis for	8 (nterim Operation) im	152 i plementation			

TABLE F-1. PERFORMANCE SUMMARY (Sheet 2 of 2)

Footnotes:

INCREASES/DECREASES IN WASTE VOLUMES

- (1) Including flush
- (2) Sulfate waste is generated from ion exchange backflushing and sand filter clean out, resulting in sulfate waste.
- (3) Slurry increase/growth is caused by gas generation within the waste.
- (4) Aging waste tanks
- (5) Unknown waste gains or losses
- (6) Includes Tank Farms miscellaneous flushes
- (7) Liquid level measurement instrument changes from the automatic FIC to manual tape (and vice versa) result in unusual gains or losses because the manual tape may rest on an uneven crust surface giving a different reading from that of the automatic FIC.
- (8) Results from pumping of single-shell tanks to double-shell tanks.
- (9) Tracks waste being sent to the double-shell tanks from the "Precampaign Training Run." Evaporator procedures require a training run at least once per year. This also includes pressure testing and flushing of cross-site transfer lines.

WASTE VOLUME REDUCTION

- (10) Currently inoperative.
- (11) Currently operative. The 242-A Evaporator-Crystallizer was started up March 1977, and shut down April 1989 because of regulatory issues, and remained shut down for subsequent upgrading. This evaporator operates under a vacuum, employing evaporative concentration with subsequent crystallization and precipitation of salt crystals (forming saltcake). The evaporator was restarted on April 15, 1994.

TABLE F-2. SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANKS

SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANK (DST) SYSTEM FOR DECEMBER 1998: ALL VOLUMES IN KGALS

- The DST system received waste transfers/additions from Tank Farms, SST Stabilization and Tank 106-C solids retrieval in December.
- There was a net change of +6 Kgals in the DST system for December 1998.
- The total DST inventory as of December 31, 1998 was 18,750 Kgals.
- There was no Saltwell Liquid (SWL) pumped to the East Area DSTs in December.
- There were 22 Kgals of Saltwell Liquid (SWL) pumped to the West Area DSTs (102-SY) in December.
- There were ~ 2 Kgals of solids pumped from Tank 106-C to Tank 102-AY in December,. This brings the total accumulative solids retrieved from Tank 106-C to ~11 Kgals.
- The projected SWL pumping volumes were updated this month. The new volumes reflect the most current SWL pumping schedule.
- The "Unusable Tank Space" volumes were updated this month. The new "Unusable Tank Space" volumes reflect the most current assumptions used for Waste Volume Projections.

DECEMBER 1998 DST WASTE RECEIPTS											
FACILITY GENERATION	ONS	OTHER GAINS ASS	OCIATED WITH	OTHER LOSSES AS	SOCIATED WITH						
SWL (West)	+22 Kgal (2SY)	SLURRY	+5 Kgal	SLURRY	-11 Kgal						
Tank Farms	+2 Kgal (2AW, 1AZ)	CONDENSATE	+0 Kgal	CONDENSATE	-6 Kgat						
Tank 106-C Solids	+2 Kgal (2AY)	INSTRUMENTATION	+0 Kgal	INSTRUMENTATION	-4 Kgal						
TOTAL	+26 Kgal	UNKNOWN	+0 Kgal	UNKNOWN	-4 Kgal						
		TOTAL	+5 Kgal	TOTAL	-25 Kgal						

	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR	NET DST CHANGE	TOTAL DST
<u></u>	MASIE RECEIPIS	WASTE RECEIPTS	CHARGES (*/-)			
OCT98	73	81	4	0	77	18675
NOV98	52	115	17	0	69	18744
NOV98 DEC98	26	57	-20	0	6	18750
JAN99		122		0		
FEB99		74		0		
MAR99		135		0		
APR99		128		0		
APR99 MAY99 JUN99		-736		0	••	,
JUN99		204		0		
JUL99 AUG99		177		0		
AUG99		127		0		
SEP99		149		0		

NOTE: The "PROJECTED DST WASTE RECEIPTS" numbers were updated in December 1998.

COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES (ALL VOLUMES IN KGALS)

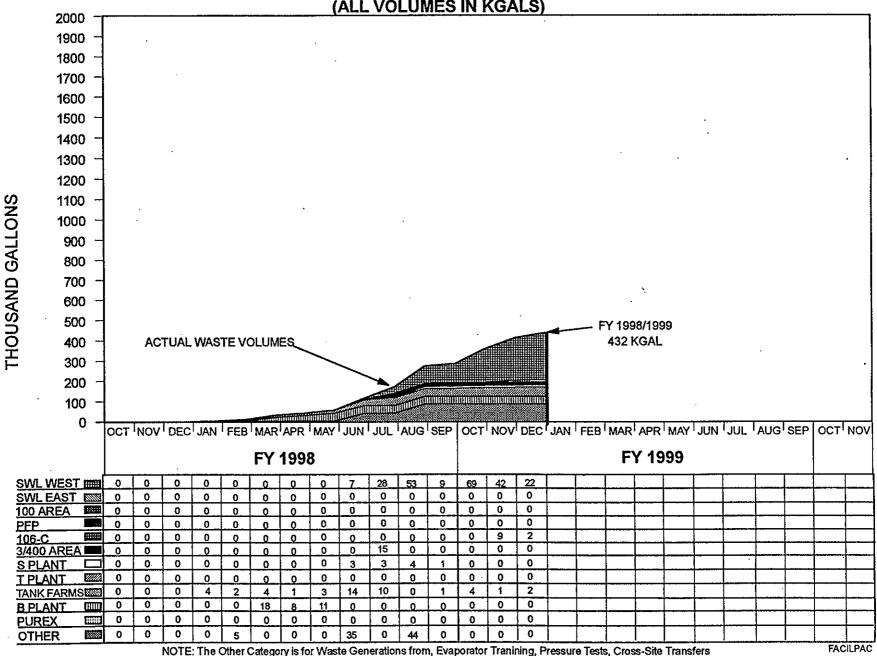


FIGURE F-1. COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES
(All volumes in Kgals)

This page intentionally left blank

APPENDIX G

MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

TABLE G-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements

December 31, 1998

FACILITY	LOCATION	PURPOSE (receives waste from:)	(Gallons)	MONITORED BY	REMARKS
EAST AREA 241-A-302-A	A Farm	A-151 DB	959	SACS/ENRAF	Foamed over Catch Tank pump pit & div. box to prevent intrusion
241-ER-311	B Plant	ER-151, ER-152 DB	7113	SACS/CASS/FIC	Rein
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Pumped 11/98
241-AZ-151	AZ Farm	AZ-702 condensate	7070	SACS/CASS/FIC	Volume changes daily - pumped to AZ-102 as needed
241-AZ-154	AZ Farm		25	SACS/CASS/MT	
244-BX-TK/SMP	BX Complex	DCRT - Receives from several farms	24634	SACS/MANUALLY	Using Manual Tape for tank
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	7214	MCS/SACS/WTF	WTF
A-350	A Farm	Collects drainage	465	MCS/SACS/WTF	WTF pumped as needed
AR-204	AY Farm	RR Cars during transfer to rec. tanks	325	DIP TUBE	Alarms on CASS
A-417	A Farm		11757	SACS/DIP TUBE	WTF - pumped 4/98
CR-003-TK/SUMP	C Farm	DCRT	3938	MT/ZIP CORD	
					intrusion, 1/98
WEST AREA					129
241-TX-302-C	TX Farm	TX-154 DB	320	SACS/CASS/ENRAF	_
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	8128	SACS/CASS/ENRAF	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	2092	SACS/CASS/ENRAF	•
241-S-304	S Farm	S-151 DB	150	SACS/CASS/ENRAF	Replaced S-302-A, 10/91; ENRAF installed 7/98
					Sump not alarming.
244-S-TK/SMP	S Farm	DCRT - Receives from several farms	16386	SACS/MANUALLY	CWF
244-TX-TK/SMP	TX Farm	DCRT - Receives from several farms	23276	SACS/MANUALLY	MT
Vent Station Catch		Cross Country Transfer Line	339	SACS/MANUALLY	MT
		Total Active Facilities 18	LEGEND:	DB Diversion Box	Angeles (parente en la companya del la companya de

Note: Readings may be taken manually or automatically by FIC (or ENRAF).

All FICs and manual ENRAFs connected to CASS. All tanks on CASS (either sure or manual) are also on the SACS database. If surtomatic connections to CASS are broken, readings are taken manually.

Manual readings include readings taken by manual tape, manual FIC, or manual readings of automatic FIC (if CASS is printing "0").

Readings may also be taken by zip cord, syltich are acceptable but less applicate.

339	SACS/MANUALLY	MT
LEGEND:	DB - Diversion Box	a necessitation of the property of the contract of the second
	DCRT - Double-Container	d Receiver Tank
	TK - Tank	an granda in the angular and standard consistent
	SMP - Sump	
	FIG - Food Instrument Co	orporation measurement device
	R8 - Robert Shaw instru	ment measurement device
	MFIC - Manual FIC	
	MT - Manual Tope	an communication in the communication of the commun
	CWF - Weight Fector/Sp	G = Corrected Weight Feator
	CASS - Computer Auton	nated Surveillance System
	SACS & Burvellance Aut	omated Control System
	MCS - Monitor and Cont	rol System
	D/S - Out of Service	
	ENRAF - Surface Level N	Assisting Device

INACTIVE - no longer receiving waste transfers
December 31, 1998

				MONITORE	ED ·
FACILITY.	LOCATION	RECEIVED WASTE FROM:	(Gallons)	BY	REMARKS
216-BY-201	BY Farm	TBP Waste Line	Unknown	NM	(216-BY)
241-A-302-B	A Farm	A-152 DB	5681	CASS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990, Rain intrusion
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-CX-70	Hot Semi-	Transfer lines	Unknown	NM	Isolated, Decommission Project,
241-CX-72	Works	Transfer lines	650	NM	See Dwg H-2-95-501, 2/5/87
241-ER-311A	SW B Plant	ER-151 DB	Unknown	NM	Isolated
244-AR VAULT	A Complex	Between farms & B-Plant	Unknown	NM	Not actively being used. Systems activated for final clean-out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	. 1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)
361-B-TANK	B Plant	Drainage from B-Plant	Unknown	NM .	Interim Stabilization 1985 (1)
		Total Fast Area inactive facilities	18		DB - Diversion Box DCRT - Double-Contained Receiver Tank

MT - Manual Tape

R - Usually denotes replacement NM - Not Monitored

TK - Tank SMP - Sump

CASS - Computer Automated Surveillance System

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

244-TXR-TK/SMP-002 TX Farm

244-TXR-TK/SMP-003 TX Farm

SE of U Plant

T Plant

U Plant

270-W

361-T-TANK

361-U-TANK

TABLE G-3. WEST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES

INACTIVE - no longer receiving waste transfers December 31, 1998

MONITORED

NM

NM

NM

NM

NM

				MONTONEL	,
<u>FACILITY</u>	LOCATION	RECEIVED WASTE FROM:	(Gallons)	<u>BY</u>	<u>REMARKS</u>
218-TY-201	E. of TY Farm	Supernate from T-112	Unknown	NM	Isolated
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, lest data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-\$-302	S Farm	240-S-151 DB	8536	CASS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	^ 0	CASS/FIC *	Assumed Leaker TF-EFS-90-042
			* FIC in Intrus	sion mode	Partially filled with grout 2/91, determined
					still assumed leaker after leak test
241-S-302-B	S Farm	S Encasements	Unknown	NM	Isolated 1985 (1)
241-SX-302	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-SX-304	SX Farm	SX-152 Transfer Box, SX-151 DB	Unknown	NM	Isolated 1985 (1)
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	1600	CASS/MT	New MT installed 7/16/93
241-TX-302B(R)	E. of TX Farm	TX-155 DB	Unknown	NM ·	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Unknown	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recupiex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM .	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S Farm	Pers. Decon. Facility	Unknown	NM	Isolated -
244-U-TK/SMP	U Farm	DCRT - Receives from several farms	Unknown	NM	Not yet in use
244-TXR VAULT	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)

Unknown

Unknown

Unknown

Unknown

Unknown

Total West Area mactive facilities

LEGEND: DB - Diversion Box . TB - Transfer Box DCRT - Double-Contained Receiver Tank TK - Tank SMP - Bump R - Usually denotes replacement FIC - Surface Level Monitoring Device MT - Manual Tape O/S - Out of Service CASS - Computer Automated Surveillance System NM - Not Monitored ENRAF - Surface Level Monitoring Device

isolated 1970

isolated 1985 (1)

Interim Stabilized, MT removed 1984 (1)

Interim Stabilized, MT removed 1984 (1)

Interim Stabilzed, MT removed 1984 (1)

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

Transfer lines

Transfer lines

Condensate from U-221

Drainage from T-Plant

Drainage from U-Plant

APPENDIX H

LEAK VOLUME ESTIMATES

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 5)
December 31, 1998

			Date Declared Confirmed or	Volume	Associated KiloCuries	Interim Stabilized	Leak i	Estimate
	Tank Number	·	Assumed Leaker (3)	Gallons (2)(4)	137 cs (10)	Date (12)	Updated	Reference
	241-A-103		1987	5500 (9)		06/88	1987	(j)
	241-A-104 241-A-105	(1)	1975 1963	500 to 2500 10000 to 277000	0.8 to 1.8 (q) 85 to 760 (b)	09/78 07/79	1983 1991	(a)(q) (b)(c)
	241-AX-102 241-AX-104		1988 1977	3000 (9) — (7)		09/88 08/81	1989 1989	(h) (g)
	241-B-101 241-B-103		1974 1978	(7) (7)		03/81	1989 1989	(g)
	241-B-105		1978	(7) (7)		02/85 12/84	1989	(g) (g)
	241-B-107 241-B-110		1980 1981	8000 (9) 10000 (9)		03/85 03/85	1986 1986	(d)(f)
	241-B-111		1978	- (7)		06/85	1989	(d) (g)
	241-B-112 241-B-201		1978 1980	2000	•	05/85	1989	(<u>a</u>)
	241-B-203		1983	1200 (9) 300 (9)		08/81 06/84	1984 1986	(e)(f) (d)
	241-B-204		1984	400 (9)		06/84	1989	(g)
	241-BX-101 241-BX-102		1972 1971	(7) 70000	50 (I)	.09/78 11/78	1989 1986	(g) (d)
	241-BX-108		1974	2500	0.5 (i)	07/79	1986	(d)
	241-BX-110 241-BX-111		1976 1984 (14)	- (7) - (7)		08/85 03/95	1989 1993	(g) (g)(r)
•	241-BY-103		1973	<5000		11/97	1983	(a)
	241-BY-105		1984 1984	(7)		N/A	1989	(g)
	241-BY-106 241-BY-107		1984	- (7) 15100 (9)		N/A 07/79	1989 1989	(g) (g)
	241-BY-108		1972	<5000		02/85	1983	(a)
	241-C-101 241-C-110		1980 1984	20000 (9)(11) 2000		11/83 05/95	1986 1989	(d) (g)
	241-C-111		1968	5500 (9)		03/84	1989	(g) (i)
	241-C-201 241-C-202	(5) (5)	1988 1988	550 450		03/82 08/81	1987 1987	(i) (i)
	241-C-203		1984	400 (9)		03/82	1986	(d)
-	241-C-204	(5)	1988	350	· · · · · · · · · · · · · · · · · · ·	09/82	1987	<u>(i)</u>
_	241-S-104 241-SX-104		1968 1988	24000 (9) 6000 (9)		12/84	1989	(g)
	241-SX-107		1964	< 5000 (a)		N/A 10/79	1988 1983	(k) (a)
	241-SX-108	(6)(15)	1962	2400 to 35000	17 to 140 (m)(q)(u)	08/79	1991	(m)(q)(u)
	241-SX-109	(6)(15)	1965	<10000	(11)(q)(u) <40 (n)(u)	05/81	1992	(n)(u)
	241-SX-110	(4.5)	1976 1974	5500 (9)	00.00	08/79	1989	(g)
	241-SX-111 241-SX-112	(15) (15)	1969	500 to 2000 30000	0.6 to 2.4 (l)(q)(u) 40 (l)(u)	07/79 07/79	1986 1986	(d)(q)(u) (d)(u)
	241-SX-113 241-SX-114		1962	15000	8 (1)	11/78	1986	(d)
	241-5X-114 241-SX-115		1972 1965	(7) 50000	21 (o)	07/79 09/78	1989 1992	(g) (o)
	241-T-101		1992	7500 (9)		04/93	1992	(p)
	241-T-103 241-T-106		1974 1973	<1000 (9) 115000 (9)	40 (I)	11/83 08/81	1989 1986	(g) (d)
	241-T-107		1984	(7)	- 2 (1)	Q5/96	1989	(g)
	241-T-108 241-T-109		1974 1974	<1000 (9) <1000 (9)		11/78 12/84	1980 1989	(f) (g)
2	241-T-111		1979, 1994 (13)	<1000 (9)		02/95	1994	(f)(t)
	241-TX-105 241-TX-107	(6)	1977 1984	(7) 2500	•	04/83 10/79	1989 1986	(g)
i	241-TX-110	(0)	1977	- (7)	•	04/83	1989	(d) (g)
	241-TX-113 241-TX-114		1974 1974	- (7) - (7)		04/83 04/83	1989 1989	(g) (g) (g)
- 1	241-TX-115	-	1977	(7)		09/83	1989	(g)
	241-TX-116 241-TX-117		1977 1977	(7) (7)		04/83 03/83	1989 1989	(g) (g)
_	241-TY-101		1973	<1000 (9)		04/83	1980	(g) (f)
- 3	241-TY-103		1973	3000	0.7 (1)	02/83	1986	(d)
	241-TY-104 241-TY-105		1981 1960	1400 (9) 35000	4 (1)	11/83 02/83	1986 1986	(d) (d)
2	241-TY-106		1959"	20000	2 (1)	11/78	1986	(d)
	241-U-101 241-U-104		1959 1961	30000 55000	20 (I) 0.09 (I)	09/79 10/78	1986 1986	(d) (d)
4	241-U-110		1975	5000 to 8100 (9)	0.05 (q)	12/84	1986	(d)(q)
2.0	241-U-112		1980	8500 (9)		09/79	1986	(d)
á	37 Tanks			<750,000 - 1,050,000	101			

TABLE H-1. SINGLE-SHELL LEAK VOLUME ESTIMATES (Sheet 2 of 5)

Footnotes:

- (1) Current estimates [see reference(b)] are that 610 Kgallons of cooling water was added to Tank 241-A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with <u>Dangerous Waste Regulations</u> [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 Kgallons to 277 Kgallons) is based on the following (see References):
 - 1. Reference (b) contains an estimate of 5 Kgallons to 15 Kgallons for the initial leak prior to August 1968.
 - 2. Reference (b) contains an estimate of 5 Kgallons to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.
 - 3. Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978 but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
 - 4. Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

	Low Estimate	High Estimate
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	0	232,000
Totals	10,000	277,000

- These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- In many cases, a leak was suspected long before it was identified or confirmed. For example, reference (d) shows that Tank 241-U-104 was suspected of leaking in 1956. The leak was "confirmed" in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, Tank 241-U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," "borderline" and "dormant," were merged into one category now reported as "assumed leaker." See reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) There has been an effort in the past few years to re-evaluate these leak volume estimates; however, the activity is not currently funded.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 3 of 5)

- (5) The leak volume estimate date for these tanks is before the "declared leaker" date because the tank was in a "suspected leaker" or "questionable integrity" status; however, a leak volume had been estimated prior to the tank being reclassified.
- (6) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicative of a continuing leak or movement of existing radio nuclides in the soil. There is no conclusive way to confirm these observations.
- (7) Methods were used to estimate the leak volumes from these 19 tanks based on the <u>assumption</u> that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallons), for an average of approximately 8 Kgallons for each of 19 tanks.
- (8) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (9) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (10) The curie content shown is as listed in the reference document and is <u>not</u> decayed to a consistent date: therefore, a cumulative total is inappropriate.
- (11) Tank 241-C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a "minimum heel" in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See references (q) and (s); refer to reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (12) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (13) Tank T-111 was declared an assumed re-leaker on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (14) Tank BX-111 was declared an assumed re-leaker in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (15) The leak volume and curie release estimates on SX-108, SX-109, SX-111, and SX-112 have been reevaluated using a Historical Leak Model [see reference (u)]. In general, the model estimates are much higher
 than the values listed in the table, both for volume and curies released. The values listed in the table do not
 reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to
 be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the
 issue of leak inventories with a new and different methodology." (This quote is from the first page of the
 referenced report). Therefore, an uncertainty analysis to determine the applicability of this methodology is
 currently in progress.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 4 of 5)

References:

- (a) Murthy, K.S., et al, June 1983, Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, Tank 241-A-105 Leak Assessment, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, Tank 241-A-105 Evaporation Estimate 1970 Through 1978, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, Single-Shell Tank Isolation Safety Analysis Report, SD-WM-SAR-006, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, Waste Status Summary, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford, Hanford Engineering Development Laboratory, Richland, Washington.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, Single-Shell Tank Leak Volumes, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, Liquid Level Losses in Tanks 241-C-201, -202 and -204, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R. and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Westinghouse Hanford Company, Richland, Washington.
- (k) Campbell, G. D., July 8, 1988, Internal Memorandum to R. K. Welty, Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (I) ERDA, 1975, Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, Tank 241-SX-108 Leak Assessment, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, Tank 241-SX-109 Leak Assessment, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, Tank 241-SX-115 Leak Assessment, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 5 of 5)

- (p) WHC, 1992d, Occurrence Report, Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC,1990b, A History of the 200 Area Tank Farms, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (f) WHC, 1993, Occurrence Report, Single-Shell Underground Waste Storage Tank 241-BX-111 Surface Level Decrease and Change From Steady State Condition, RL-WHC-TANKFARM-1993-0035, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1993a, Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (t) WHC, 1994, Occurrence Report, Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (u) HNF, 1998, Agnew, S. F. and R. A. Corbin, August 1998, Analysis of SX Farm Leak Histories Historical Leak Model, (HLM), HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico

APPENDIX I

INTERIM STABILIZATION STATUS CONTROLLED, CLEAN, AND STABLE STATUS

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (Sheet 1 of 3) December 31, 1998

		Interim	I	***			Interim	T			1	Interim	
Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.
Number	Integrity	Date (1)	Method		Number	Integrity	Date (1)	Method		Number	Integrity	Date (1)	Method
A-101	SOUND	N/A	***********		C-101	ASMD LKR	11/83	AR		T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/89	SN		C-102	SOUND	09/95	JET		T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	06/88	AR	*	C-103	SOUND	N/A			T-110	SOUND	N/A	
A-104	ASMD LKR	09/78	AR	***	C-104	SOUND	09/89	SN		T-111	ASMD LKR	02/95	JET
A-105	ASMD LKR	07/79	AR	*	C-105	SOUND	10/95	AR (5)	×	T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR		C-106	SOUND	N/A			T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A		<u> </u>	C-107	SOUND	09/85	JET		T-202	SOUND	08/81	AR
AX-102	ASMD LKR	09/88	SN		C-108 C-109	SOUND	03/84 11/83	AR		T-203 T-204	SOUND	04/81 08/81	AR AR
AX-103 AX-104	SOUND. ASMD LKR	08/87 08/81	AR AR	***	C-110	ASMD LKR	05/95	JET	×	TX-101	SOUND	02/84	AR
B-101	ASMD IKR	03/81	SN	***	C-111	ASMD LKR	03/84	SN		TX-101	SOUND	04/83	JET
B-102	SOUND	08/85	SN	***	C-112	SOUND	09/90	AR	***	TX-103	SOUND	08/83	JET
B-103	ASMD IKR	02/85	SN	***	C-201	ASMD LKR	03/82	AR	***	TX-104	SOUND	09/79	SN
B-104	SOUND	06/85	SN	***	C-202	ASMD LKR	08/81	AR		TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR	*	C-203	ASMD LKR	03/82	AR	×	TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN	*	C-204	ASMD LKR	09/82	AR		TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN		S-101	SOUND	N/A			TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN		S-102	SOUND	N/A			TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN	▓	S-103	SOUND	N/A		W	TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR		S-104	ASMD LKR	12/84	AR	w	TX-111	SOUND	04/83	JET
B-111	ASMD LKR	06/85	SN	*	S-105	SOUND	09/88	JET	***	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	***	S-106	SOUND	N/A		***	TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	※	S-107	SOUND	N/A		***	TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR		S-108	SOUND	12/96	JET (7)	***	TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR	8	S-109	SOUND	N/A			TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	06/84	AR		S-110	SOUND	01/97	JET (8)		TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR	***	S-111	SOUND	N/A			TX-118	SOUND	04/83	JET
BX-102	ASMD LKR SOUND	11/78 11/83	AR AR(2)	***	S-112 SX-101	SOUND	N/A N/A		**************************************	TY-101 TY-102	ASMD LKR SOUND	04/83 09/79	JET AR
BX-103 BX-104	SOUND	09/89	SN	**** ****	SX-101	SOUND	N/A		 	TY-102	ASMD LKR	03/73	JET
BX-104	SOUND	03/81	SN	**************************************	SX-102	SOUND	N/A		***	TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/95	SN	**** ****	SX-104	ASMD LKR	N/A		***	TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET	***	SX-105	SOUND	N/A		***	TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	***	SX-106	SOUND	N/A		*	U-101	ASMD LKR	09/79	AR
BX-109	SOUND	09/90	JET	※	SX-107	ASMD LKR	10/79	AR	※	U-102	SOUND	N/A	
8X-110	ASMD LKR	08/85	SN (4)	***	SX-108	ASMD LKR	08/79	AR	×	U-103	SOUND	N/A	
BX-111	ASMD LKR	03/95	JET	**	SX-109	ASMD LKR	05/81	AR		U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/90	JET		SX-110	ASMD LKR	08/79	AR		U-10 5	SOUND	N/A	
BY-101	SOUND	05/84	JET	***	SX-111	ASMD LKR	07/79	SN		U-106	SOUND	N/A	
BY-102	SOUND	04/95	JET	***	SX-112	ASMD LKR	07/79	AR	▓	U-107	SOUND	N/A	
BY-103	ASMD LKR	11/97	JET(10)		SX-113	ASMD LKR	11/78	AR	▓	U-108	SOUND	N/A	
BY-104	SOUND	01/85	JET	▓	SX-114	ASMD LKR	07/79	AR	▓	U-109	SOUND	N/A	
BY-105	ASMD LKR	N/A		▓	SX-115	ASMD LKR	09/78	AR		U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A		纞	T-101	ASMD LKR	04/93	SN	888	U-111	SOUND	N/A	
BY-107	ASMD LKR	07/79	JET		T-102	SOUND	03/.81	AR(2)(3)	***	U-112	ASMD LKR	09/79	AR
BY-108	ASMD LKR	02/85	JET		T-103	ASMD LKR	11/83	AR		U-201	SOUND	08/79	AR
BY-109	SOUND	07/97	JET(9)		T-104	SOUND	N/A	45	***	U-202	SOUND	08/79 08/79	SN
BY-110	SOUND	01/85	JET	***	T-105	SOUND	06/87	AR		U-203	SOUND		AR SN
BY-111	SOUND	01/85	JET		T-106 T-107	ASMD LKR	08/81 05/96	AR JET	****	U-204	SOUND	08/79	
BY-112 LEGEND:	SOUND	06/84	JET	***	1-10/	ASMD LKR	00/80	JEI	_				
	المرد والمرسوس الساسر		abilizad							Interim C	tabilized Tank	·e	119
AR = Administratively interim stabilized JET = Saltwell jet pumped to remove drainable interstitial liquid							nterim Stabili:		30				
1	Saitweii jet pui Supernate pum	•			miciett	ज्या कर्यवाच					viiii vanii		~
	Not yet interim	•	er bannbau	•,				Total Single-Shell Tanks 149				149	
	LKR = Assum	,								,-1			
				_									

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (sheet 2 of 3)

Footnotes:

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- Originally, seven tanks (B-104, B-110, B-111, BX-103, T-102, and T-112) did not meet current established supernatant and interstitial liquid interim stabilization criteria, but <u>did</u> meet the criteria in existence when they were declared interim stabilized.
 - B-110, B-111, U-110 were determined to have met current interim stabilization criteria, per WHC-SD-WM-ER-516-REV 0, "Interim Stabilization Status of SSTs B-104, B-110, B-111, T-102, T-112, and U-110," and WHC-SD-WM-ER-518-REV 0, "Investigation of Liquid Intrusion in 241-BX-103," both dated October 5, 1995.
 - B-104, BX-103, T-102, T-112 have been determined to meet current interim stabilization criteria as of September 30, 1996, per memo 9654456, J. H. Wicks to Dr. J. K. McClusky, DOE-RL.
 - <u>B-202</u> was determined to no longer meet the current established criteria for 200-series tanks due to a steady increase in the surface level indicating an ongoing intrusion based on a comparison of in-tank videos and subsequent evaluation in March 1996.
- (3) Original Interim Stabilization data are missing on four tanks: B-201, T-102, T-112, and T-201.
- (4) BX-110 was interim stabilized by Supernate Pumping in August 1985. Jet pumping began in December 1993 and soon stopped because of equipment failure. Due to low net volume pumped, major equipment failure, and ALARA, it was decided jet pumping would not resume. An in-tank video was taken in October 1994. Reevaluation after review of the video indicated 1.5 Kgallons of waste was pumped. (Almost 3 Kgallons of water flushes were needed to produce 1.5 Kgallons tank waste.)
- (5) C-105 was interim stabilized administratively on October 30, 1995. No jet pumping occurred in this tank, nor does interstitial liquid level data exist for this tank. There are no diptubes or LOWs installed. Approximately 12 Kgallons of liquid waste was evaporated between May 1993 and October 1995. An in-tank video taken August 30, 1995, revealed a shallow supernatant pool surrounded by a 5-8 foot solids waste shore. The volume of supernate is estimated as 2 Kgallons. The tank currently meets the established criteria for declaring single-shell tanks Interim Stabilized.
- (6) T-107 was interim stabilized by Jet Pumping in May 1996. Pumping was completed in March, and an in-tank video taken in May showed no supernate visible on the surface. The surface has an irregular contour of mostly sludge, and the elevation differences between high and low points appear to be about four inches.
- (7) S-108 was interim stabilized by Jet Pumping in December 1996. Pumping was completed in September and an in-tank video taken in December showed no supernate visible on the surface of the waste, which appears to be saltcake. The video shows a relatively level surface with some caving and crowning. Total waste is 448.7 Kgallons, with drainable liquids 4.0 Kgallons and no pumpable liquids.
- (8) S-110 was interim stabilized by Jet Pumping in January 1997. Pumping was completed in July 1996, and an in-tank video taken in December showed no supernate visible on the surface of the waste, which appears to be saltcake. The level is not consistent and there appears to have been some caving and crowning. Total waste is 389.0 Kgallons, with drainable liquids 29.8 Kgallons and pumpable liquids 23.4 Kgallons.
- (9) BY-109 was interim stabilized by Jet Pumping in July 1997. Pumping was completed in May 1997, and an intank video taken in June indicated there is a relatively uniform, slightly concave, crusty/cracked contour over most of the surface with no visible supernate. Total waste is 290.0 Kgallons, with drainable liquids 36.7 Kgallons, and pumpable liquids 20.3 Kgallons.

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (sheet 3 of 3)

(10) BY-103 was interim stabilized in November 1997, after completion of jet pumping in September. An in-tank video taken in February 1997 showed no visible surface liquid and no evidence of an intrusion. The waste was dry and flaky. Dried, caked waste was suspended from many of the pipes and pieces of process equipment. The overall surface of the waste seemed to slump slightly towards the center of the tank. Total waste is 414 Kgallons, with drainable liquids 38.3 Kgallons, and pumpable liquids 31.9 Kgallons.

TABLE I-2. TRI-PARTY AGREEMENT SINGLE-SHELL TANK INTERIM STABILIZATION SCHEDULE

December 31, 1998

As part of the Controlled, Clean, and Stable mission, the Single-Shell Tank Interim Stabilization Project goal is to mitigate the risk to the environment from a leak release from aging SSTs, by removing as much of the drainable liquid as practical, for safe storage prior to full waste retrieval.

New TPA milestones were negotiated effective September 23, 1996, to allow greater flexibility in the sequencing of tanks, in light of the latest technical information regarding tank waste safety status and watch list concerns.

Milestone	Description	Due Date	Actual Date	Comments
M-41-20	Start Interim Stabilization of 4 Single-Shell Tanks	9/30/96	3/24/96	S-108, S-110, T-104, and T-107 started.
M-41-21	Start Interim Stabilization of 2 Single-Shell Tanks	5/31/97 (1)	5/12/97	BY-109 started 9/10/96; T-110 started 5/12/97
M-41-22	Start Interim Stabilization of 6 Single-Shell Tanks	9/30/97 (2)(4)		BY-103 started 9/29/97, SX-104 started 9/26/97
M-41-23	Start Interim Stabilization of 8 Single-Shell Tanks	3/31/98 (3)(4)		
M-41-24	Start Interim Stabilization of 9 Single-Shell Tanks	9/30/98 (4)		
M-41 -2 5	Start Interim Stabilization of 3 Single-Shell Tanks	3/31/99 (4)		
M-41-26	Start Interim Stabilization of 2 Single-Shell Tanks	9/30/99 (4)		
M-41-27	Complete Saltwell Pumping of Single-Shell Tanks	9/30/00 (4)		
M-41-00	Complete Interim Stabilization of Single-Shell Tanks including Intrusion Prevention	9/30/00 (4)		·

- (1) On March 13, 1997, Department of Ecology (Ecology) approved Change Control Form M-41-96-03, extending M-41-21 from March 31 to May 31, 1997.
- (2) Change Control Form M-41-97-01 was sent to Ecology on June 27, 1997; Dispute Resolution invoked on July 16, 1997. This Change Request was denied by the Director of Ecology on February 10, 1998.
- (3) Change Control Form M-41-97-02 was sent to Ecology on December 29, 1997. Dispute Resolution invoked on January 13, 1998. This Change Request was denied by the Director of Ecology on March 10, 1998.
- (4) Path Forward Plan submitted to Ecology on April 15, 1998, projects completion date of September 30, 2004.

TABLE I-3. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY December 31, 1998

Partial Interim Isolated (PI)	Intrusion Preven	tion Completed (IP)	Interim Stabili	zed (IS)
EAST AREA	EAST AREA	WEST AREA	EAST AREA	WEST AREA
A-101	A-103	S-104	A-102	S-104
A-102	A-104	S-105	≨ A-103	S-105
	A-105		A-104	S-108
AX-101	A-106	SX-107	A-105	S-110
		SX-108	A-106	
BY-102	AX-102	SX-109		SX-107
BY-103	AX-103	SX-110	AX-102	SX-108
BY-105	AX-104	SX-111	AX-103	SX-109
BY-106		SX-112	AX-104	SX-110
BY-109	B-FARM - 16 tanks	SX-113		SX-111
	BX-FARM - 12 tanks	SX-114	B-FARM - 16 tanks	SX-112
C-103		SX-115	BX-FARM - 12 tanks	SX-113
C-105	BY-101			SX-114
C-106	BY-104	T-102	BY-101	SX-115
East Area (1979) Proposition 11 (1979)	BY-107	T-103	BY-102	
• .	BY-108	T-105	BY-103	T-101
WEST AREA	BY-110	T-106	BY-104	T-102
S-101	BY-111	T-108	BY-107	T-103
S-102	BY-112	T-109	BY-108	T-105
S-103	8	T-112	BY-109	T-106
S-106	ਊ C-101	T-201	BY-110	T-107
S-107	C-102	T-202	BY-111	T-108
S-108	€C-104	T-203	BY-112	T-109
S-109	C-107	T-204		T-111
S-110	C-108		C-101	T-112
S-111	∰C-109	TX-FARM - 18 tanks	C-102	T-201
S-112	C-110	TY-FARM - 6 tanks	C-104	T-202
	C-111		C-105	T-203
SX-101	C-112	U-101	C-107	T-204
SX-102	C-201	U-104	C-108	
SX-103	C-202	U-112	C-109	TX-FARM - 18 tanks
SX-104	C-203	U-102	C-110	TY-FARM - 6 tanks
SX-105	C-204	U-202	C-111	
SX-106	East Area 55	U-203	C-112	U-101
		U-204	C-201	U-104
T-101		West Area 53	C-202	U-110
T-104		****	C-203	U-112
T-107		ì	C-204	U-201
T-110			East Area 60	U-202
T-111	Controlled Class on	d Static (CCS)		U-203
	Controlled, Clean, an	n granie (CCS)		U-204
U-102	SEACT ADEA	MEST ADEA		West Area 59
U-103	EAST AREA	WEST AREA		Total 119
U-105	BX-FARM - 12 Tanks	TX-FARM - 18 tanks	,	
U-106	Englished	TY FARM - 6 tanks		
U-107 U-108	East Area 12	West Area 24 Total 36		
U-109		oual 30		•
U-109 U-110	Note: CCS activities ha	vya haan dafarrad		
,	until funding is availab		٠	
U-111 West Area 29	ह काचा मामलावि १२ अठवाञ्च०:	iç.		
Total 40				
I VVIII				
	•			

SINGLE SHELL TANK FARMS Interim Stabilization Progress Status

Interim Stabilized 119
Pumping In Progress 4
Retrieval 1
Pumping Planned 25
TOTAL SSTs 149

Status as of December 31, 1998 - Updated Quarterly

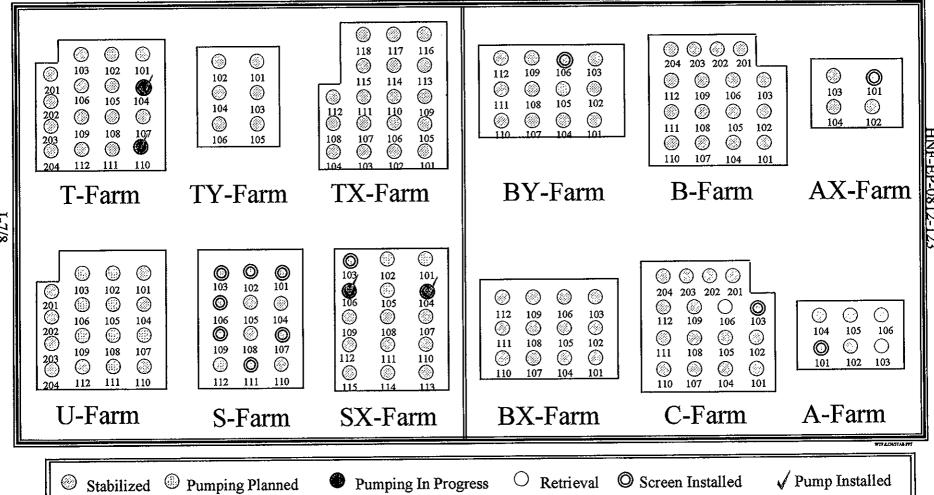


Figure I-1. SINGLE SHELL TANKS INTERIM STABILIZATION PROGRESS STATUS

APPENDIX J CHARACTERIZATION PROGRESS STATUS

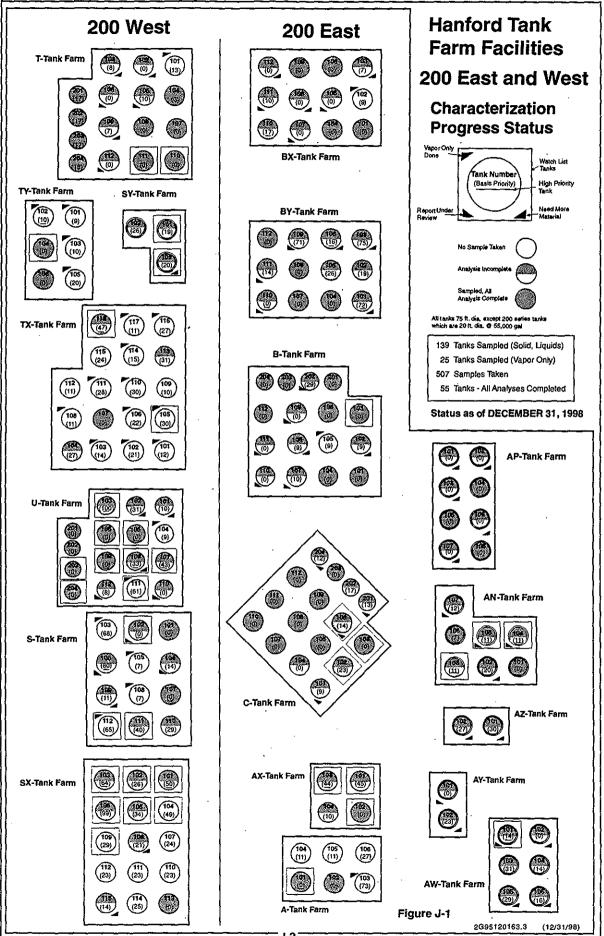


FIGURE J-1. CHARACTERIZATION PROGRESS STATUS CHART LEGEND (Sheet 2 of 2)

December 31, 1998

200 East/West	The chart divides the two areas.
Tank Farms	Each tank farm is represented by a rough schematic of the tank layout and a heading naming the farm.
Circles	Tanks are depicted by a circle for single-shell tanks and a double circle for double-shell tanks.
Boxes	A thin line box around a tank inside a tank farm denotes "Watch List" status, in concurrence with Table A-1 of this document.
Numbers in Circles	The top number is the tank number. The number in parentheses is a weighted priority number, described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." The numbers can be compared to each other to gain appreciation of relative priority: the higher the number, the greater the priority to sample and analyze.
Underlined Numbers	If a number in parenthesis is underlined, it is denoted as a "Characterization Basis Tank," as described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." These are key tanks taken from the priority list that are of principal interest to the Characterization Program.
Circle Shading	The shading in the circle indicates the degree to which sampling and analysis are complete per requirements described in applicable Data Quality Objectives (DQOs). If blank, no characterization sampling has taken place. If fully shaded, the sampling and analysis are complete for each DQO applicable to that tank. Tanks in which characterization has begun but is not complete are designated by being half shaded.
Corner Triangles	Small triangles near a tank circle give further information on half-shaded tanks. Upper left corner triangles indicate that vapor samples have been taken from the tank. Lower left-hand corner triangles indicate that the tank has been sampled, analyzed, and a formal report has been written on the condensed phase sampling. Further status of the tank will be determined after review of the report is complete. Lower right-hand corner triangles indicate that some review has been completed and it has been determined that more sampling is needed to resolve the DQO requirements. Absence of triangles from a half shaded tank indicates recent condensed phase sampling.

This page intentionally left blank

DISTRIBUTION

Number of copies

OFFSITE - USA

2 Congress of the United States

House of Representatives 1111 Longworth Building Washington D.C. 20515-3703

Ron Wyden, Member of Congress, 3rd District

House of Representatives 1431 Longworth House Office Building Washington D. C. 20515

Richard "Doc" Hastings, Member of Congress, 4th District

5 U. S. Department of Energy-Headquarters

1000 Independence Avenue, SW Washington, D. C. 20585

H. Calley EM-38 Cloverleaf Bldg.
Raymond Greenberg EM-38 Cloverleaf Bldg.
Kenneth Lang EM-36 Cloverleaf Bldg.
Ralph Lightener EM-38 Cloverleaf Bldg.
C. O'Dell EM-4 FORS/6E-034

1 U. S. Nuclear Regulatory Commission

Division of Fuel Cycle, Safeguards & Security Mail Stop T8-A33

Mail Stop 18-A33 Washington, DC 20555

Robert Pierson, Chief

2 Washington State Department of Ecology

Nuclear & Mixed Waste Management Program

P.O. Box 47600

Olympia, WA 98504-7600

Library

Nuclear Waste Program 300 Desmond Drive Lacey, WA 98504

R. Stanley

I Washington State Department of Health

Radiation Protection 7171 Cleanwater Lane Box 47827

Olympia, WA 98504-7827

Ed Bricker

1 Oregon State Department of Energy 625 Marion St. NE Salem, OR 97310 Dirk Dunning 1 Oak Ridge National Laboratory P. O. Box 2008 Oak Ridge, TN 37831-6180 MS-6180 C. Forsberg 1 Los Alamos National Laboratory P. O. Box 1663 Los Alamos, NM 87545 Stephen Agnew Group INC-14, J-586 1 Sandia National Laboratories 1515 Eubank, NE P. O. Box 5800 Albuquerque, NM 87185 Scott Slezak, Organization 2161, MS 0716 1 Donald T. Oakley 9612 Hall Road Potomac, MD 20854 1 Fluor Daniel, Inc. 3353 Michelson Drive Irvine, CA 92698 Charles Divona, 512T 1 Foster-Miller, Inc. Power Systems Technology Group 350 Second Avenue Waltham, MA 02154-1196 Maureen Williams 3 **National Research Council** 2101 Constitution Ave, N.W. Washington D. C. 20418

Robert S. Andrews, Senior Staff Officer, MS HA456

I Government Accountability Project
West Coast Office

1402 Third Avenue, Suite 1215

Seattle, WA 98101

Thomas E. Carpenter, Director

1 Heart of America Northwest

1305 Fourth Avenue Cobb Building Suite 208 Seattle, WA 98101

Gerald M. Pollet, Executive Director

TRI-CITIES:

1 TRW Environmental Systems

507 Knight St, Ste A Richland, WA 99352

Mike Leonard

1 Foster Wheeler Environmental Corp.

3200 George Washington Way, Suite G

Richland, WA 99352

R. J. Roberts

1 ARES Corporation

636 Jadwin Ave., Suite B Richland, WA 99352

Lewis Muhlestein

1 Babad Technical Services

2540 Cordoba Court Richland, WA 99352

1 Vista Research, Inc.

3000 George Washington Way, Suite 2C

Richland, WA 99352

Phil Ohl

1 Wastren Inc.

1050 Gilmore Ave, Suite C Richland, WA 99352

Gary Dunford

I R. K. Welty

409 S. 41st Ave

West Richland, WA 99353

ONSITE

1	BAI R. T. Winward	A2-22	
1	Jacobs Engineering Grou Ruth Schreiber	<u>ip, Inc.</u> . B2-05	
2	MACTEC - Meier Assoc		
•	J. D. Bingham	R2-11 .	
	T. E. Jones	H6-12	
2	MACTEC - ERS		
	J. F. Bertsch	B1-42	
	J. R. Brodeur	B1-42	
1	MACTEC		
	S. M. Blacker	R3-75	
1	General Accounting Office	<u>ce</u>	
	C. R. Abraham	A1-80	
2	Washington State Depart	ment of Ecology	
	Tony Valero	B5-18	
	Library	B5-18	
1	U. S. Environmental Prot		
	D. R. Sherwood	B5-01	
22	U. S. Department of Ener	gy-Richland Operations Of	fice
	S. R. Brechbill	A4-52	
	D. C. Bryson	S7-41	
	J. M. Clark	S7-54	
	J. J. Davis	A0-21	
	T. P. Pietrok	K8-50	
	R. G. Harwood	S7-54	
	R. L. Higgins	S7-53	
	R. D. Hildebrand	H0-12	
	D. H. Irby	S7-54	
	J. E. Kinzer	S7-50	
	C. Pacheco	S7-54	
	T. E. Olds	A7-75	
	S. H. Pfaff	\$7-50	
	G. M. Ramin	A2-22	
	G. W. Rosenwald	S7-54	
	M. J. Royack	S7-54	
	A. B. Sidpara	S7-53	
	R. A. Stolberg	A4-81	•
	K. G. Wade	S7-53	
	D. J. Williams	S7-41	
	D. D. Wodrich	S7-50	
	Reading Room	H2-53	

9	Pacific National Northwest Labor	atories
	S. A. Bryan	P7-25
	T. A. Ferryman	K5-12
	R. E. Gephart	K9-76
	S. A. Hartley	K5-12
	J. L. Huckaby	K6-80
	C. M. King	P7-25
	A. F. Noonan	K9-91
	B. E. Opitz	K6-75
	L. A. Smyser	A0-21
132	Fluor Daniel, Inc., and Affiliated	Companies
152	D. I. Allen	R2-50
	D. G. Baide	S5-05
	R. W. Bechtol	A3-05
•	D. B. Bechtold	T6-07
	L. Bedford	R2-84
	M. V. Berriochoa	B3-30
	T. M. Blaak	S5-13
	H. L. Boston	G3-21
	V. C. Boyles	R2-11
	C. B. Bryan	T4-07
	N. K. Butler	R3-01
	J. W. Cammann	R2-11
	K. G. Carothers	R2-11
	R. J. Cash	S7-14
	W. L. Cowley	R1-49
	C. Defigh-Price	R2-12
	D. K. DeFord	S7-20
	M. P. Delozier	R2-58
	M. L. Dexter (10)	R1-51
	R. A. Dodd	S5-07
	J. G. Douglas	H3-26
	A. C. Etheridge	H7-07
	S. D. Estey	R2-11
•	K. D. Fowler	R2-11
	G. R. Franz	S7-40
	G. T. Frater	K9-46
	L. A. Gaddis	H5-57
	K. A. Gasper	A3-03
	J. E. Geary	S6-71
	T. C. Geer	R1-43
	M. S. Gerber	B3-26
	B. C. Gooding	T4-01
	D. R. Groth	T4-15
	R. D. Gustavson	R2-54
	M. D. Guthrie	S6-72
	J. C. Guyette	S7-40
	C. C. Haass	R1-04
	D. B. Hagmann	R2-89
	B. K. Hampton	S7-40
	B. M. Hanlon (10)	T4-08
	G. N. Hanson	S5-07
	R. A. Harding	R1-56
	W.M. Harty Jr.	S5-13
	D.C. Hedengren	R2-11
	D.C. Hedengren	NZ-11

B. A. Higley	H5-49
K. M. Hodgson	R2-11
J. L. Homan	R3-25
G. P. Hopkins	S5-03
W. G. Hopkinson	R2-50
S. E. Hulsey	· S5-12
M. N. Islam	R1-43
O. M. Jaka	S5-12
P. Jennings	R2-84
R. D. Jensen	B3-53
G. D. Johnson	S7-14
J. Kalia	R1-43
R. A. Kirkbride	R3-73
P. F. Kison	T4-07
N. W. Kirch	R2-11
J. S. Konyu	R4-04
J. G. Kristofzski	S7-01
M. J. Kupfer	H5-49
M. A. Lane	S2-47
M. D. LeClair	R3-75
J. A. Lechelt	R2-11
J. W. Lentsch	R2-50
G. T. MacLean	R3-73
D. J. McCain	R2-12
M. A. McLaughlin	H8-67
W. H. Meader	H8-66
P. J. Morgan (2)	S7-40
M. A. Payne	R2-58
L. T. Pedersen, Jr.	R1-56
R. E. Pohto	R1-30 R2-84
R. S. Popielarczyk	S7-01
R. L. Powers	S5-13
T. B. Powers	R3-15
C. J. Rice	R2-50
R. E. Raymond (2)	R2-38
D. S. Rewinkel	\$7-40
W. E. Ross	S7-40
K. Sathyanarayana	H0-34
D. J. Saueressig	S8-05
J. S. Schoffeld	\$7-12
E. B. Schwenk, Jr.	L6-38
N. J. Scott-Proctor	S5-01
J. E. Shapley	B4-46
J. P. Shearer	H0-20
D. H. Shuford	S7-03
E. R. Siciliano	B4-43
W. J. Stokes	R3-75
J. N. Strode	R2-11
R. R. Thompson	R2-12
A. M. Umek	S7-40
J. E. Van Beek	S2-48
T. B. Veneziano D. T. Vladimiroff	S7-40
	S7-20
J. A. Voogd	H6-37
D. J. Washenfelder	S7-40
A. B. Webb	RI-44
K. A. White	S5-13

A. E. Young (6)	R1-10
F. A. Zak	R3-01
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S5-04
Environmental	
Data Mgmt Center (2)	H6-08
Unified Dose Assessment	
Center (UDAC)	A0-20
Document Processing Center	A3-94